


# MetLogix

## M<sup>3</sup>

### Version 4

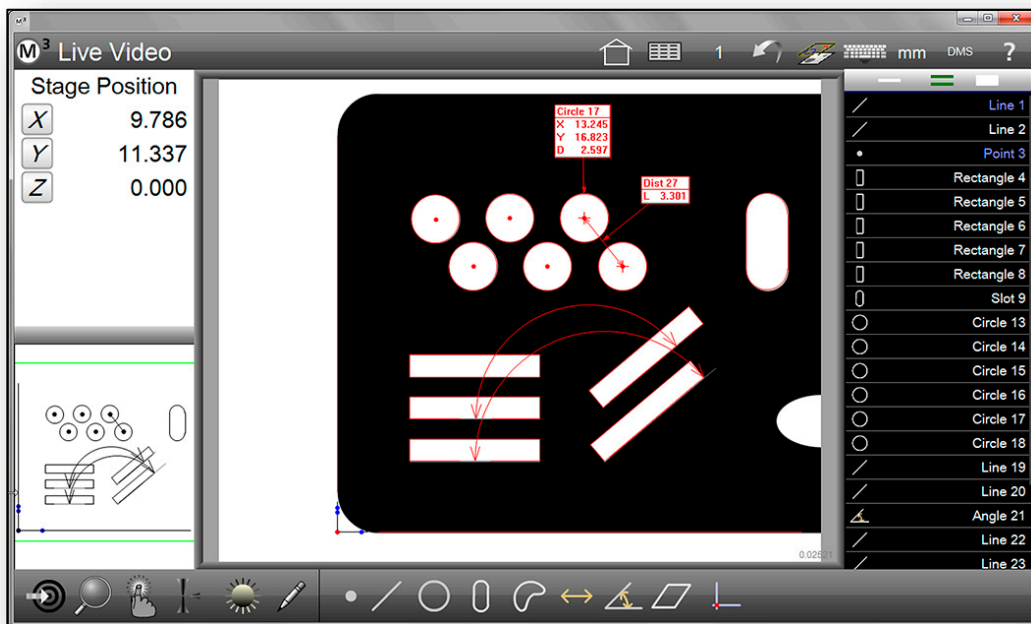

## Video and FOV Inspection Software

---

### *User's Guide*





# **M3 Version 4**

## **Video Inspection Software**

### ***User's Guide***

Crosshair, Video Edge Detection and Field of View System

MetLogix Incorporated  
175 Canal Street  
Manchester, NH 03101. USA  
Telephone 603.836.4452  
Fax 603.369.6499  
[info@MetLogix.com](mailto:info@MetLogix.com)  
[www.MetLogix.com](http://www.MetLogix.com)





# **M3 Version 4 Crosshair, Video Edge Detection and Field of View System User's Guide**

Published by:

MetLogix Incorporated

175 Canal Street

Manchester, NH 03101. USA

User's Guide part number: 15008-00 Revision 7

Publishing date: November 2021

Printed in United States of America

Copyright © 2021 by MetLogix, Incorporated., Manchester, New Hampshire

M3 software version: 4.xx.xx

All information set forth in this document, all rights to such information, any and all inventions disclosed herein and any patents that might be granted by employing the materials, methods, techniques or apparatus described herein are the exclusive property of MetLogix, Incorporated, Manchester, New Hampshire.

Terms, conditions, and features referenced in this document are subject to change without notice.

No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, without prior written permission of MetLogix, Inc. Requests to MetLogix, Inc. for permission should be addressed to the Customer Services Department, MetLogix, Incorporated. 175 Canal Street, Manchester, New Hampshire 03101.

## **Limit of liability and disclaimer of warranty**

While this guide was prepared with great care, MetLogix makes no representations or warranties with respect to the accuracy or completeness of the contents of this book and specifically disclaims any implied warranties of merchantability or fitness for a particular purpose. The advice, methods and instructions contained in this book might not be suitable for your situation. When in doubt regarding suitability, you are encouraged to consult with a professional where appropriate. MetLogix shall not be liable for any loss of profit or any damages, including but not limited to special, incidental, consequential or other damages.

## **Trademarks**

MetLogix, is a registered trademark of MetLogix, Incorporated. Windows is a registered trademark of the Microsoft Corporation in the United States and other countries.

# Introduction

The M3 Version 4 Video Inspection Software User Guide describes the operation of the M3 precision measuring software for software versions 4.00.00 and above. The encoder-based systems support manual part positioning and feature measurement under user control, and CNC part positioning and automated measurement under program control. Field of view systems do not include encoders or support CNC operations; all measurements are performed in the video field of view. While many M3 functions are common to encoder-based and field of view systems, there are some important functions that are unique to one or the other of the two systems. The organization of information in this user guide is shown below. Touch probe support is provided as an option in some CNC enabled systems.

## User guide organization

Section	Content	Systems
1	Overview	Encoder and Field of View
2	User Interface	Encoder and Field of View
3	Probes	Encoder and Field of View
4	Measuring, Constructing and Creating Features	Encoder and Field of View
5	Image Stitching	<b>Encoder systems only</b>
6	Feature List and Part View	Encoder and Field of View
7	Reference Frames	Encoder and Field of View
8	Tolerancing	Encoder and Field of View
9	Reporting Data	Encoder and Field of View
10	Exporting Data	Encoder and Field of View
11	Programming	<b>Encoder (includes CNC) and Field of View (no CNC)</b>
12	Field of View Functions	<b>Field of View Systems Only</b>

While it is likely that this Guide includes some material that doesn't apply to your specific M3 system, most concepts explained here can easily be applied to all M3 systems.

The concepts explained in this Guide are necessary for the operation of any M3 system. Operators and supervisors will find the contents invaluable in conducting measurements, programming automatic functions and reporting results. A few user setup functions are also described that will help users and supervisors customize the M3 measurement tools, user interface screens and report formats.

## Prerequisites

Operators and supervisors are assumed to understand dimensional metrology theory and practice and have a good working knowledge of the Microsoft Windows operating system use and conventions.

## Conventions & Terms

The term "M3 system" refers to the M3 software and the measuring hardware connected to it.

## Icons

This guide uses the following icons to highlight information:

# WARNINGS



The raised hand icon warns of a situation or condition that can lead to personal injury or death. Do not proceed until the warning is read and thoroughly understood.

# CAUTIONS & IMPORTANT INFORMATION



The exclamation point icon indicates important information regarding equipment operation or maintenance, or a situation or condition that can lead to equipment malfunction or damage. Do not proceed until the information is read and thoroughly understood.

# NOTES



The question mark icon indicates important supplementary information about an activity or concept.

## Menu path navigation


Many references are made in this guide to measurement tools that are displayed by touching or clicking the mouse cursor on a series of toolbar buttons and menu items. This kind of navigation path and the shorthand used to describe it is demonstrated in this example of displaying the Measure Skew button of the Datum menu, accessed through the Measure toolbar. The long form instruction to perform this operation is:

**Press or click the Datum button of the Measure toolbar and then press or click the Skew button.**

The shorthand that will be used in instructions to describe this operation is:

**Measure toolbar > Datum button > Skew**

A graphic representation of the operation is shown below.

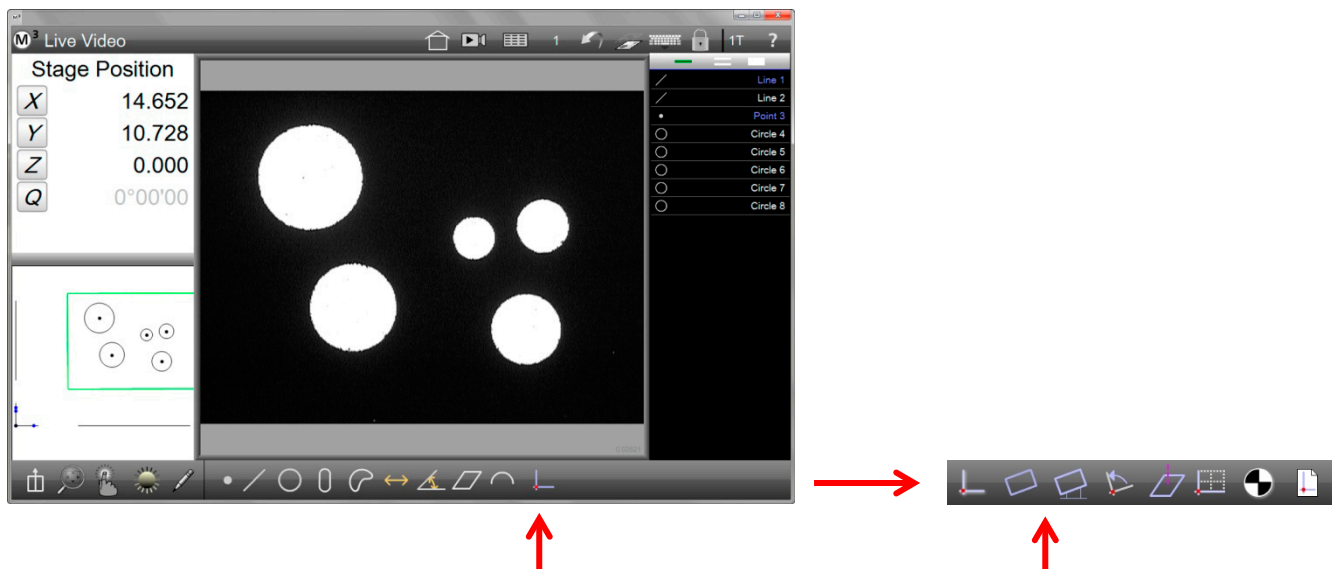



## NOTE

*Toolbar buttons can be touched with a fingertip or clicked with a mouse cursor in M3 touchscreen systems. Instructions in this guide will use the term “press” to indicate a finger press or mouse click.*

# Getting Help

Help is available in this guide, in the electronic version of this guide accessed from the Help menu (question mark icon) of the System toolbar, from your MetLogix distributor or system provider and from our product support page at [www.MetLogix.com](http://www.MetLogix.com).

Should it become necessary to contact your MetLogix distributor or system provider, be prepared to supply the following information:

- The M3 software version number can be found in the About Settings screen accessed through the M3 System menu (M3 logo in the System toolbar).

### **M3 System menu > Settings > About**

- Information describing the measuring system hardware can be found in the Hardware Settings screen also accessed from the About Settings screen.

### **M3 System menu > Settings > About**

- A detailed description of the problem and steps that you've taken to resolve it





## Contents

Section 1: System Overview .....	1
Section 2: User Interface .....	3
User Interaction .....	3
Viewports and Screen Organization .....	3
Screen Viewport Navigation .....	3
Live Video Screen .....	4
Measure Feature Screen .....	4
Part View Screen .....	5
Feature Detail Screen .....	6
Report (Run Results) Screen .....	6
Toolbars, Menus and Function Buttons .....	7
Measure Toolbar .....	7
Feature Measurement Menus .....	7
Change Feature Type Button .....	10
Part View Markup Menu .....	10
Part Lighting Controls .....	11
Autofocus Mode Button .....	11
Probe Menu .....	11
Zoom Menus .....	11
Goto Move Button .....	12
Extra Menu .....	12
System Toolbar .....	13
System menu .....	13
Main viewport indication .....	14
Home View Button .....	14
Freeze Live Video Images Button .....	14
Image Stitching Button .....	14
Report Button .....	15
Video Magnification Indication .....	15
Undo Button .....	15
Help Button .....	15
Report Toolbar .....	15

# Video Inspection Software User's Guide

Edit Cells Button .....	16
Report Format Menu .....	16
Hide Row Button .....	16
Export Data Menu .....	16
Report Filters Menu .....	17
Import DXF Nominals .....	17
Statistics .....	17
Pivot View .....	17
Delete Run Results .....	17
Program Edit Toolbar .....	17
Play Button .....	18
Play From Here Button .....	18
Record Into Button .....	18
Re-measure Feature Button .....	18
Step and Repeat Button .....	18
Ask Button .....	18
Delete Program Step Button .....	18
Feature List .....	18
Section 3: Probes .....	19
Crosshair Probes .....	19
Multipoint Video Probes .....	19
Touch Probes .....	19
Points Required for Single Point Probing .....	20
Points .....	20
Lines .....	20
Circles and Arcs .....	20
Slots and Rectangles .....	20
Blobs .....	20
Distances .....	20
Angles .....	20
Planes and Datum Planes .....	20
Spheres .....	20
Cylinders .....	20
Cones .....	21
Axis (3D Line) features .....	21
Datum Point Features .....	21



# Video Inspection Software User's Guide

Skew Features .....	21
Using Video Probes .....	21
Video Probe Scanning .....	21
Standard Crosshair Probe .....	21
Simple Active Crosshair Probe .....	22
Vtouch Probe .....	22
MeasureLogic Probe .....	22
EyeMeasure Probe .....	22
Nearest Furthest Probe .....	25
Auto Point Entry .....	25
Auto Focus Mode .....	26
Auto Focus States .....	26
Focus Assist .....	26
Auto Focus Measurements .....	28
Setting the Number of Points Captured by Multipoint Probes .....	32
Using Video Probes Effectively .....	32
Video Probe Terms and Functions .....	32
Advanced Edge Teach .....	34
Inspection Example Images .....	36
Low Edge Contrast and Uniform Edge Form .....	36
Probe behavior in program playback .....	38
Pattern Recognition .....	39
Teaching a pattern .....	39
Datum Pattern Measurement .....	39
Standard Pattern Measurement .....	40
Pattern Recognition in Program Playback .....	40
Viewing the Image Source for Pattern Features .....	41
Using Touch Probes .....	41
Straight, Disc, Cylinder and Star Probes .....	41
Making Probe Contact .....	41
Touch Probe Setup Operations .....	42
Calibrating a Probe Tip .....	42
Calibrating using the Contact Probe Settings Screen .....	42
Calibrating using the Probe Teach Function .....	43
Adding a Probe Tip .....	43
Removing a Probe Tip .....	44

# Video Inspection Software User's Guide

Editing a Probe Tip .....	44
Changing the probe Tip Name .....	45
Assigning a Tip Type .....	45
Designating the Probe as a Reference .....	45
Changing the Current Probe Tip .....	45
Configuring Probe Path Data .....	46
Section 4: Measuring, Constructing and Creating Features .....	47
Explicit and Automatic Measurement .....	47
Feature Constructions .....	47
Feature Creation .....	47
Preparing for Measurement Activities .....	48
Lighting Adjustment .....	48
Image Processing .....	48
Calibrating a Touch Probe Tip .....	51
Configuring (Touch) Probe Path Data .....	51
Teaching Video Edge Recognition .....	51
Establishing a Reference Frame .....	51
Part Leveling .....	51
Skew Alignment .....	52
Part Datum .....	52
Probing a Part Datum Point .....	52
Constructing a Skew and Part Datum Point from Parent Features .....	52
Skew .....	52
Datum Point .....	53
Creating a Datum by Manually Zeroing the X and Y Coefficients of a Feature .....	53
Probing and Measuring Features .....	54
Single Point Probing .....	54
Multipoint Probing .....	54
Probing Features .....	55
Probing Features with the Crosshair Probes .....	55
Probing Features with a Touch Probe .....	55
Probing Features with the Simple Active Crosshair probe .....	55
Probing Features with the MeasureLogic Probe .....	56
Probing Features with the EyeMeasure Probe .....	56
Probing and Measuring Blobs .....	56
Repeat Mode Feature Measurements .....	58

# Video Inspection Software User's Guide

Probing Features that Extend Beyond the Field of View .....	58
Multi-feature measurements .....	59
Multi-Measure Tool Filters .....	60
An example of using the Multi-Measure tool .....	61
Pattern Recognition.....	61
Teaching a pattern .....	61
Registration Pattern Measurement .....	62
Standard Pattern Measurement .....	62
Pattern Program Playback .....	63
Viewing the Image Source for Pattern Features .....	63
Goto Move Function .....	64
Enabling the Goto Move Function.....	64
Goto Position (Absolute/Relative) .....	64
Goto Feature .....	65
Goto Part View location.....	65
Constructing Features .....	66
Point Constructions .....	66
Circle Constructions .....	67
Arc Constructions .....	67
Line Constructions .....	67
Axis (3D Line) Constructions .....	68
Angle Constructions .....	68
Distance Constructions .....	68
3D Distance Constructions .....	68
Plane Constructions .....	69
Sphere Constructions.....	69
Cylinder and Cone Constructions .....	69
Feature Construction Procedures .....	69
Construction Procedures for Gauge Circle and Gauge Line .....	69
Gauge circle between two lines .....	69
Gauge circle between two arcs .....	70
Gauge line between two lines.....	70
Construction Procedures for all Other Features .....	70
Changing Constructed Feature Type.....	70
Creating Features .....	72
Formula Results via Calc Feature .....	73
An example of using the Calc feature .....	73

# Video Inspection Software User's Guide

Editing a Calc Feature Result:.....	74
Using a Calc feature as a variable: .....	75
Using a variable in program GoTo step:.....	75
Global Variables: .....	76
Section 5: Image Stitching .....	77
Stitching a Super Image .....	77
Enabling Image stitching.....	77
Rectangular Image Stitching.....	77
Free Form Image Stitching .....	78
Preset Stage Stitching .....	79
Opening a DXF Overlay over a Stitched Image .....	80
Stitching a Super image Within a Part Program.....	82
Section 6: Feature List, Feature Detail and Part View Functions .....	83
The Feature List .....	83
Displaying Part Name and Run Numbers.....	83
Displaying Features .....	84
Scrolling the Feature List.....	84
Selecting features .....	84
Feature Finder.....	84
Deleting Features from the Feature List .....	86
Feature Detail screen .....	87
Part View Screen.....	89
Accessing the Part View screen .....	89
Selecting Features in the Part View screen.....	89
Zooming and Panning.....	90
Adding Feature Annotations .....	90
Adding Box Markups.....	91
Adding Text Markups .....	91
Enhanced Data Cloud Display.....	92
An example for adding Data Cloud Markup to the part view.....	93
3D Viewing.....	95
Displaying 3D Part Views.....	95
Rotation and elevation view controls .....	96
Preset 3D Views .....	97
The Part View Overlay .....	97
Section 7: Reference Frames .....	99
Establishing a Reference Frame .....	99

# Video Inspection Software User's Guide

Part Leveling .....	99
Skew alignment.....	100
Datum Creation .....	100
Probing a Part Datum Point .....	101
Constructing a Part Datum Point from one or more Parent Features.....	101
Creating a Datum by Manually Zeroing the X and Y Coefficients of a Feature .....	101
Rotating and Offsetting a Reference Frame .....	102
Rotating the Measurement Reference Frame.....	102
Offsetting the Skew Alignment.....	102
Managing Multiple Reference Frames.....	103
Unsaved Reference Frames .....	104
Saving Reference Frames .....	104
Locking and Unlocking Features from their Reference Frames .....	104
Registration Datum .....	105
Saving and loading reference frames to and from a file .....	105
Section 8: Tolerancing.....	107
Supported Tolerances .....	107
Applying Tolerances to a Single Feature.....	108
Keypad Entry of Nominal Values .....	109
Select Feature and go to the Nominal Feature Detail screen .....	109
Enter Nominal Values using the Keypad .....	109
Go to the Tolerance Screen, Select and Enter Tolerance .....	109
Go to the Deviation Screen to Observe Results .....	110
Entering Nominal Values using Auto-Round .....	110
Entering Nominal and Tolerance Values using Place Tolerancing.....	111
Importing Nominal Values from a DXF Drawing File .....	113
Applying Tolerances to a Group of Features.....	115
Quick Tolerance Functions .....	116
Configuring Preset Tolerance Values .....	116
Accessing the Quick Tolerance Functions.....	117
Interactive Mode.....	117
Program Edit Mode .....	117
Applying Quick Tolerances .....	118
Applying Nominal Values and Tolerances to Individual Coefficients.....	118
Applying Nominal Values and Tolerances to Multiple Feature Coefficients.....	119
Section 9: Reporting Data and the Results Screen.....	121
Report Template Formats .....	121

# Video Inspection Software User's Guide

Selecting a Report Format .....	121
Editing Report Templates .....	122
Accessing Report Template Editing Functions .....	122
Displaying Report Edit Functions .....	123
Adding or Deleting Template Categories (Columns) .....	124
Changing Column Order and Column Width .....	125
Increasing or Decreasing Horizontal Lines .....	125
Increasing or Decreasing Vertical Lines .....	126
Changing the Number of Feature Names for European Templates .....	126
Changing the Row Height .....	127
Resetting Template Modifications to the Factory Default .....	127
Discarding Changes Before Saving .....	127
Saving Template Changes as the New Default .....	127
User Defined Report Templates .....	128
Editing Report Cells .....	128
Hiding Report Data .....	129
Customizing Printed Reports .....	130
Specifying Printout Settings .....	130
Results View Visual Review Tools .....	132
Pivot view .....	132
Pinning Coefficient Data .....	132
Statistics .....	133
Results View Statistics .....	133
Pivot View Statistics .....	134
Run Zero Tab .....	135
Delete Tab .....	135
Results Statistical Analysis Feature .....	135
An example of using the Statistical Analysis feature: .....	136
Section 10: Exporting Data .....	138
Specifying Export Settings .....	138
Exporting a Data File .....	139
Direct Data Transfer to Excel .....	139
Direct to New Sheet Export .....	139
Export to Existing/Custom Excel Sheet .....	140
An example of exporting to new Excel sheet .....	141
An example of exporting to a custom Excel sheet .....	141
Section 11: Programming .....	143

# Video Inspection Software User's Guide

Part Fixturing Modes.....	144
No Part Fixturing .....	144
Temporary Part Fixturing .....	144
Permanent Part Fixturing .....	144
Creating a Part Program.....	145
Adjusting Probe Path Data.....	145
Inserting Goto Steps .....	146
Saving a Part Program .....	147
Loading a Program for Playback .....	148
Playing a Program .....	149
Playing Programs with Permanent Fixtures (CNC only).....	149
Playing Programs with a Temporary or no Fixture .....	149
Editing programs.....	150
Initiate Edit Mode .....	151
Change Program Properties .....	151
Change CNC Probe Path Data .....	152
Edit Goto Moves.....	152
Change Lighting .....	152
Edit VED probes.....	152
Change Magnification .....	153
Change Feature Tolerances .....	153
Examining feature step details .....	153
Play Program .....	153
Play from Here .....	153
Add Program Steps.....	154
Add Program Steps.....	154
Enable or Disable CNC Clearance Moves.....	154
Re-measure Feature Steps.....	155
Add CNC Step and Repeat steps .....	155
Step and Repeat function .....	156
Cartesian Step and Repeat .....	156
Polar Step and Repeat.....	157
Adding a User Message or Request Data .....	157
Adding User Messages and Images.....	158
Requesting User Data (Variables) .....	159
Deleting Program Steps.....	160
DXF Import and Auto Programming.....	161

# Video Inspection Software User's Guide

Cut/Copy/Paste Program Steps.....	161
Pallet Program Creation.....	162
Pallet Program Creation with a loaded reference frame from file.....	163
Editing a pallet program .....	164
Section 12: Field of View (FOV).....	165
M3 Measurement and Other Functions .....	165
Functions unique to field of view systems .....	165
Auto Play.....	165
Program Finder .....	165
Auto Play Use of the Program Finder.....	165
Verifying Auto Play Use of Program Finder .....	166
Motion Monitor .....	166
Operation Example .....	166
Measuring and Saving A Part Program .....	166
Playing a Part Program without Program Finder .....	168
Adding a Part to the Program Finder .....	169
Adding a Part Program with Auto Play .....	169
Adding a Part Program without Auto Play .....	170
Playing Programs using Program Finder and Auto Play .....	171
Playing a Program Without Auto Play.....	171
Playing a Program with Auto Play.....	171
Playing Programs to Measure Multiple Identical Parts .....	172
Editing Program Properties to Measure Multiple Parts.....	172
Playing the Program with Multiple Parts .....	173
Product Warranty .....	175
SOFTWARE LICENSE AGREEMENT .....	177
1. Definitions.....	178
2. Software License.....	178
2.1 Limited Use .....	178
2.1.1 .....	178
2.1.2 .....	178
2.1.3 General Use .....	179
2.1.4 Distribution from a Server .....	179
2.1.5 Dual Boot Platform .....	179
2.1.6 Documentation .....	179
3. Intellectual Property Ownership .....	179
4. Restrictions and Requirements .....	179



# Video Inspection Software User's Guide

4.1	Notices .....	179
4.2	Use Obligations .....	179
4.3	No Modifications .....	179
4.4	No Reverse Engineering .....	179
4.5	No Unbundling .....	179
4.6	No Transfer .....	180
4.7	No Service Bureau .....	180
4.8	MetLogix M Series Restrictions .....	180
5.	Updates .....	180
6.	Limited Warranty .....	180
7.	Disclaimer .....	181
8.	Limitation of Liability .....	181
9.	Export Rules .....	181
10.	General Provisions .....	182
11.	Notice to U.S. Government End Users .....	182
12.	Compliance with Licenses .....	182
13.	Peer to Peer Communications .....	182



## Section 1: System Overview

The M3 video inspection software is advanced metrology software for performing two and three axis measurements in encoder-based systems and field of view systems at very high levels of precision and accuracy. Measurements can be performed using video comparators, measuring microscopes and a variety of video and touch probe measurement systems. Component inspection can be performed as part of prototype development, in-line production or final quality inspection. Part measuring programs are created automatically during the measurement process. Programs can be saved when measurements have been completed and played back later to measure identical parts. Measurement results from program runs can be displayed in a variety of customized report template views with a separate tab for each run. Result review tools display measurement data and statistics for each run or compare selected data across multiple runs. Feature detail windows display drawings that include point cloud distribution, data fit type, actual values, nominal values, deviations, and tolerance results.



### NOTE

*M3 systems are provided as either encoder-based or field of view measuring systems. Only encoder-based systems support CNC functions. The touch probe option is available only for systems that include CNC support.*

User interaction with the software can be through a conventional mouse interface or through the M3 MultiTouch Logic. The user interface is controlled by clicking items with a mouse or by touching the screen. MultiTouch Logic greatly increases ease of use by allowing pan and zoom of the live video and Part View displays with simple finger pinch, swipe, and press actions.

During part feature measurement, feature points are entered manually or automatically using an advanced collection of video probes or touch probes. Probes include:

- **EyeMeasure:** This custom probe is created as the user's finger draws a path over an edge of the video part image on the screen. The EyeMeasure probe ensures the capture of points along complex part edges.
- **MeasureLogic probe:** The MeasureLogic probe incorporates pattern recognition to determine feature type and collect data points automatically with a single mouse click or finger press on a feature edge.
- **Vtouch probe:** The Vtouch probe moves the active crosshair to a clicked or pressed point on the live video window to collect a data point located on a part edge using video edge detection.
- **Pattern probe (optional):** The pattern probe teaches specific image patterns to the system for automatic detection during program playback.
- **Active crosshair:** The active crosshair collects a single point on a part edge at the center of the live video window or at a point clicked by the user using video edge detection.
- **Standard crosshair:** The standard crosshair collects a point at the intersection of the crosshair lines. The standard crosshair can be translated or rotated in the Field of View By pressing and dragging.
- **Touch probe (optional):** Touch probes capture a single point when contact is made with a part surface. Straight down and star probes can be used. While video probes typically probe part features in 2D space, touch probes probe features in 3D space. Touch probe support is available as an option for CNC enabled systems.

CNC-enabled systems include DXF auto-programming functions that convert DXF drawing files to part measurement programs automatically. Part pallet programs can be generated quickly by simply specifying pallet rows and columns. Step and repeat programs can be generated to measure a matrix of identical features on a single part.

CNC-enabled systems and Manual systems that include the Digital Comparator option and field of view systems can also be taught image patterns for automatic pattern recognition during program playback. Added support for rotated

# Video Inspection Software User's Guide

pattern recognition results in more consistent playback in random fixturing scenarios, and speeds playback through the soft-fixture part positioning.

CNC focus mode measurements can be performed using any of the measuring probes in encoder-based systems equipped with the Auto Focus option. The focus mode is enabled, the measurement is initiated, the system focuses and measures automatically during program playback. Hardware frame latching and a digital camera interface provide extremely accurate and repeatable autofocus results.

Image stitching is included in CNC systems to scale and fit large parts within the field or view.

Industry-standard methods of stage and camera calibration are supported, including LEC, SLEC, NLEC, orthogonality, pixel size, camera skew and field of view.

Microsoft Windows 7, 8, or 10 provides the operating system basis of the functionality, performance, and reliability necessary to address the wide variety of application requirements such as exporting data, printing reports and interfacing to third-party applications.

The software can be in one of four operating modes:

- **Interactive:** The software has just been launched and no program exists yet, or new a program is being recorded as measurements are made.
- **Program:** A complete program is loaded, and features are displayed in the Feature list. If the program has not yet collected feature data in the playback mode, the Report screen displays the feature data from the original measuring/recording sequence. After the program has been played back and gathered new feature data, the measurement results are shown in numbered run tabs. The program can be played back again or edited by pressing tabs at the top of the Feature list.
- **Playback:** The part program is executed to perform repeated measurements of part features on identical parts. The various measurement, tolerance and other program activities are shown as the program is executed. Upon program completion, a new run tab is created in the result database showing the most recent measurement results and the software returns to the program mode. On-screen guidance is provided during playback that helps the user move from one feature to the next in non-CNC systems.
- **Program Edit:** The program edit mode is used to modify steps of a part program file. In the edit mode, program steps can be modified, deleted, or added. Functions including re-measuring features, appending new measurement steps, and changing system parameters such as light levels, camera magnifications and probe path data can be performed.

# Section 2: User Interface

The software user interface consists of menus, submenus and view ports that display different measurement windows and buttons that work in cooperation to perform and display measurements on a color LED monitor or touchscreen. The software interface is organized into basic functional areas that include:

- Three context-sensitive viewports
- The Feature List
- The System toolbar
- The Measure toolbar
- The Report toolbar
- The Program Edit toolbar

The software interface changes to add or delete items in support of specific system activities.

The viewports include one large viewport in the center of the screen and two smaller viewports on the left side of the screen. Viewport window contents change to support measurement and reporting activities.

The Feature List displays and provides access to all part features that have been measured, constructed, or created.

The System, Measure, Report and Program Edit toolbars contain buttons that control overall measurement, reporting and the program edit functions. Toolbar buttons also provide access to submenus that initiate specific actions.

## User Interaction

The user interface can be navigated and controlled by clicking a mouse cursor on the desired screen location or by pressing the desired location with a fingertip. Additional functions are accessed by long-clicking or long-pressing a screen location. Throughout the remainder of this guide, instructions and examples will use the term “press” to indicate either a mouse click or a finger press on the screen.

## Viewports and Screen Organization

The organization of viewports and toolbars changes to support measurement activities that include measuring part features, constructing and creating features, applying tolerances, preparing and sending reports, exporting data and saving, playing or editing part program files. Some screens and toolbars are slightly different in encoder-based and field of view systems. A representative collection of screen organizations is shown in the following pages. Each example of screen organization shows a slightly different set of measurement and reporting functions. These functions will be described in detail in subsequent pages. Field of view functions are discussed in detail in [Chapter 13: Field of View Functions](#).

### *Screen Viewport Navigation*


Viewport or screen navigation is very straightforward and intuitive. Generally, screen navigation simply follows the usual workflow of measurement, application of tolerances, reporting or exporting results or editing a part program. The following screen images show six basic viewport configurations. The six screens include:

- Live Video (Home) screen
- Measure screen
- Part View screen with DRO in upper left viewport
- Part View screen with feature details in upper left viewport
- Part Detail screen
- Report screen

# Video Inspection Software User's Guide


## Live Video Screen

The Live Video screen displays the live video feed in the center viewport. Press the Home button to display the Live Video screen. This is the default Home screen.

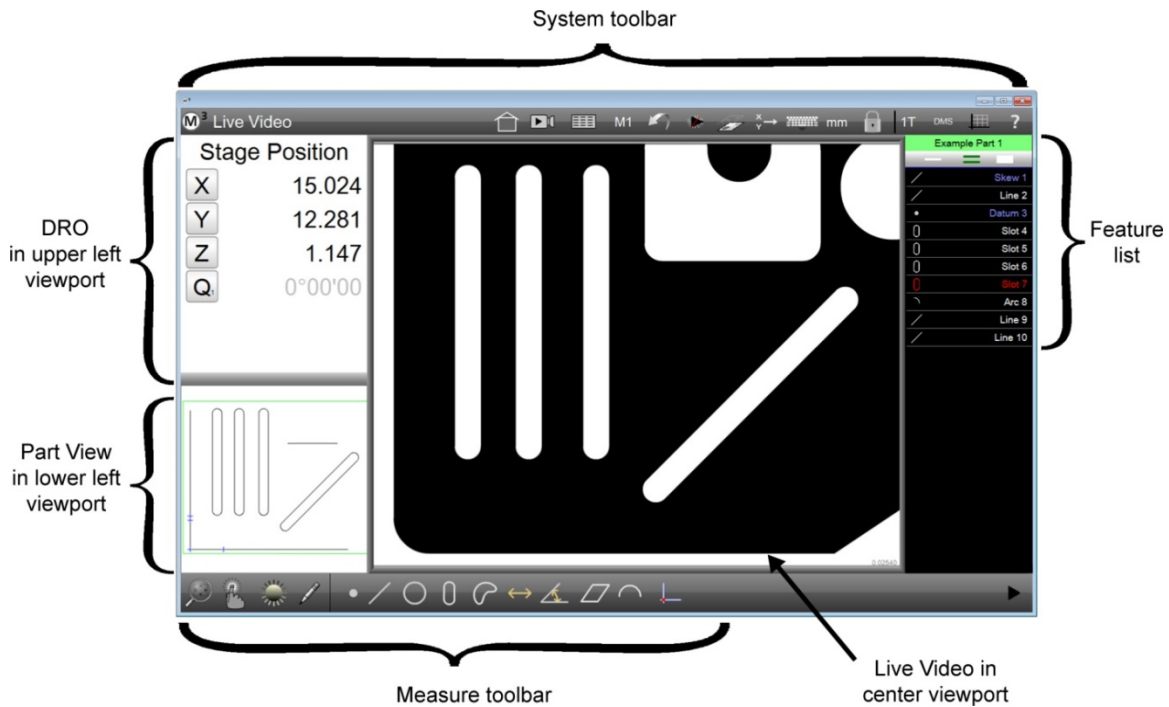

## Measure Feature Screen


The Measure Feature screen is displayed as measurements are being performed. Acquired points are shown with DRO coordinates in the upper left viewport. Acquired points are shown in the Live Video image. Press any Measure Feature button in the Measure toolbar to display the Measure Feature screen. The Measure feature submenu for the selected feature measurement will be shown at the bottom of the screen.

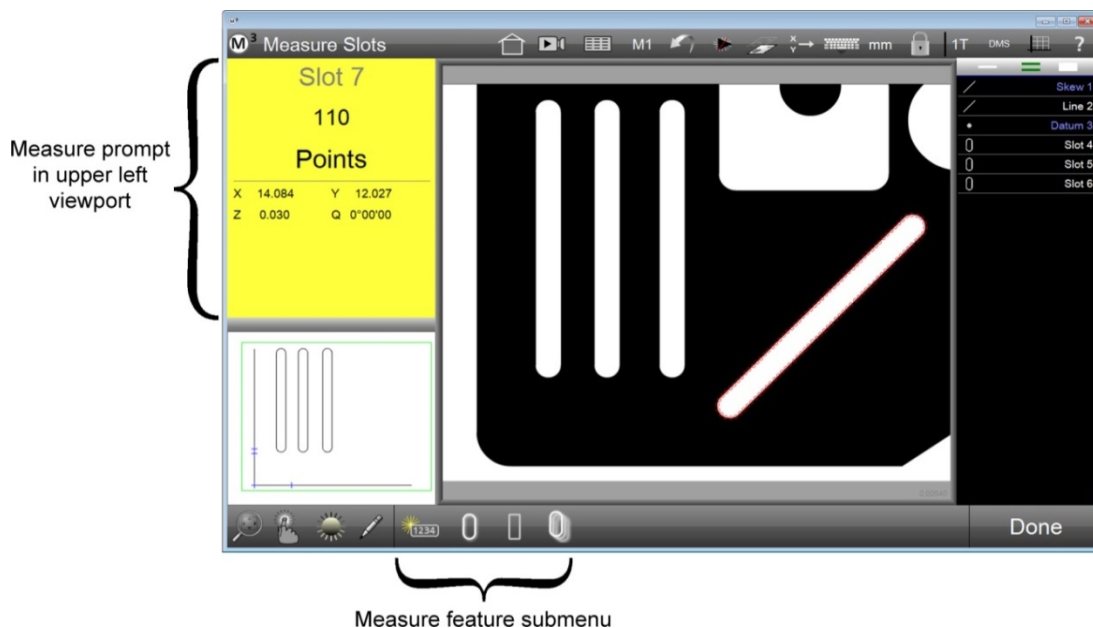


# Video Inspection Software User's Guide

## Part View Screen

The Part View screen displays a drawing of probed, constructed or created features and the measurement datum. The video field of view is highlighted by a green outline. Press in the small Part View image in the lower left viewport to display the Part View screen. The Live Video image will be moved to the lower left viewport.

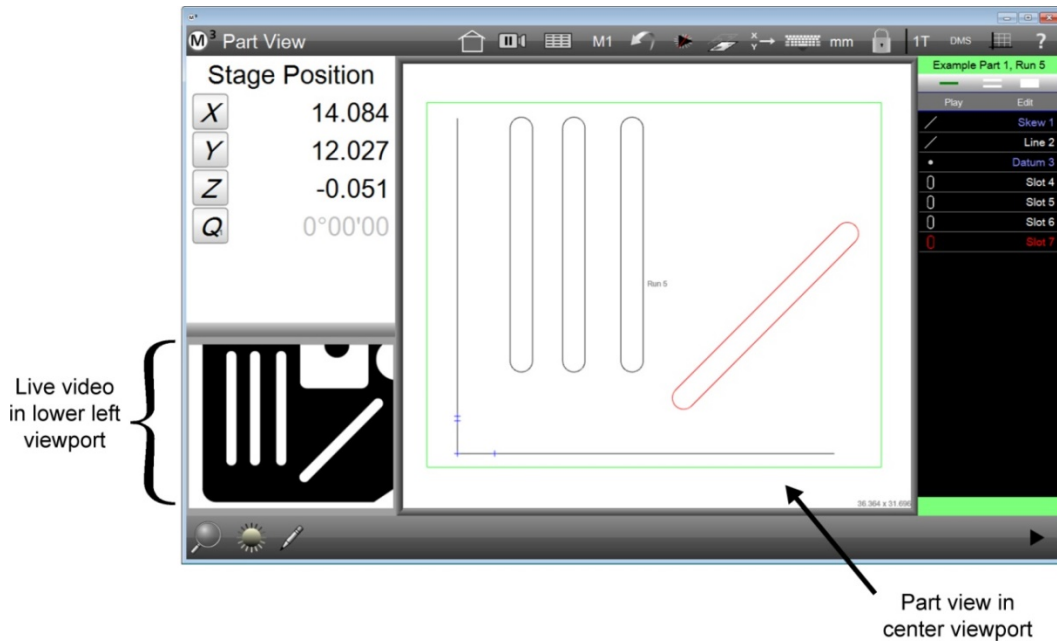


Feature detail information can be displayed in the upper left viewport of the Part View screen by selecting (pressing) a feature in the Feature List or on the Part View image. The selected feature will be shown by pulsating lines and highlighted in blue in the Feature List. Feature detail information includes position coordinates, feature geometric parameters such as diameter, form, number of probed points, the geometric fit type, and the reference frame.

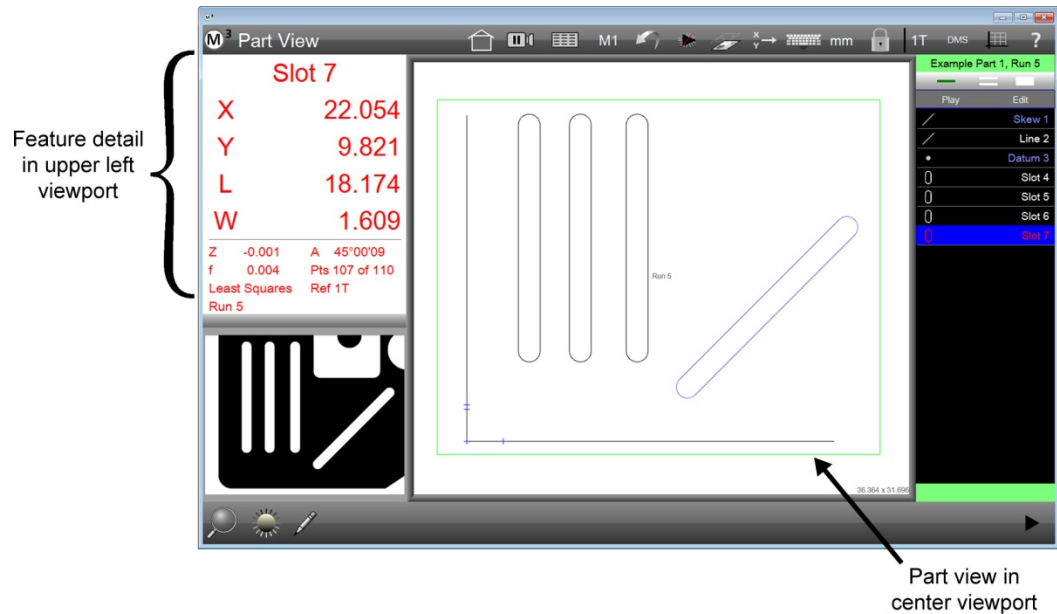

# Video Inspection Software User's Guide


## Feature Detail Screen

The Feature Detail screen displays the feature with probed points that passed and failed any assigned tolerances, and feature detail information including position coordinates, feature geometric parameters such as diameter, form, number of probed points, the geometric fit type and the reference frame. The geometric fit type can be changed, and tolerances can be assigned, edited, or deleted using tools provided by this screen. Press in the feature detail displayed in the upper left viewport (shown on the previous page) to display the Feature Detail screen.

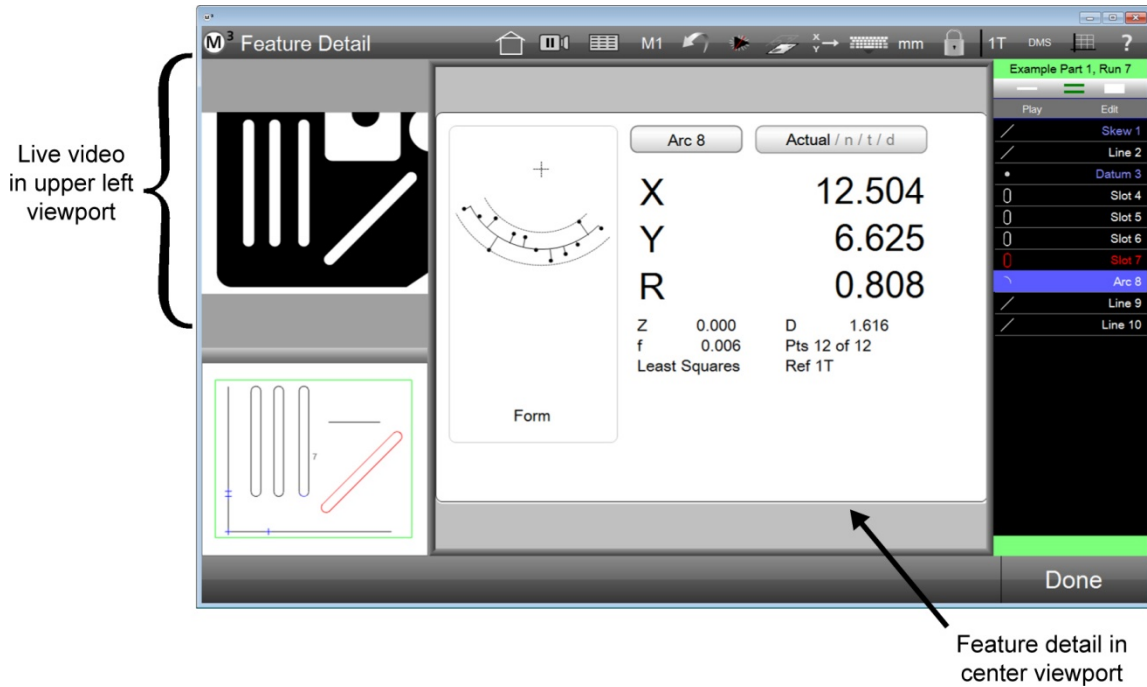

## Report (Run Results) Screen

The Report screen is used to format, edit and display reports of feature measurements and tolerance results. The Measure toolbar will be replaced by the Report toolbar. Program run data are shown in separate tabs. Press the Report button to display the Tolerance Report screen.

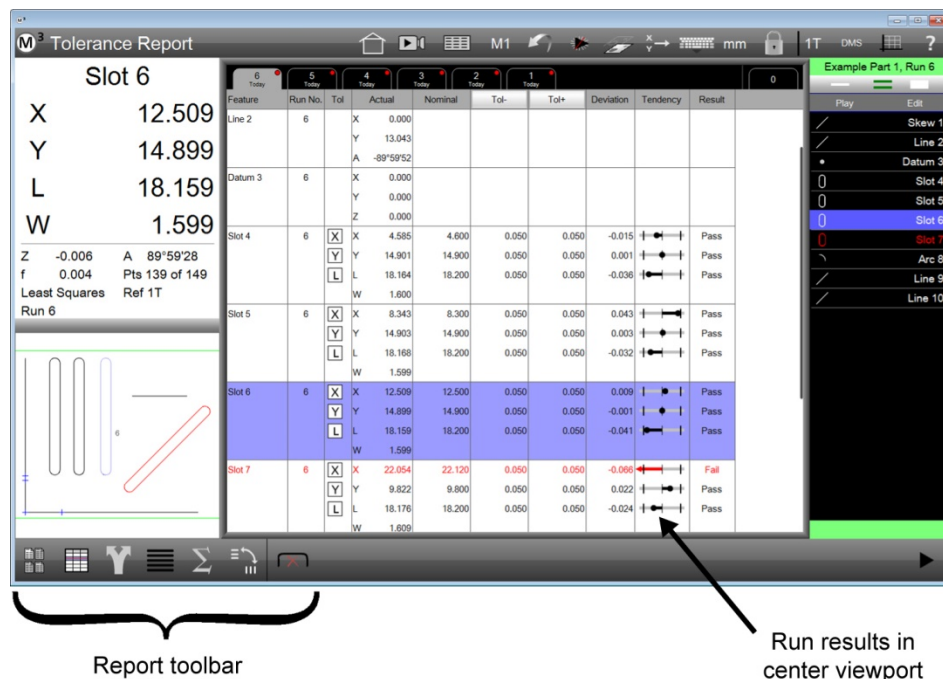



## Toolbars, Menus and Function Buttons

Toolbars contain button icons that either perform an operation directly or display a menu of buttons that belong to a specific category of operation. The basic toolbars include:

- Measure toolbar
- System toolbar
- Report toolbar
- Program Edit toolbar

### *Measure Toolbar*



The measure toolbar contains buttons that include:

- 1 Feature Measurement menus
- 2 Change Feature Type button
- 3 Part View Markup menu
- 4 Part Lighting controls
- 5 Autofocus Mode button (CNC enabled systems)
- 6 Probe menu
- 7 Zoom menu
- 8 Goto Move button (CNC enabled systems)
- 9 Extra menu

### **Feature Measurement Menus**

Pressing any of the feature measurement menu buttons initiates a single feature measurement and displays a submenu of related feature measurement function buttons. Feature measurements will be discussed in detail in Section 4: Measuring, Constructing and Creating Features. Feature measurement menus include (from left to right):

- Points
- Lines
- Circles and Arcs
- Slots and Rectangles
- Blobs
- Distances
- Angles
- Planes
- Profiles (optional)
- Patterns
- Datum elements necessary to construct a measurement reference frame

# Video Inspection Software User's Guide

## Point menu

Press the Measure Point button to initiate a single point measurement and display the submenu of point measurement function buttons.



Point measurement function buttons include:

- Create point by entering data
- Probe a single point
- Probe a series of points

## Line Menu

Press the Measure Line button to initiate a single line measurement and display the submenu of line measurement function buttons.

 


Line measurement function buttons include:

- Create Line by entering data
- Probe a single line
- Probe a series of lines


## Circle and Arc Menu

Press the Measure Circle button to initiate a single circle measurement and display the submenu of circle and arc measurement function buttons.



Circle and Arc measurement function buttons include:

- Create circle by entering data
- Probe a single circle
- Initiate a single arc measurement and display arc measurement function buttons
- Probe a series of circles

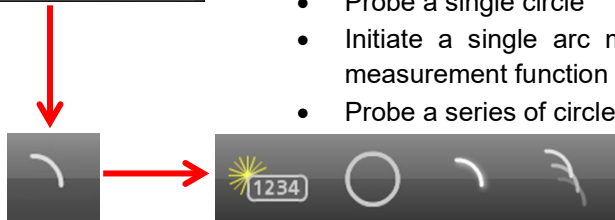

Arc measurement function buttons include:

- Create arc by entering data
- Return to circle function buttons and measure circle
- Probe a single arc
- Probe a series of arcs


## Slot and Rectangle Menu

Press the Measure Slot button to initiate a single slot measurement and display the menu of slot and rectangle measurement function buttons.



Slot and rectangle measurement function buttons include:

- Create slot by entering data
- Probe a single slot
- Initiate a single rectangle measurement and display rectangle measurement function buttons
- Probe a series of slots

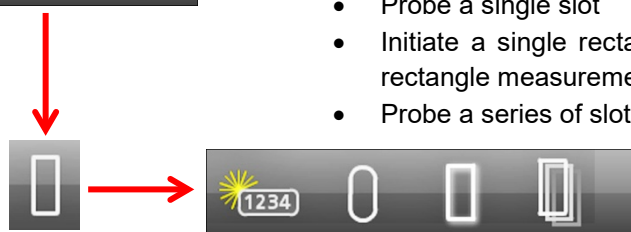

# Video Inspection Software User's Guide

Rectangle measurement function buttons include:

- Create rectangle by entering data
- Return to slot function buttons and measure slot
- Probe a single rectangle
- Probe a series of rectangles

## Blob Menu

Press the Measure Blob button to initiate a single blob measurement and display the menu of Blob measurement function buttons. The Blob function must be enabled in the System Settings menu to be available. Please contact your MetLogix Representative for assistance if necessary.



Blob measurement function buttons include:

- Probe a single blob
- Probe a series of blobs

## Distance Menu

Press the Measure Distance button to initiate a single distance measurement and display the menu of Distance measurement function buttons.

 


Distance measurement function buttons include:

- Create Distance by entering data
- Probe a single distance
- Probe a series of distances

## Angle Menu

Press the Measure Angle button to initiate a single angle measurement and display the menu of angle measurement function buttons.



Angle measurement function buttons include:

- Create angle by entering data
- Probe a single angle
- Probe a series of angles
- Measure a rotated crosshair

## Plane Menu

Press the Measure Plane button to initiate a single plane measurement.



## Profile Features Menu

Press the Measure Profile Features button in systems that are equipped with the Digital Comparator option to construct profile features for digital overlay creation.



# Video Inspection Software User's Guide


## Datum Menu and Pattern Probe

Press the Measure Datum button to initiate a datum measurement and display the menu of Datum measurement function buttons used to create a measurement reference frame. Reference frames will be discussed in detail in [Section 7: Reference Frames](#).

Datum measurement function buttons include:



- Probe or construct a datum point
- Probe or construct a part skew
- Create an offset skew
- Rotate the coordinate system around the datum point
- Probe or construct a datum plane
- Initiate a pattern teach and display the Pattern function buttons. Pattern function buttons include:
  - Teach a datum pattern
  - Teach a pattern

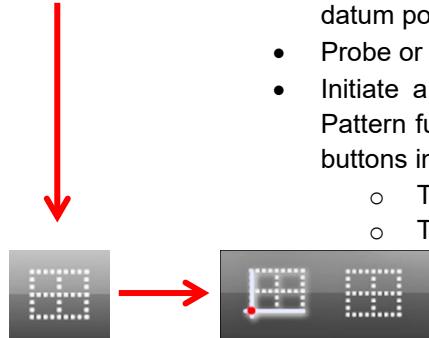

- Update to Positional Registration via Registration Datum
- Save or Load reference frame to or from file.

## Change Feature Type Button

The Change Feature Type button changes the feature type of a feature selected in the Feature List or Part View when the feature can be defined by identical parameters. For example, a circle feature can be changed to an arc. The Change Feature button is not shown when there are no alternative feature types for the selected feature.



## Part View Markup Menu


Press the Markup button to display the menu of Part View Markup tools. Markup tools are used to show feature parameters on the Part View drawing of a selected feature. Markups can also include squares and rectangles of selected colors and user notes. Markup functions will be discussed in detail in [Section 6: Feature List and Part View Functions](#).



Auto
Name
X
Y
Z
A
f
Tolerances
W
L
Box
Text

## **Part Lighting Controls**

For systems that support Lighting Controls, press the Light Control button to superimpose the part lighting controls over the Live Video part image. Press again to toggle the display off.

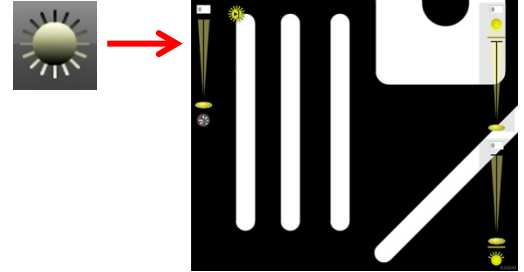

## **Autofocus Mode Button**

For systems that support Autofocus, press the Autofocus button to enable the focus assist and focus measure modes for a single measurement. Long-press the Autofocus button to lock the system in the autofocus mode. Press the button again to unlock the autofocus mode.



**Autofocus OFF**



**Autofocus ON**




**Autofocus Locked**

The Autofocus mode will be discussed in detail in [Section 3: Probes](#).

## **Probe Menu**

Press the Probe button to display a menu of measurement probes. Probe types will be discussed in detail in [Section 3: Probes](#). Probe types include:


- Standard crosshair
- Active crosshair and Vtouch probe
- MeasureLogic probe and EyeMeasure probe
- DXF functions for systems that include the digital comparator option

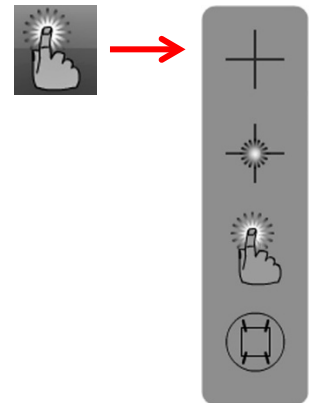


## **Zoom Menus**

Press the Zoom button to display the zoom magnification functions available for the Live Video or Part View in encoder systems and FOV systems. Zoom menu functions can include:


- 1 Zoom Fill: fits the video image horizontally and vertically
- 2 Zoom Fit: fits the video image horizontally
- 3 Zoom 1:1: sets one video pixel equal to one camera pixel
- 4 Zoom Marquee: fills video with user selected (press and drag) area
- 5 Zoom +: zooms in to increase magnification
- 6 Zoom -: zooms out to decrease magnification

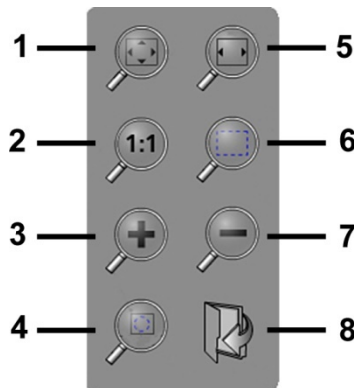

**FOV systems**

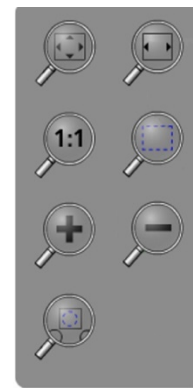

**Encoder systems**

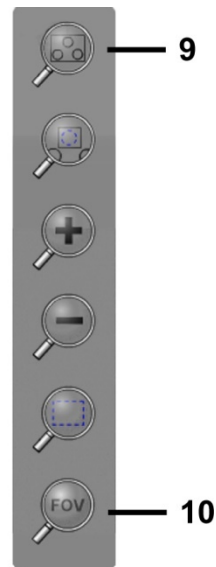

**Part view  
encoder and  
FOV**

# Video Inspection Software User's Guide

- 7 Zoom Features: zooms to all features selected in the Feature List
- 8 Load part image into field of view (FOV systems)
- 9 Zoom all features: zooms to include all features
- 10 Zoom FOV: zooms the part view to the current field of view



## NOTE

*Zoom magnifications can be changed using the mouse by clicking the mouse cursor in the live video window and moving the mouse scroll wheel forward or backward to increase or decrease the zoom magnifications.*

## Goto Move Button

The Goto function prepares encoder-based CNC enabled systems to perform one of three CNC Goto moves including:

- Goto position
- Goto feature
- Goto Part View location

Press the Goto button to enable CNC Goto moves. The button arrow will turn red and the M3 screen will display green control borders around the interface areas where Goto commands can be executed. The Goto function is described in detail in [Section 4: Measuring, Constructing and Creating Features](#).




## Extra Menu


Press the Preferences button to display the utility functions specified as “Extra” in the Desktop Settings screen accessed from the System Menu. Utility functions can be hidden, displayed in the System toolbar or contained in the Extra menu. When no utilities are specified as “Extra” in the Desktop Settings screen, the Extra menu button is not shown in the Measure toolbar. All available utility functions are shown here (from top to bottom) in the Extra menu:



- 1 Toggles the displayed coordinate system between Polar and Cartesian
- 2 Toggles the display of angular units of measure between Degrees/Minutes/Seconds and Decimal Degrees
- 3 Selects the displayed reference frame
- 4 Locks or unlocks features to their measured reference frames
- 5 Toggles the display of linear units of measure between millimeters and inches
- 6 Displays the on-screen keyboard
- 7 Displays the Send menu for selecting the data to be transmitted to an RS232 device. The data choices change to support the selected feature. The Send functions are described in detail in [Section 9: Reporting Data](#)
- 8 Toggles the feature overlay function on or off. The feature overlay function is discussed in detail in [Section 6: Feature List and Part View Functions](#)
- 9 Toggles the Auto Play function on or off for FOV systems. The Auto Play function is discussed in detail in [Section 12: Field of View Functions](#)

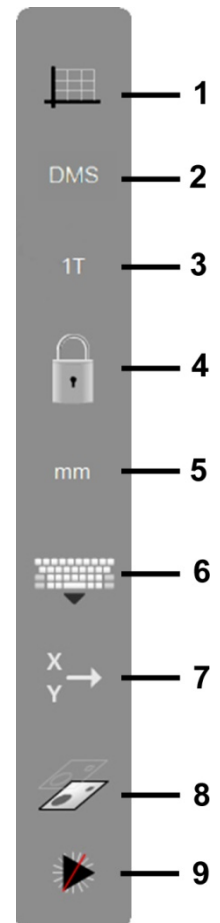

## System Toolbar

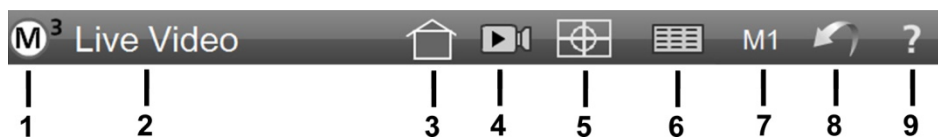


The System toolbar can be configured in the Desktop Settings screen to contain any or all of the utility functions described above in the **Extra menu**. The minimum buttons contained in the System menu include:

- 1 System menu
- 2 Main viewport content indication
- 3 Home View button: The default home screen displays the Live video in the main viewport.
- 4 Freeze Live Video Images button (field of view enabled systems)
- 5 Image Stitching button
- 6 Report View button
- 7 Video magnification indication
- 8 Undo button
- 9 Help button


## System menu

Press the System Menu button to display the system functions in the Interactive, Program playback and program edit modes. System functions can include:

- 1 New Part: clears the current part Feature List and part data in preparation for new part measurements
- 2 Open part file: display an open file dialog for opening a previously saved part file
- 3 Print: prints the contents of the main viewport (live video, part view, report)
- 4 User login: used to switch to a different user login account. User Account passwords and privileges are setup in the Security Settings screen.
- 5 Play program: initiates the playback of the current or loaded part program
- 6 Save program: displays a save part dialog for saving the current part file
- 7 Settings screens: provides access to the M3 settings screen menu
- 8 Exit M3: closes the M3 program
- 9 List of recent programs run.

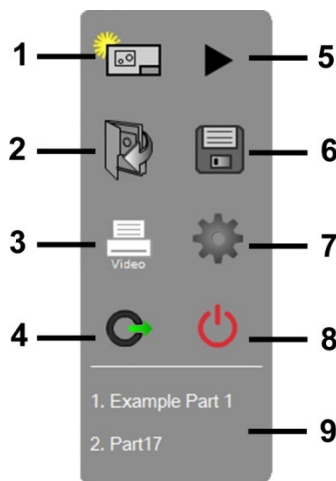

*Interactive mode*

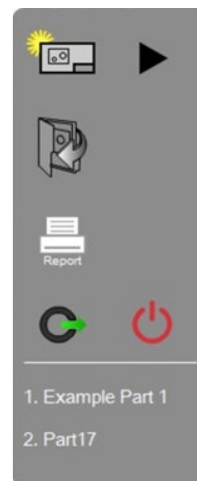

*Results view in program playback mode*



*Program playback program editing*



### NOTE

**The M3 does not save the current part upon closing. Be careful to save your current part file before exiting the software if you wish to retain your measurement session activities.**

## **Main viewport indication**

The indication will display the name of the current main viewport contents and may also provide useful information during program playback such as "Measure Circle":

- Live video
- Part View
- Report (Results view)
- Stage position

## **Home View Button**

Press the Home View button to quickly display the home view screen. The Home View is typically the most used arrangement of viewports. The Home View is defined by specifying the main viewport contents in the Display Settings screen. The default home view is the live video. Display Settings screen content selections include:



- Video (live video)
- Part View
- Data (report)
- DRO (stage position)

## **Freeze Live Video Images Button**

The digital comparator option provides the capability to quickly freeze and release a live video image. All features and functions remain available whether the camera image is static or live. To freeze a live video image:




- Press the pause image button to freeze the current Live Video window image in the field of view.
- Press the Play Image button to resume the live image feed.



## **Image Stitching Button**

Press the Image Stitching button to display the Image Stitching menu. Image stitching will be discussed in detail in [Section 5: Image Stitching](#).

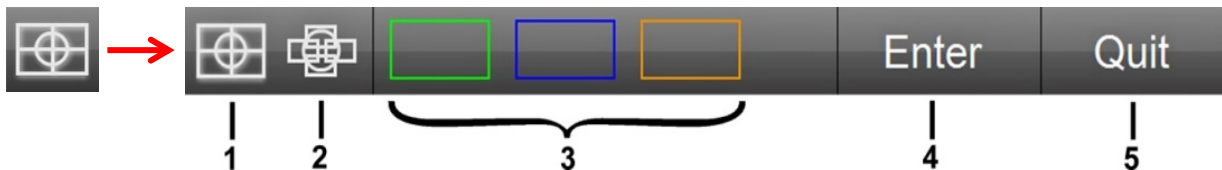

The Image Stitching toolbar contains:

- 1 Rectangular Stitch
- 2 Free Form Stitch
- 3 Stage Preset Area
- 4 Enter Position
- 5 Quit Stitching Function

## **Rectangular Stitch Button**

Press the Rectangular Stitch button to begin the image stitching process based on a predefined rectangular matrix of image areas.



## **Free Form Stitch Button**

Press the Free Form Stitch button to begin the image stitching process based on arbitrary user selections of image areas.

 




# Video Inspection Software User's Guide

## Stage Preset Area Button

Press the Stage Preset Area button to begin the image stitching process based on arbitrary user selections of stage locations.



## Enter Position Button

Press the Enter Position button to enter a stitch boundary position.



## Quit Stitching Function Button

Press the Quit Stitching Function button to discard any stitching data and quit the image stitching function.



## Report Button

Press the Report button to display the Results view of feature measurement and tolerance data in the report format selected in the Report Format menu of the Report toolbar. The Results view and Report toolbar will be discussed in detail in [Section 9: Reporting Data and the Results Screen](#) and after this discussion of the System toolbar.



## Video Magnification Indication

The current system video magnification is displayed. This is also a menu that provides access to the other defined magnifications in the system. This indication is only displayed when more than one magnification is configured in the system.



## Undo Button

Press the Undo button to erase the last software operation.



## Help Button

Press the Help button to display a hyperlinked version of this M3 User's Guide.




## Report Toolbar

The Report toolbar is displayed when the Report button is pressed in the System toolbar to display the feature measurement Results View in the main viewport. The buttons displayed will depend on the current state of the measuring system. Reporting functions will be discussed in detail in [Section 9: Reporting Data and the Results Screen](#).



The Report toolbar contains:

- 1 Edit Cell button
- 2 Report Format menu
- 3 Hide Row button
- 4 Export Data menu
- 5 Report Filters menu
- 6 Import DXF Nominals
- 7 Pivot view Statistics button
- 8 Pivot view button
- 9 Delete Run Results Tab button

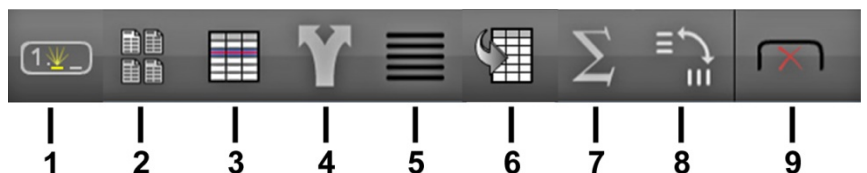

# Video Inspection Software User's Guide

## **Edit Cells Button**

Press the Edit Cells button to enable the alphanumeric editing of report cells. Editable cells will become highlighted in green.



## **Report Format Menu**

Press the Report Format button to display the menu of report format types. Report formats include:

- European
- CSV
- Tolerance Report
- European 2



## **Hide Row Button**


Press the Hide Row button to hide selected report rows in printed or exported report data. Long press the hide row button to hide all rows that are not currently selected.



## **Export Data Menu**

Press the Export Data button to select an export format from the menu of export formats and export the report data. Data formats include:

- .CSV
- .TSV
- .TXT
- .DXF
- .PDF
- Cloud .CSV: (includes all data points collected for the selected feature(s))
- Cloud .DXF: (includes all data points collected for the selected feature(s))
- .XLSX

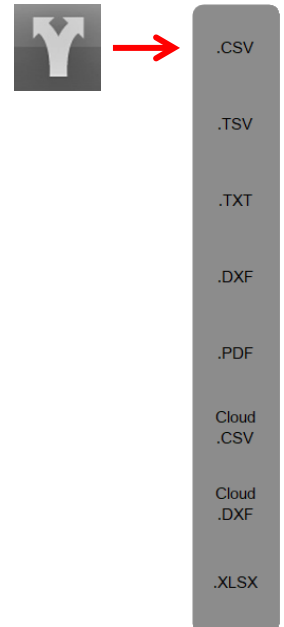


### **NOTE**

*The DXF Export option is only available on CNC systems or on manual systems that have the Digital Comparator option enabled.*

## **Report Filters Menu**

Press the Report Filters button to select a filter from Report Filters menu. Printed and exported reports will include only the filtered data. Filters include (from top to bottom):

- Filter All
- Filter Selected
- Filter Toleranced
- Filter Passed Tolerance
- Filter Failed Tolerance
- Filter Feature Type

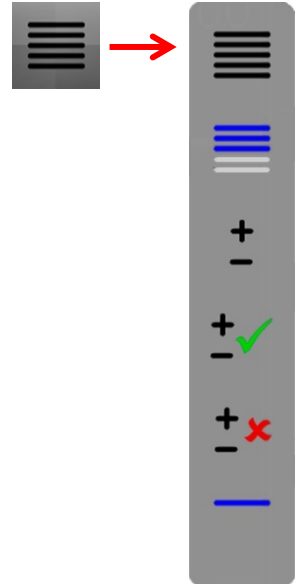

## **Import DXF Nominals**

Press the Import DXF Nominals button to display a file import dialog and specify a DXF drawing file from which part feature nominal tolerance values will be extracted. Importing DXF nominal values will be discussed in detail in [Section 8: Tolerancing](#).



## **Statistics**

Press the Statistics button to display the Statistics menu of standard statistics functions. Statistics functions will be discussed in detail in [Section 9: Reporting Data and the Results Screen](#).



## **Pivot View**

Press the Pivot button to display the selected features in a single row per run orientation. The Pivot function will be discussed in detail in [Section 9: Reporting Data and the Results Screen](#).



## **Delete Run Results**

Press the Delete Run Results button to delete the selected run data(tab) from the runs database.



## **Program Edit Toolbar**

The Program Edit toolbar is displayed when an M3 program is placed in the edit mode. Program recording, playback and editing are discussed in detail in [Section 11: Programming](#).



# Video Inspection Software User's Guide

The Program Edit toolbar contains:

- 1 Play button
- 2 Play From Here button
- 3 Record Into button
- 4 Re-measure Feature button
- 5 Step and repeat button
- 6 Ask button
- 7 Delete Program Step button

## **Play Button**

Press the Play button to reinitiate program playback after the program has been paused.



## **Play From Here Button**

Press the Play From Here button to reinitiate program playback from the current program line location.



## **Record Into Button**

Press the Record Into button to insert a new program step after the current location.



## **Re-measure Feature Button**

Press the Re-measure Feature button to replace the feature measurement at the current location with new feature measurement.



## **Step and Repeat Button**

Press the Step and Repeat button to specify a grid of repeat measurements or constructions for the selected feature in the edit mode.



## **Ask Button**

Press the Ask button to insert a user-defined message, image or request variable data before the current program location.



## **Delete Program Step Button**

Press the Delete Feature Step button to delete the feature step at the current location.



### **NOTE**

*Various program steps can be deleted, such as feature measurements, light control, and magnification steps. However, program steps that are part of the datum creation cannot be deleted. Additionally, datum features cannot be re-measured or edited into a program with the Record Into function.*

## Feature List

The Feature List is discussed in detail in [Section 6: Feature List, feature Detail and Part View Functions](#).

## Section 3: Probes

Features are measured by probing points along the edge of the feature within the live video window. Points are probed as part of either an explicit or automatic feature measurement using one of the video or touch probes. There are two main categories of video probes and two of touch probes:

- Crosshair video probes
- Multipoint video probes
- Straight down touch probes
- Star touch probes



### **NOTE**

*Touch probes are included only as an option on CNC systems.*

### Crosshair Probes

Crosshair probes capture a single point at a time. The software supports two types; simple and active.

- The simple crosshair probe requires that the operator manually line up the crosshair center with a point to be probed on the feature edge.
- The active crosshair probe requires that the operator manually line up the crosshair center with an edge then the probe incorporates a relatively large area of edge detection and will detect the feature edge automatically, thereby increasing speed and accuracy.

### Multipoint Video Probes

Two multipoint probes capture several points along an edge in a single probe firing. The MeasureLogic probe measure features with a single press of the fingertip or click of the mouse cursor on a feature edge. The MeasureLogic probe can automatically determine the feature type being measured eliminating the need to identify a feature type prior to probing. The EyeMeasure probe is drawn directly on an edge by the operator's fingertip or the mouse cursor and facilitates probing complex or partially obscured part edges. The number of points captured by multi-point probes can be set by the user and is discussed later in this section.



### **NOTE**

*Some M3 Systems support the Auto Focus mode which performs z-axis focus position calculations. Single point probes can be used in non-CNC manual zoom systems, and both the multipoint and single point probes can be used in motorized zoom CNC systems.*

### Touch Probes

Touch probes capture a single point at a time and are placed in contact with the part features manually as programs are recorded and then automatically as the programs are played back. While video probes typically probe part features in XY space, touch probes probe three-dimensional features in XYZ space.

# Points Required for Single Point Probing

While multipoint probes collect many points each time they are fired, crosshairs and touch probes probe a single point at a time. The minimum number of points required for each feature type and recommendations regarding single point and multipoint probes are provided below.

## ***Points***

Require one or more points. When more than one point is probed, a least squares fit is applied to the data cloud.

## ***Lines***

Require two or more points. When more than two points are probed, the data fit type specified in the Feature Detail screen is applied to the feature's data cloud. Points should be evenly distributed along the line.

## ***Circles and Arcs***

Require three or more points. When more than three points are probed, the data fit type specified in the Feature Detail screen is applied to the feature's data cloud. Circle points should be evenly distributed around the circle. Arc points should begin at one end of the arc and finish at the other, with intermediate points evenly distributed along the arc.

## ***Slots and Rectangles***

Require five or more points. When more than five points are probed, the data fit type specified in the Feature Detail screen is applied to the feature's data cloud. Single point and multipoint probes may be used.

## ***Blobs***

Blobs are defined as irregular shapes, often characterized by a complex perimeter. The point density necessary to accurately measure a blob is much higher than the point density of the probes available in the probe menu and therefore blob measurements utilize a special tool to acquire points around the perimeter. The measurement of blobs is discussed in detail in [Section 4: Measuring, Constructing and Creating Features](#).

## ***Distances***

Require two points.

## ***Angles***


Require two or more points on each leg of the angle. Points are probed first on one leg and then on the other leg of the angle.

## ***Planes and Datum Planes***

Require three or more points. When more than three points are probed, the data fit type specified in the Feature Detail screen is applied to the feature's data cloud. Probed points on a plane feature should be evenly distributed across the plane surface. Measurements of planes with greater than 15 degrees tilt are not permitted.


## ***Spheres***

Require a minimum of four points evenly distributed around the sphere. One good pattern is three near the diameter and one at the top.

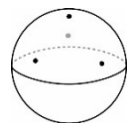


## ***Cylinders***

 Require the first three evenly distributed around one Z elevation and the second three evenly distributed around a second Z elevation. Any number of points can be probed anywhere on the cylinder after the first six points have been probed.



## ***Cones***

Require the first three evenly distributed around one Z elevation and the second three evenly distributed around a second Z elevation. Any number of points can be probed anywhere on the cylinder after the first six points have been probed.

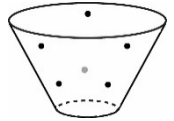

## ***Axis (3D Line) features***

An Axis (3D Line) feature should not be probed, but if it must, a 0-radius probe like a crosshair, or scribe can be used. If a touch probe is used instead, it is not compensated. The best way to measure this type feature is by construction.

## ***Datum Point Features***

Require a minimum of one point. When more than one point is probed, a least squares fit is applied to the data cloud.

## ***Skew Features***

Require a minimum of two points. The skew feature is of fundamental importance to the creation of a reference frame; therefore, many points should be probed along the skew line to ensure skew accuracy. The EyeMeasure probe or MeasureLogic probe is recommended for this measurement. When more than two points are probed, a least squares fit is applied to the data cloud.

## **Using Video Probes**

Five video probe types are available for creating reference skews and datums and for measuring regular geometric features including points, lines, circles, arcs, slots, rectangles, blobs, distances, angles and planes. The five video probe types include:

- Standard crosshair
- Simple Active crosshair
- Vtouch
- MeasureLogic
- EyeMeasure

Automatic point entry can be enabled for the standard and active crosshairs. Automatic point entry is discussed in detail later in this section.


## ***Video Probe Scanning***

When a video probe is fired one or more orthogonal scan lines cross the selected part edge bounded by light and dark areas of the screen image. Optimum scanning direction and color sensitivity for contrast recognition are set by the system for the active crosshair, Vtouch, and MeasureLogic probes. Optimum scanning direction and color sensitivity are also set by default for the EyeMeasure and Simple Active crosshair probes but can be changed if required. This topic is discussed in detail in the description of the EyeMeasure and Simple Active crosshair probes later in this section.

## ***Standard Crosshair Probe***

The standard crosshair consists of two lines crossed at 90 degrees. Single points are acquired manually or automatically (in CNC enabled systems) by positioning the crosshair intersection over a feature. To use the standard crosshair probe:

- 1 Select the standard crosshair probe from the Probe menu  
**Measure toolbar > Probe menu > Standard crosshair probe**
- 2 Position the crosshair probe over the part
- 3 Press the Enter button or press in the yellow measure prompt to fire the probe. A single point will be probed.

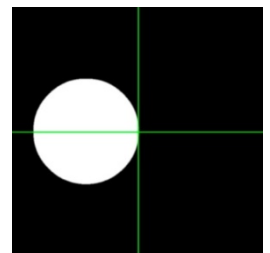

# Video Inspection Software User's Guide

## **Measure toolbar > Enter button**

- 4 Probe the required number of points and then press the Done button to complete a feature measurement.

## **Measure toolbar > Done button**

## ***Simple Active Crosshair Probe***

The simple active crosshair consists of a standard crosshair with a small circle at the center for positioning the edge detector. Single points are acquired manually or automatically (in CNC enabled systems) by positioning the crosshair circle over a feature. To use the active crosshair probe:

- 1 Select the active crosshair probe from the Probe menu.


## **Measure toolbar > Probe menu > Active crosshair probe**

- 2 Position the crosshair probe over the part.
- 3 Press the Enter button or press in the yellow measure prompt to fire the probe. A single point will be probed.

## **Measure toolbar > Enter button**

- 4 Probe the required number of points and then press the Done button to complete a feature measurement.

## **Measure toolbar > Done button**

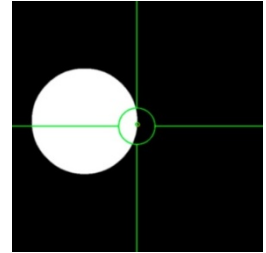

## ***Vtouch Probe***


The Vtouch probe is a special application of the active crosshair probe. When the active crosshair probe is selected, a single point is acquired on an edge that is pressed at a location on the live video window. To use the Vtouch probe:

- 1 Select the active crosshair probe from the Probe menu.

## **Measure toolbar > Probe menu > Active crosshair probe**

- 2 Move the stage to show the part feature of interest.
- 3 Press or click an edge of the part feature on the live video window screen. The probe will move momentarily to the touched point and a single point will be probed.
- 4 Probe the required number of points and then press the Done button to complete a feature measurement.

## **Measure toolbar > Done button**

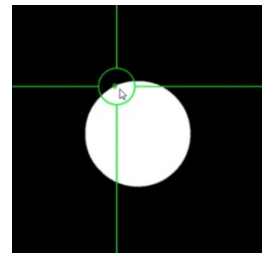


## ***MeasureLogic Probe***

The MeasureLogic probe acquires many points when fired and automatically determines the feature type being measured eliminating the need to identify a feature type prior to probing. To use the MeasureLogic probe:

- 1 Select the MeasureLogic probe from the Probe menu.

## **Measure toolbar > Probe menu > MeasureLogic probe**

- 2 Move the stage to show the part feature of interest.
- 3 Press or click an edge of the desired part feature on the live video window screen to fire the probe.
- 4 Many points will be probed, and the feature measurement will be completed automatically.

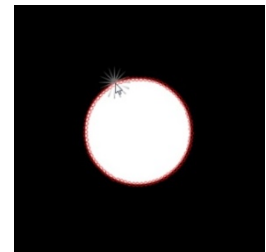

## ***EyeMeasure Probe***

The EyeMeasure probe is a special application of the MeasureLogic probe. The EyeMeasure probe is drawn directly over an edge by the operator's fingertip or the mouse cursor and facilitates probing complex or partially obscured part edges. The EyeMeasure probe acquires many points when fired and automatically determines the feature type being measured eliminating the need to specify a feature type prior to probing. To use the EyeMeasure probe:

- 1 Select the MeasureLogic probe from the Probe menu.


## **Measure toolbar > Probe menu > MeasureLogic probe**

- 2 Move the stage to show the part feature of interest.




# Video Inspection Software User's Guide


- 3 Press and drag along an edge of the desired part feature location on the live video window screen. In these examples, a circle and line are being probed.

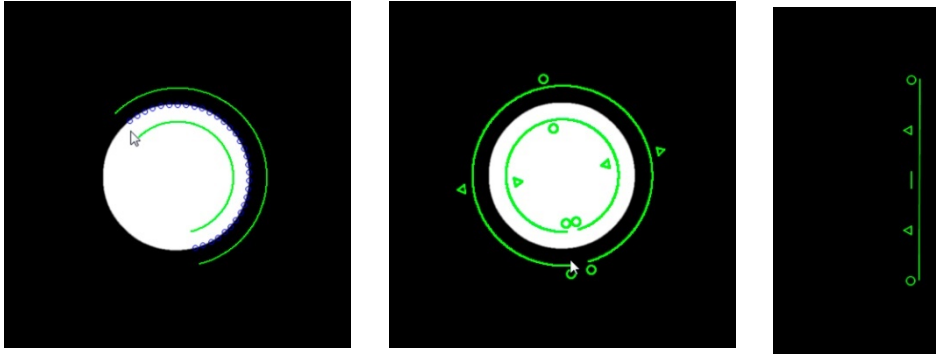

When the feature is adequately bounded by the probe, the probe size can be changed by pressing and dragging the probe triangle handles. In this example the edge sensing area of the probe is increased in size.

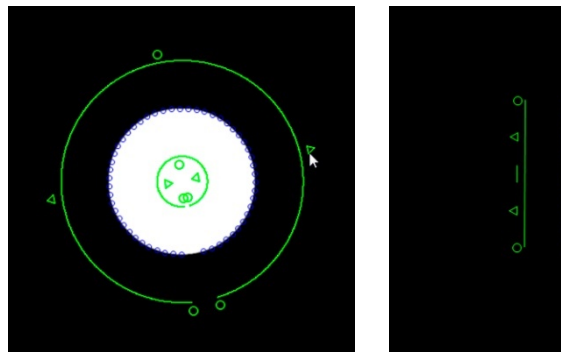


The probe can also be rotated about its initial starting point by pressing and dragging the end circle handle.

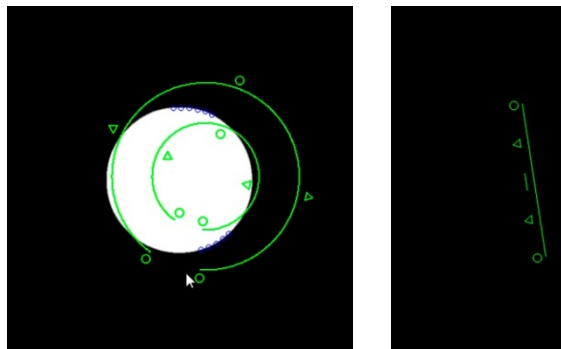


The scanning direction can be changed by pressing a triangle handle as shown in this example of the line probe. In the default orientation of the triangle handles, the triangles face away from each other indicating that the system will choose the optimum scan direction. In these examples, a triangle handle is pressed to set the scan direction from black to white, then the triangle handle is pressed again to set the scan direction from white to black. A third press on the triangle handle would return the scan direction to the default optimum.

## Video Inspection Software User's Guide

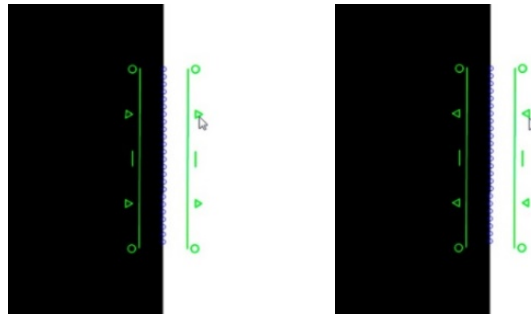


The scan color contrast sensitivity can be changed by dragging one probe boundary across and over the other reversing the two boundary lines as shown in this example. The right boundary line of the probe was dragged across and over the left boundary line changing the color sensitivity as indicated by the white and black dots in the triangle handles.

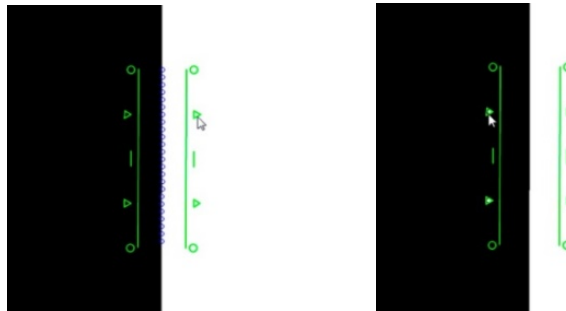

### CAUTION

*As mentioned earlier, the default scanning direction and color sensitivity of the EyeMeasure probe are optimum for feature measurements. Therefore, any changes in scanning direction or color sensitivity should be made only if absolutely necessary and by qualified personnel.*

- 4 Press inside the probe boundaries to fire the probe. Many points will be probed and the measurement will be completed automatically.

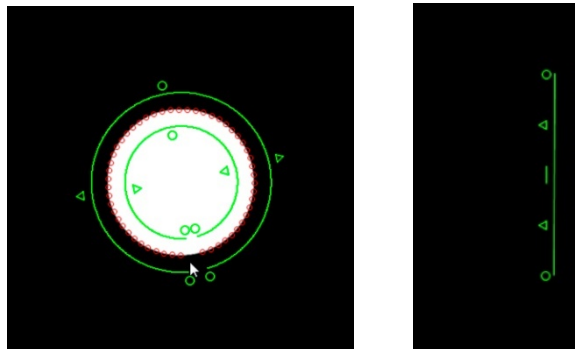


### NOTE

*Pressing within the tool space will enter points for this probe.*

## Nearest Furthest Probe

The Nearest Furthest probe can be used to find a point on an edge where the edge is most convex or concave. To use the Nearest Furthest probe:

- 1 Select the Nearest Furthest probe from the probe menu.  
**Measure toolbar > Probe menu > Nearest Furthest probe**
- 2 Select the desired feature to measure.  
**Measure toolbar > Desired Measure Feature button**
- 3 Probe the target edge with the Nearest Furthest probe. If the part alignment has been done, by long-pressing on the probe rotate handles, the probe rotate handles will turn from circles to squares and will auto align to the edge under measure.
- 4 Press Enter to enter the Nearest or Furthest point into the measurement.
- 5 Press Done to complete the measurement.

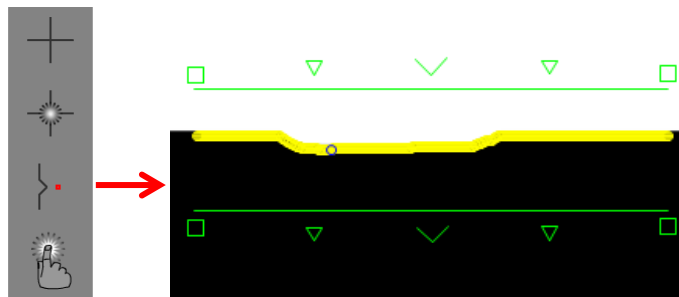

### NOTE

*Nearest Farthest Probe is off by default. It can be enabled by going to System Settings, Desktop, and then setting the Display nearest furthest probe button to YES.*

## Auto Point Entry

Auto point entry can be enabled for the standard and active crosshair probes in the interactive mode and the program playback mode for non-CNC systems. When the auto point entry function is enabled, a point is collected by the system each time the stage is moved to position the part under a probe. The automatic point entry is delayed until the stage has been motionless for a short time to ensure that the probe is located where the user intended. The timer that controls this delay can be configured in the Auto Enter fields of the Measure Settings screen. The default value will provide adequate delay for most applications. To use the auto point entry function:


- 2 Select a crosshair probe from the probe menu.  
**Measure toolbar > Probe menu > Standard or active crosshair probe**
- 3 Select the desired feature to measure.  
**Measure toolbar > Desired Measure Feature button**
- 6 A small red dot will appear in the horizontal divider bar between the Part View and the measure prompt viewports. This red dot is the activation button for the auto point entry timer. Press the red dot to enable the timer.
- 4 Move the stage to position the feature under the probe. As you move, the dots will turn green indicating that the timer is armed.
- 5 When you stop moving the stage, the dots will turn yellow and begin to disappear to the left. Shortly before the point is probed the dots will turn red. A point will automatically be probed at the current crosshair position. When the point is entered, the dots will become black. When the stage is moved again, the timer will restart and green dots will be shown again.



### NOTE

*The stage can be moved to reposition the point to be probed while the timer is counting down and the dots are either green or yellow. When the dots are red, moving the stage will not restart the timer. If you accidentally enter an incorrect point position, simply press the Undo button in the system menu to remove the point.*

# Video Inspection Software User's Guide

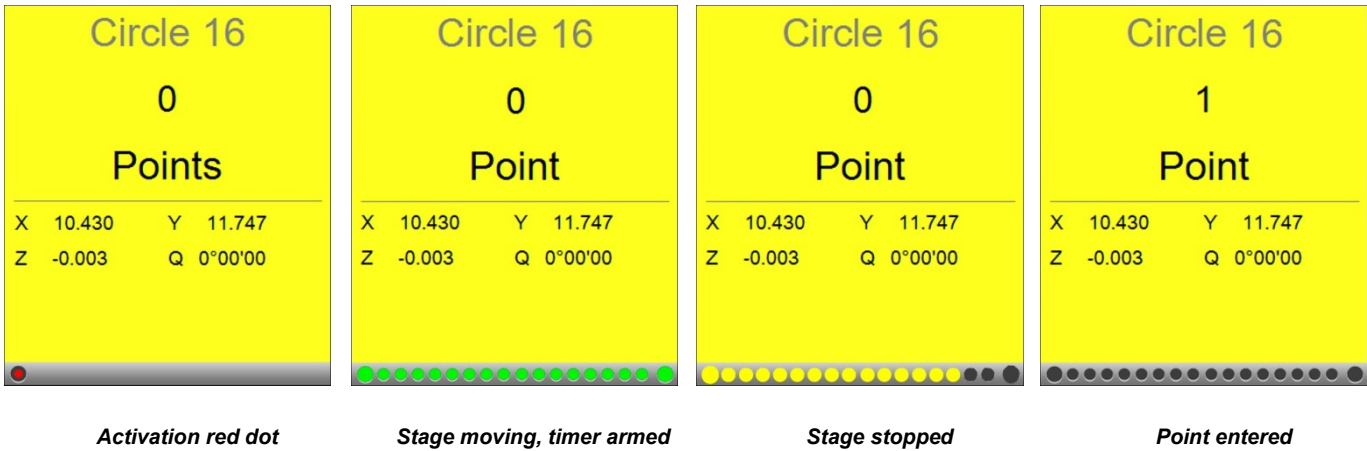

## Auto Focus Mode

The Auto Focus mode is optional and not available in all M3 systems.



### NOTE

If your system supports the Auto Focus mode, the Auto Focus button will be located in the left side of the measure toolbar.


## Auto Focus States

The Auto Focus mode can be in one of three states:

- Disabled
- Enabled
- Enabled and locked



Disabled

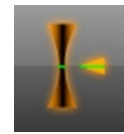

Enabled



Enabled and locked

Press the Auto Focus button to toggle the function between disabled and enabled. Long-press the Auto Focus button to lock the function in the enabled state. Unlock and disable the Auto Focus mode with a single press.

The Auto Focus mode uses contrast sharpness recognition to determine the optimum focus as the z-axis is raised and lowered to sweep back and forth through the focus range of the video camera. The Auto Focus mode is used in manual and CNC enabled systems to perform two functions:

- Focus assist
- Focused feature measurement

## Focus Assist


Focus assist determines the z-axis position of optimum part focus as the z-axis is moved up and down and the video camera system is swept back and forth through the focus region.

In manual systems, the user raises and lowers the z-axis. When the optimum point of focus has been determined by the system, the Stage Position indication in the measure prompt is changed to show only the z-axis focus target. The user then raises or lowers the z-axis to reduce the target value to zero at optimum focus. In CNC enabled systems, the system drives the z-axis to find and set the optimum focus point automatically.


## Focus Assist in Manual Systems

To use focus assist in a manual system:



- 1 Position the standard or active crosshair over the desired part edge.
- 2 Enable the Auto Focus mode.  
**Measure toolbar > Focus Mode button**
- 3 Press and drag the triangle handles of the region of interest to change its size if desired.
- 4 Press in the region of interest to initiate auto focus assist. A grid will appear.
- 5 Raise and lower the z-axis through the range of focus until the Stage Position indicated in the measure prompt changes to indicate a Target position. The grid will be red when the system is out of focus, and green when the system is in focus.

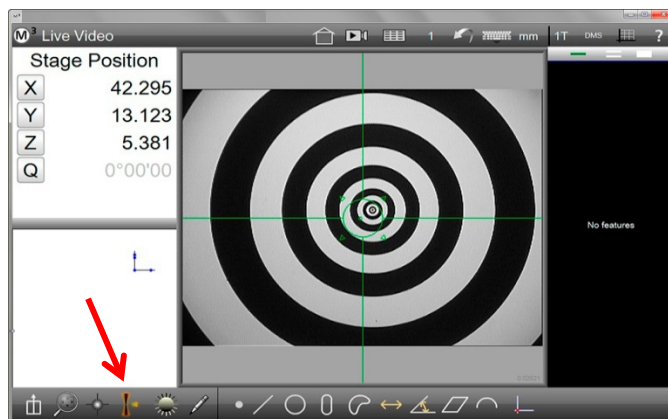


**Enable Auto Focus**

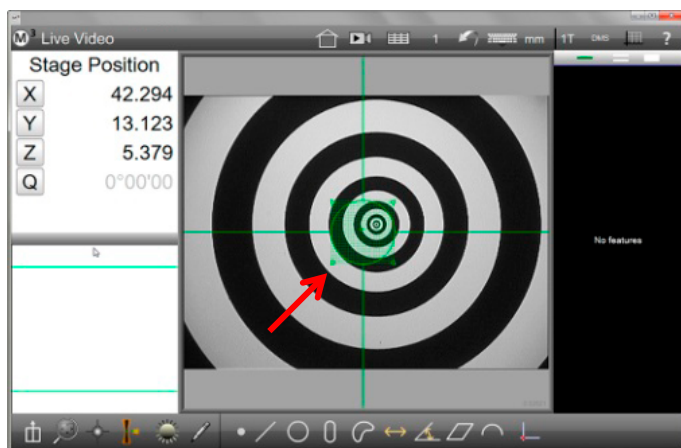


**Change size if desired**

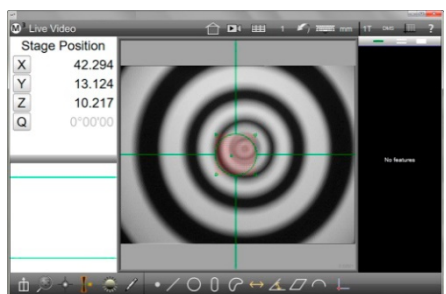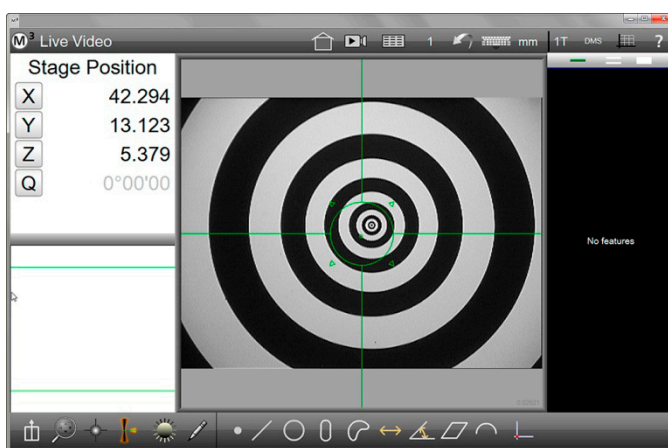

**Out of focus high**

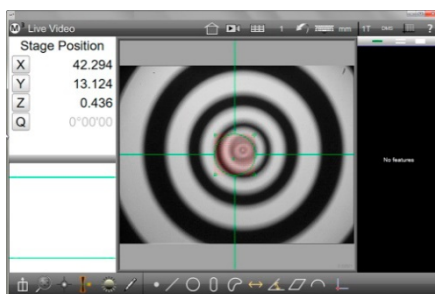


**Out of focus low**

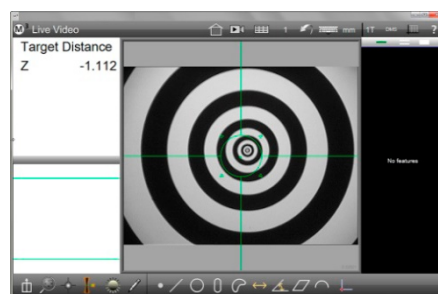

**Focus point found**

- 6 Raise or lower the z-axis to reduce the Target value to zero at the optimum focus position.

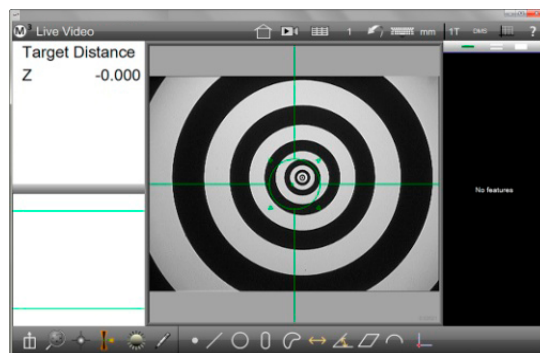

# Video Inspection Software User's Guide


## Focus Assist in CNC Enabled Systems

To use the focus assist in a CNC enabled system:


- 1 Position the standard or active crosshair over the desired part edge.
- 2 Enable the Auto Focus mode.

**Measure toolbar > Focus Mode button**

- 3 Press and drag the triangle handles of the region of interest to change the size if desired.
- 4 Press in the region of interest to initiate auto focus assist. A grid will appear, and the system will raise and lower the z-axis through the range of focus to find and set the optimum focus automatically.

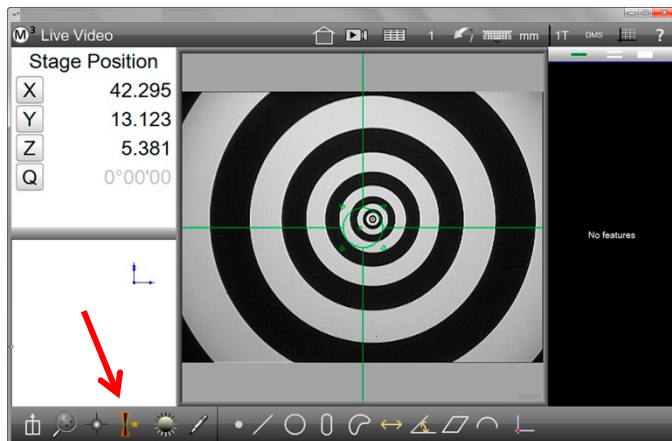

*Enable Auto Focus*

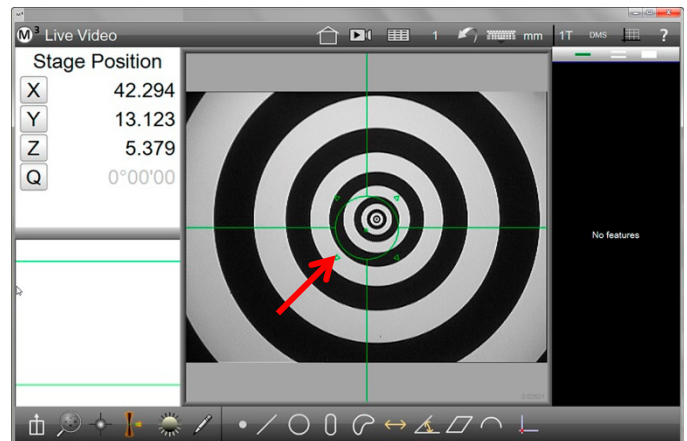

*Change size if desired*

## Auto Focus Measurements

The Auto Focus mode can be used to conduct feature measurements in the optimum focal plane. When performing Auto Focus measurements, the system determines the z-axis position of optimum part focus before collecting feature data points.

In manual systems, the user sweeps back and forth through the range of focus by raising and lowering the z-axis. When the optimum point of focus has been found, a point at the center of the crosshair will be probed. Auto Focus points are probed using the standard or active crosshair in manual systems.

In CNC enabled systems, the system drives the z-axis to the optimum focus point automatically and any of the available probes can be used for autofocus measurements. In CNC enabled systems, and Auto Focus measurement steps are included in M3 part programs.

## Auto Focus Measurements in Manual Systems


To perform Auto Focus measurements in a manual system:

- 1 Select the standard or active crosshair probe from the probe menu.


**Measure toolbar > Probe menu > Standard or active crosshair probe**

- 2 Enable Auto Focus (if it is not already enabled).

**Measure toolbar > Auto Focus button**

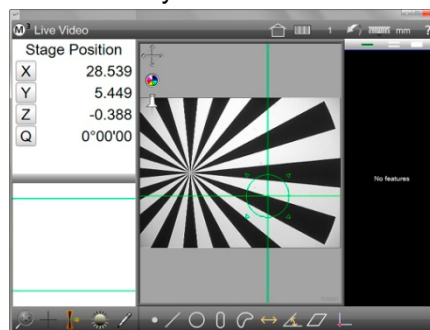

*Crosshair positioned and sized*

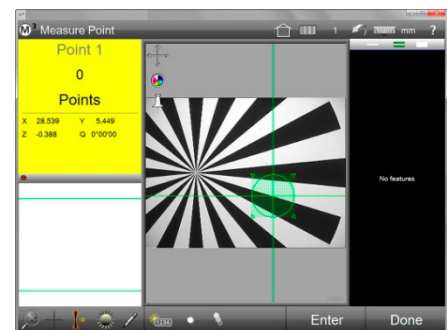

*Auto Focus measurement initiated*




## Video Inspection Software User's Guide

- 3 Position the crosshair probe over the desired feature edge and then press and drag the triangle handles of the region of interest to change its size if desired.
- 4 Press the desired feature measurement button and then press in the Measure Prompt or press the Enter button to initiate the Auto Focus measurement. The Auto Focus grid will be shown. In this example, the Measure Point button was pressed.


**Measure toolbar > Measure Point button**

**Measure toolbar > Enter button**


- 5 Raise and lower the z-axis through the range of focus until a point is probed and shown in the measure prompt viewport.

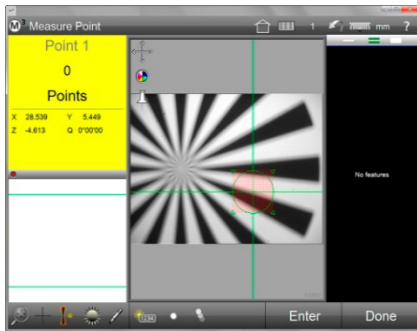

*Out of focus z-axis low*

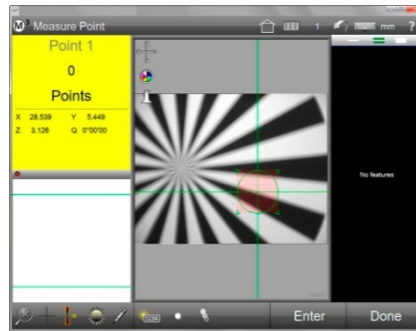


*Out of focus z-axis high*

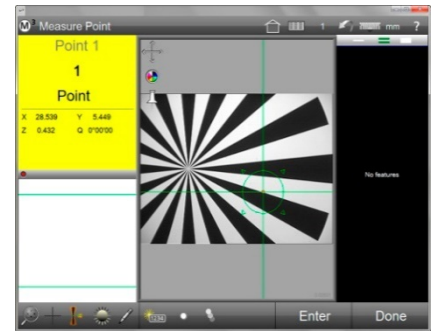

*In focus, point probed*

- 6 Press the Done button to complete the measurement and enter the point into the Feature List.

**Measure toolbar > Done button**

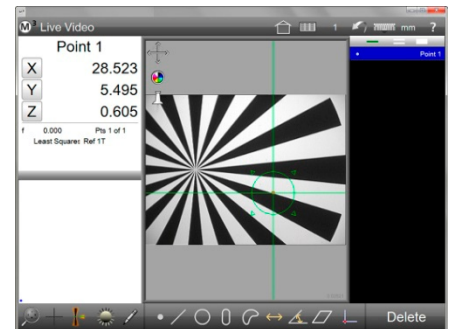

*Measurement completed*

### Auto Focus Measurements in CNC Systems Using Standard and Active Crosshairs


To perform Auto Focus measurements in CNC Systems using Standard and Active Crosshairs:

- 1 Select the standard or active crosshair probe from the probe menu.


**Measure toolbar >  
Probe menu >  
Standard or active  
crosshair probe**

- 2 Enable Auto Focus (if it is not already enabled).

**Measure toolbar >  
Auto Focus button**

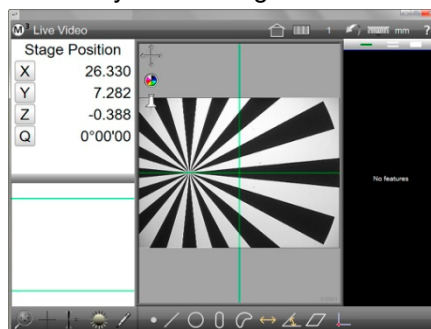


*Simple crosshair selected*

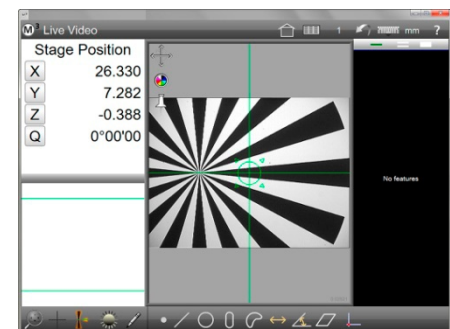


*Auto focus enabled*

- 3 Position the crosshair probe over the desired feature edge and then press and drag the triangle handles of the area of interest to change its size if desired.
- 4 Press the desired feature measurement button and then press in the Measure Prompt or press the Enter button to initiate the Auto Focus measurement. The Auto Focus grid will be shown and the CNC system will raise and lower the z-axis through the range of focus to acquire a point in the optimum focal plane. In this example, the Measure Point button was pressed.


# Video Inspection Software User's Guide

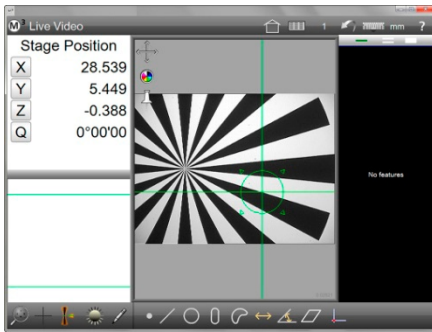

*Crosshair positioned and sized*

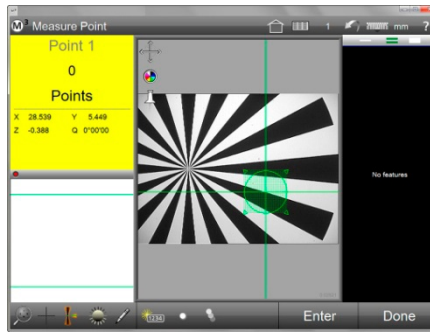

*Auto Focus measurement initiated*

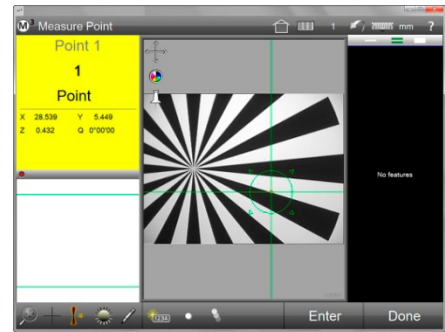


*In focus, point probed*

**Measure toolbar > Measure Point button**

**Measure toolbar > Enter button**

- Press the Done button to complete the measurement and enter the point into the Feature List.

**Measure toolbar > Done button**

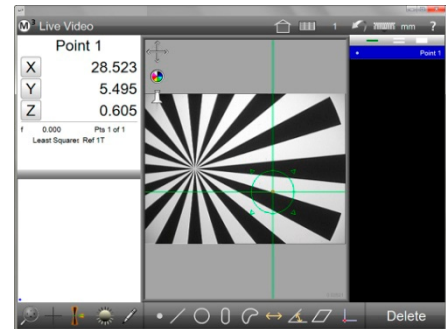

*Measurement completed*

## Auto Focus Measurements in CNC Systems using the Vtouch Probe

To perform Auto Focus measurements in CNC Systems using the Vtouch probe:


- Select the Active crosshair probe from the probe menu.

**Measure toolbar  
> Probe menu >  
Active crosshair**


- Enable Auto Focus (if it is not already enabled).

**Measure toolbar  
> Auto Focus button**


- Press the desired feature edge. The probe will move to the edge and the auto focus grid will appear. Then the CNC system will raise and lower the z-axis through the range of focus to acquire a point in the optimum focus plane. The point will be entered into the Feature List and the probe will return to the center of the screen.

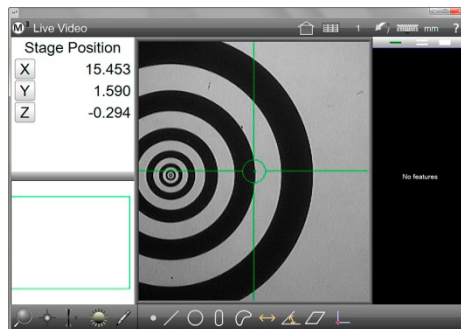


*Vtouch probe selected*

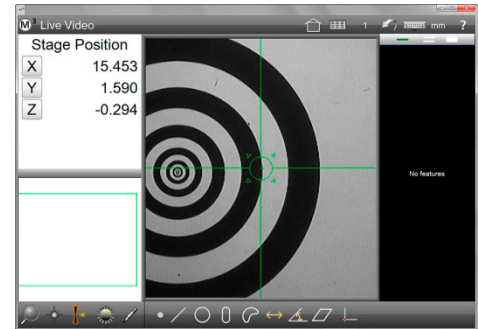

*Auto focus enabled*

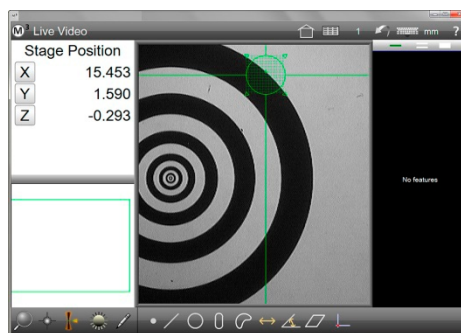

*Touch the desired edge*

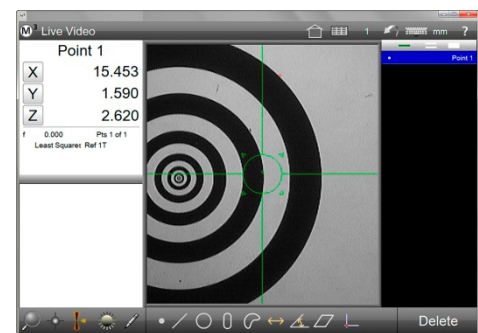


*A point is entered into the Feature List*




## Auto Focus Measurements in CNC Systems using the MeasureLogic Probe

To perform Auto Focus measurements in CNC Systems using the MeasureLogic probe:


- 1 Select the MeasureLogic probe from the probe menu.  
**Measure toolbar > Probe menu > MeasureLogic probe**
- 2 Enable Auto Focus (if it is not already enabled).  
**Measure toolbar > Auto Focus button**
- 3 Press the desired feature edge. The CNC system will raise and lower the z-axis through the range of focus to acquire points along the edge in the optimum focal plane. The points will be evaluated by the system and the appropriate feature will be entered into the Feature List.

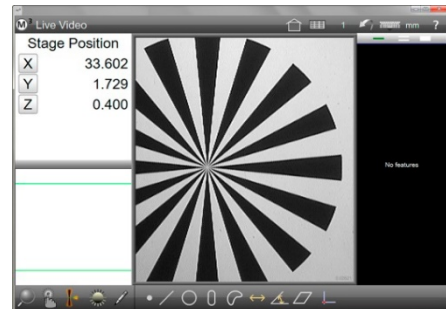

*MeasureLogic and Auto focus enabled*

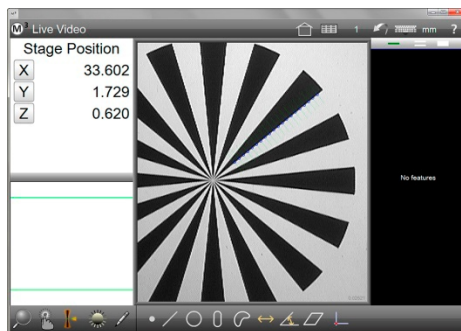

*Touch the desired edge*

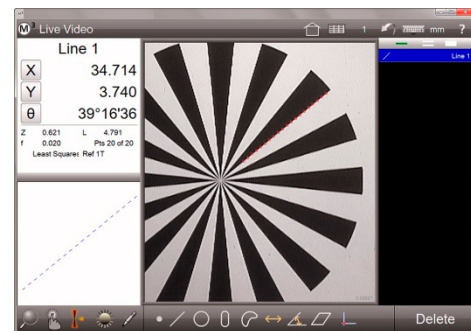


*A feature is automatically entered into the Feature List*


## Auto Focus Measurements in CNC Systems using the EyeMeasure Probe

To perform Auto Focus measurements in CNC Systems using the EyeMeasure probe:


- 1 Select the MeasureLogic probe from the probe menu.  
**Measure toolbar > Probe menu > MeasureLogic probe**
- 2 Press and drag along the desired feature edge to position the EyeMeasure probe over the edge.
- 3 Press and drag the probe handles to change the probe size if desired and then enable Auto Focus (if it is not already enabled).  
**Measure toolbar > Auto Focus button**  
The probe sizing handles will turn red to indicate that the Auto Focus mode is enabled.
- 4 Press inside the EyeMeasure probe to initiate a measurement. The CNC system will raise and lower the z-axis through the range of focus to acquire points along the edge in the optimum focal plane. The points will be evaluated by the system and the appropriate feature will be entered into the Feature List.

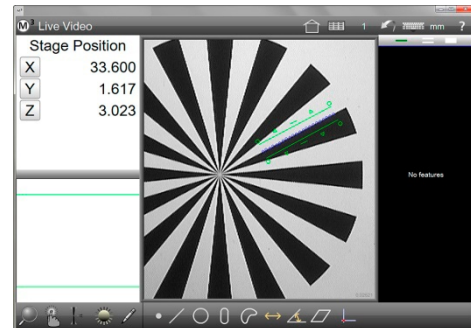

*Press and drag the EyeMeasure probe along an edge*

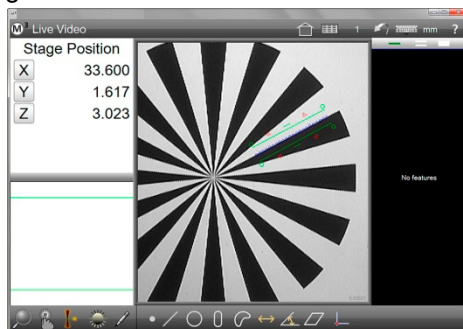

*Enable Auto Focus*

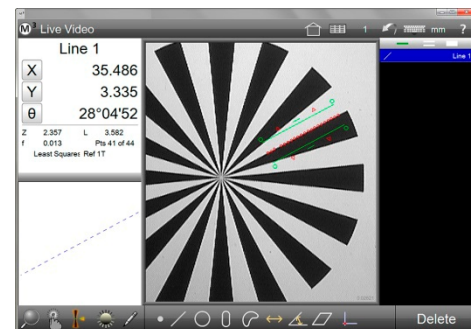

*A feature is automatically entered into the Feature List*

## ***Setting the Number of Points Captured by Multipoint Probes***

The M3 software provides control of video edge detection point density for multipoint probes through the Stitch Spacing setting found in the Video Settings screen. Stitch spacing is defined as the number of pixels between video edge detection points collected and has a default setting of 10. Fewer pixels between points increases the number of points captured.

Adjust stitch spacing to control the number of points collected for a feature of a given size. When more points are desired for a given feature, decrease the stitch spacing. When fewer points are desired, increase the stitch spacing value. To change the value of stitch spacing, navigate to the Stitch Spacing data field in the Video Settings screen and enter the desired value.

**M3 System menu > Settings menu > Video button > Stitch spacing data field**



### **CAUTION**

*The default value of 10 pixels between data points is adequate for most applications. Significantly increasing the pixel space between data points can reduce the accuracy of feature measurements. Increasing or decreasing the point spacing can also affect the reliability of the measure logic probe. It is more difficult for the measure logic probe to make feature determinations when the spacing is too large, and the measure logic tool will follow an edge less effectively if the spacing is too small.*

## ***Using Video Probes Effectively***

The section describes the effective use of the M3 video probes that make use of automatic edge detection. These probes include:

- Active crosshair
- Vtouch
- MeasureLogic
- EyeMeasure

Regardless of edge contrast or form characteristic, the standard crosshair can always be used to enter points by lining the crosshair intersection up with the desired edge and entering points manually.

The probe concepts discussed here apply to the use and behavior of probes in either the non-programmatic (interactive) mode, or in the program edit mode. Probe behavior in program playback will be discussed later in the section.

This probe discussion includes:

- Terms and functions that govern the performance and behavior of the M3 video probes
- Six inspection examples from typical vision inspection applications that will demonstrate the use and applicability of probe terms and functions

## **Video Probe Terms and Functions**

The following terms define many of the functions that govern the performance and behavior of video edge detection probes:

- Vtouch active crosshair
- Auto teach MeasureLogic
- Manual teach MeasureLogic
- Buffer zone EyeMeasure

# Video Inspection Software User's Guide

## Vtouch Active Crosshair

The Vtouch probe is the active crosshair used to acquire a single point by pressing the touch screen or clicking the mouse cursor on an edge. The Vtouch probe:

- Can be used with either auto-taught or manually taught edge parameters
- Provides the ability to choose the best possible point location on an edge thereby improving accuracy and repeatability
- Requires an explicit feature measurement request, except for point features
- Is particularly useful when single point acquisition and flexibility in point placement are required

## Auto Teach MeasureLogic Probe

The auto teach MeasureLogic probe is extremely robust and is suitable for both soft and hard edges. The Auto Teach MeasureLogic probe:

- Operates once for each tool firing, capturing many data points
- Performs a statistical analysis of nearby edges and characterizes them
- Edge parameters are then used, such as threshold (edge strength), and edge width, to follow and acquire points on edges that are parametrically similar
- Is ideal for edges of good form characterization, and weak or strong edge contrast



### NOTE

*To improve low edge contrast point acquisition, the manual edge teach routine described below can be used in conjunction with MeasureLogic probe measurements.*


## Manual Teach Procedure for the MeasureLogic Probe

The default edge contrast recognition parameters are adequate for probing under most conditions using the MeasureLogic (or EyeMeasure) probe. However, when probing in conditions that make good image contrast impossible, edge contrast recognition parameters can be changed by performing the manual teach procedure. The Manual Edge Teach procedure is used to teach the Measure Logic Probe light to dark contrast thresholds when it becomes necessary to measure in the presence of weak edge contrast, thin edges, or both.


- Manual Teach function performs an extensive analysis of edge contrast and calculates several parameters used for subsequent measurements using any of the video edge detection probes
- A color change, to stake and candidate points, indicates points acquired under manually taught conditions
- The manually taught probe can be returned to the default auto teach mode by pressing the Unteach Button

To perform the manual, teach procedure for the MeasureLogic probe:

- 1 When an edge is not recognized by the MeasureLogic probe, press and hold on the edge in the video window. A magnified image of the edge will be shown, and the system will change edge contrast recognition parameters to accommodate the weakly defined edge.

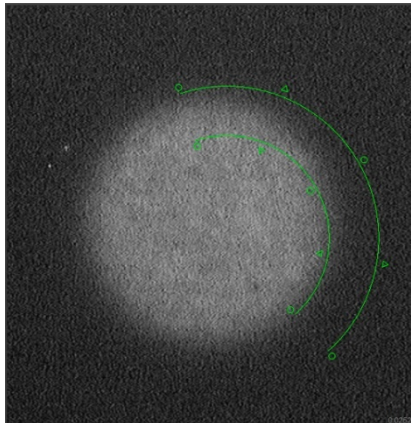

*Edge is not recognized by the MeasureLogic probe*

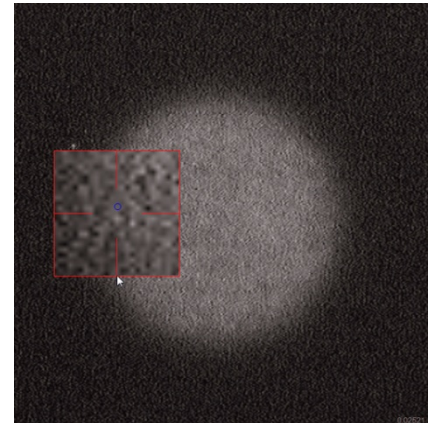


*Press and hold on the edge*

# Video Inspection Software User's Guide

- 2 Release the edge. The MeasureLogic probe can now be used to acquire data points on the low contrast edge. In this example, a circle is probed on an extremely low contrast edge using the EyeMeasure application of the MeasureLogic probe.
- 3 The MeasureLogic probe edge contrast parameters can be reset to the default auto teach parameters by pressing the Unteach button.

Menu toolbar > Probe menu > Unteach

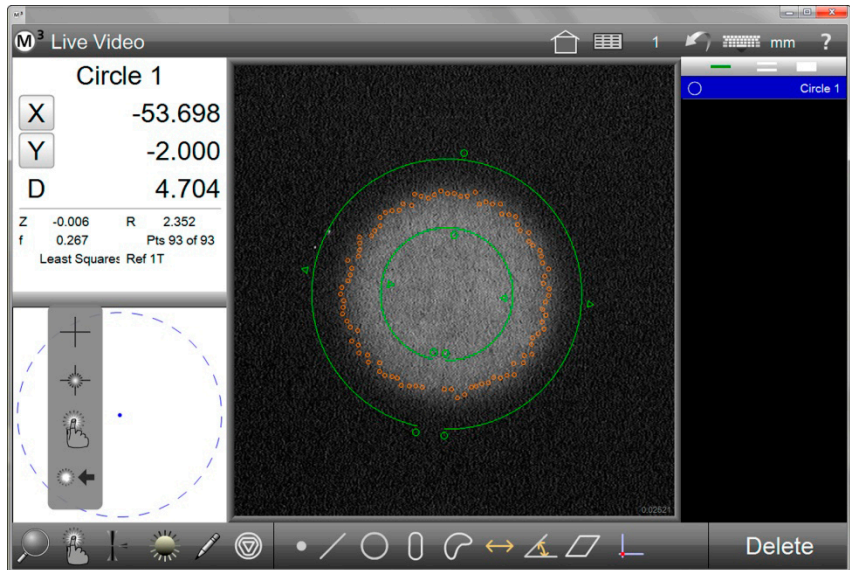

## Advanced Edge Teach

The Advanced Edge Teach (AET) can be used to fine tune controls to the video measurement process, improving edge collection results in complex imaging scenarios. The Advanced Edge Teach dialog provides a more detailed look at candidate edges and provides feedback of the candidate edges detected. Detection of low contrast, narrow, and difficult to image edges is improved with graph-based control of contrast, material direction, and edge width.

Advanced Edge Teach mode can be used in conjunction with any of the existing M3 VED probes.




### NOTE

*Advanced Edge Teach mode can be used in conjunction with any of the existing M3 VED probes. This mode is OFF by default. It can be enabled by navigating to the Video Settings screen in system Settings screen, then setting the "Use advanced teach" flag to "Yes".*

To perform Advanced Edge Teach (AET):




- 1 With any video probe selected, long-press on an edge in the Live Video window. A blue magnification window will pop up. While continuing to hold down the mouse button or your finger, drag the magnification window until the edge of interest is targeted by the small blue ringlet.
- 2 Release the mouse button or your finger to set the edge sample position, identified by a red stitch line drawn across the edge of interest. The AET dialog will also be displayed on the left side of the M3 desktop.

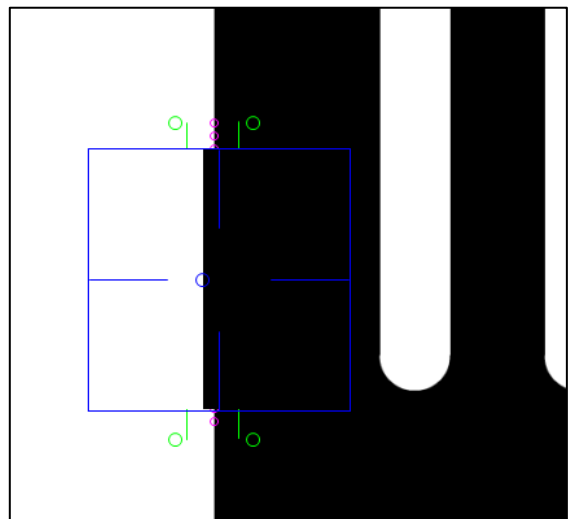



# Video Inspection Software User's Guide

- 3 Adjust the red contrast threshold bar in the contrast graph to set the current threshold for edge detection. The points in the live video window will update in "real-time" to indicate current state of edge detection, based on the AET settings.
- 4 Adjust the Edge Thickness Filter value by pressing the (+) or (-) buttons. This filter sets the minimum number of continuous pixels of sufficient contrast required to be considered a valid edge. The unit is in pixels.
- 5 Using AET with the EyeMeasure Probe enables color sense and direction to be used along with the contrast threshold control to target specific transitions by contrast level.
- 6 Press the "Done" button to save the current AET settings.

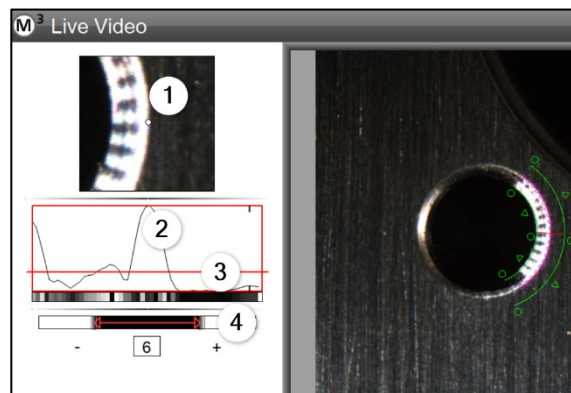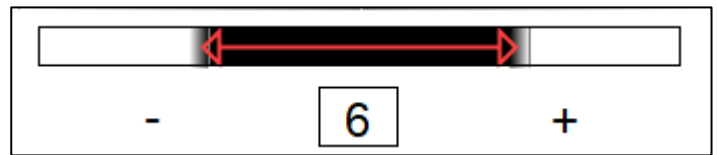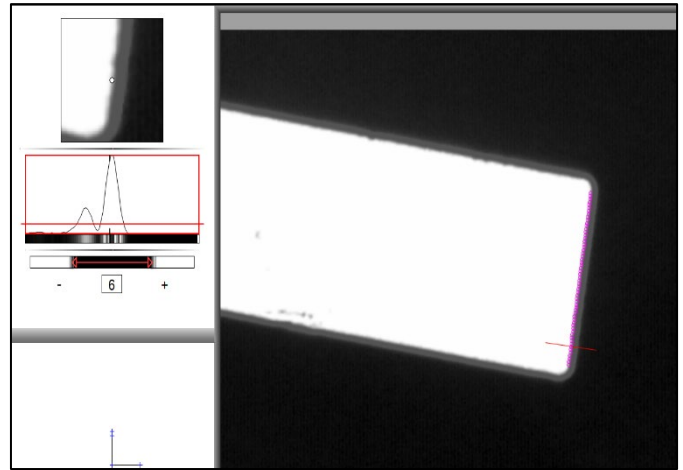

- 1 "Zoomed In" view of current AET stitch.
- 2 Edge contrast of current AET stitch.
- 3 Contrast Threshold control.
- 4 Edge Thickness Filter control.



## NOTE

Once modified edge parameters have been saved, the video probes will be displayed in the toolbar with an orange-colored tint, indicating that the system is currently using modified edge parameters. The edge parameters can be set back to default auto parameters by pressing the orange left-arrow button.



Probes displayed with an orange tint indicate that custom edge parameters are in use.

Press the orange left-arrow button to discard the custom edge parameters and return to default auto edge parameters.

# Video Inspection Software User's Guide

## Buffer Zone EyeMeasure Probe

The EyeMeasure probe is particularly useful and robust in situations of poor edge form, or when it is required or helpful to control the exact length and relative orientation of the point acquisition path. The EyeMeasure video probe:


- Can be used with either the default auto teach, or the manual teach edge parameters
- Attempts to find a continuous edge along a traced path
- Can have its shape, length and rotational orientation modified using one of the buffer handles
- Provides feature type intelligence for Lines, Circles, and Arcs when features are not explicitly requested
- Is particularly useful for features with poor form such as having noisy edges, excess material or contamination, or interrupt features, e.g. a keyway.

## Inspection Example Images

The following six video inspection images demonstrate a variety of edge conditions that may be encountered in typical vision inspection applications. These images will demonstrate the use and applicability of the terms and functions discussed above. Each image is followed by a description of the M3 Video Probe capability or optimization that was utilized to achieve successful acquisition of points on the edge in question.


### High Edge Contrast and Uniform Edge Form

The MeasureLogic probe is typically the ideal tool for high edge contrast applications. Strong edge contrast and consistent feature form are ideal for the automatic edge detection capability of this probe. The MeasureLogic probe can also be used in the alternative EyeMeasure mode. The default auto teach behavior of this probe is generally adequate for edges like the one pictured here.

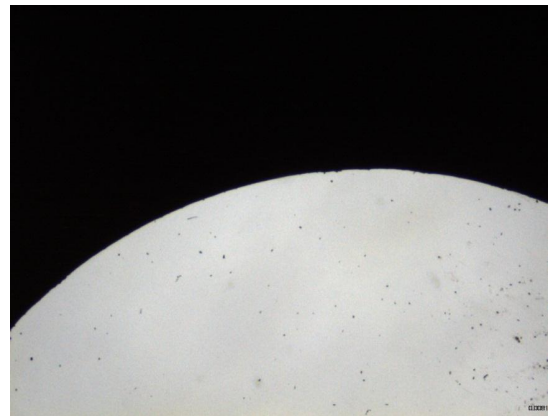

### Low Edge Contrast and Uniform Edge Form

For edges with poor edge contrast, but with good edge form, the manual teach routine can be used to optimize the edge detection capability of the MeasureLogic probe. The consistent edge form makes the MeasureLogic probe a suitable probe choice for successful point acquisition in the sample shown here. The MeasureLogic probe can also be used in the EyeMeasure mode.

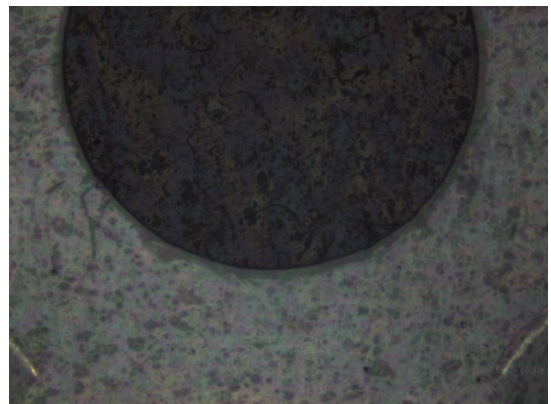


#### **NOTE**

*The manual teach procedure was described in detail earlier in this section.*


## High Edge Contrast and Low Edge Thickness

In some cases, thin edges will require the manual teach routine to be performed. This is especially true when the edge is located close to other edges. In these cases, the manual teach routine optimizes the MeasureLogic probe for a specific edge thickness profile. Following the manual teach routine, the Measure Logic probe will be optimized for point acquisition on thin edges.

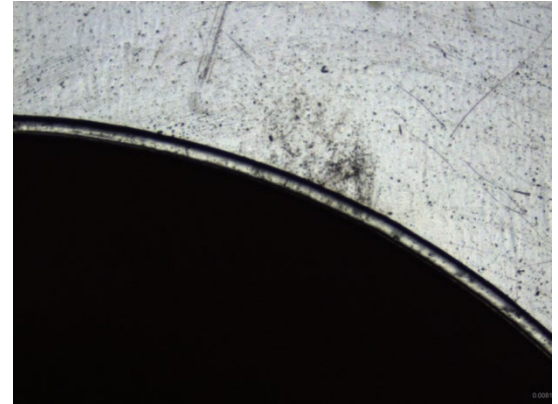

## High Edge Contrast and Irregular Edge Form

For edges that present significant edge contamination, using the EyeMeasure probe can provide enhanced point acquisition within the defined buffer zone of this probe. The EyeMeasure probe is generated by selecting the MeasureLogic tool button from probe menu, and tracing along the desired edge, the buffer zone will be drawn along the traced edge. Features can be measured explicitly, or in the case of lines and circles, automatically, using this probe. Press or click within the buffer zone to fire the probe and acquire points.

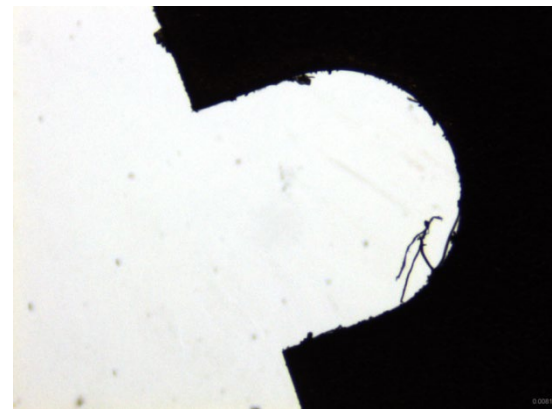

## Low Edge Contrast and Irregular Edge Form

The manual teach routine can also be used in conjunction with the EyeMeasure probe. Due to the poor edge contrast, the image shown here likely requires the edge parameters to be taught prior to adequate point acquisition. The minor to moderate edge contamination exhibited here makes the EyeMeasure probe ideal for probing.




### **NOTE**

*The manual teach procedure was described in detail earlier in this section.*

## Edge Characteristics Requiring Single Point Acquisition


When a single point is desired at a specific location along an edge, the Vtouch probe should be used. The Vtouch probe acquires a single point at an edge location specified by the operator with a single press or click on the video window image. Typically, explicit feature measurements are performed, and the individual points are probed at the desired locations along the edge of a given feature. For edges that have poor edge contrast, the manual teach procedure can be performed prior to utilizing the Vtouch probe to improve the edge detection performance. To use the Vtouch probe, select the Active crosshair in the probe menu. Probe the desired points by pressing or clicking on the edge where you would like to acquire a point.

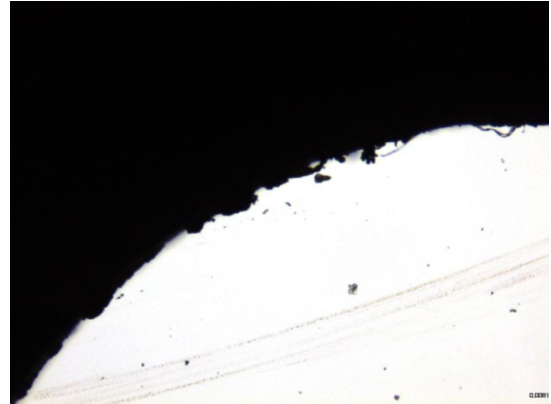

## Features that Extend Beyond the Field of View

In the M3 software, groups of acquired points are assigned to a particular feature measurement based on the probe that was used to capture them and whether the feature measurement was initiated explicitly by selecting a feature type prior to probing points.

The example shown here represents one of the most compelling reasons for **explicit feature measurement**: features that do not fit within the field of view (a single video window). Because manufactured parts are never truly perfect and therefore deviate from perfect form, the M3 software might require the specification of a feature type prior to collecting groups of points. Explicit measurements will ensure that the desired feature is always returned upon completion of a measurement.

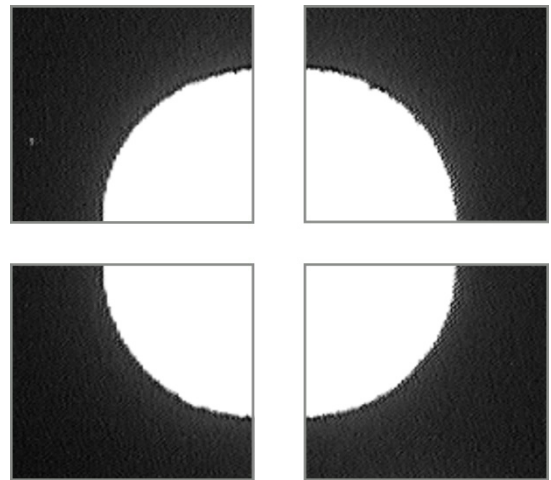

*Feature distributed over four video windows*



### **NOTE**

*A detailed example of measuring beyond the field of view is provided in [Section 4: Measuring, Constructing and Creating Features](#).*

## **Probe behavior in program playback**

Part programs are recorded as measurements are performed. During program playback, the part program remembers the approximate probe position and gradient of each edge that was recorded as part of a feature measurement. As program playback proceeds, the system simply moves to the next recorded position to find an edge. When an edge is found it must be similar to the recorded edge at that position to be considered a valid point for acquisition. Thus, program playback can be viewed as a collection of stage positions and their associated candidate points based on the recorded edge parameters of measured features. The video probe used for the recorded measurement is inconsequential to the way points are collected during playback.

Once part registration has been established, the system advances to the next programmed stage position with a screen press or Enter button press in manual systems and occurs automatically in CNC systems. All valid candidate points that fall within a given field of view will be collected automatically until the feature measurement is complete.



## ***Pattern Recognition***

The pattern recognition function teaches specific image patterns to the system for automatic detection during program playback. Program playback can be improved using a soft-fixture based part alignment routine, utilizing this pattern detection mechanism.


Patterns can be measured, or taught, as datum patterns where the skew and zero positions are set automatically or as standard pattern features where the part or machine coordinate pattern position and orientation are reported for the pattern feature.

## ***Teaching a pattern***

Select the desired pattern to be used for detection in playback. Ideal candidate patterns should contain image characteristics that are unique relative to the rest of the field of view in which they are taught. In addition, target pattern regions should contain reasonable light to dark pixel contrast and be relatively free of image noise and distortion.

To teach a pattern:

- 1 With the desired pattern in the field of view, press the Datum button in the Measure Toolbar to display the Datum Pattern Menu.


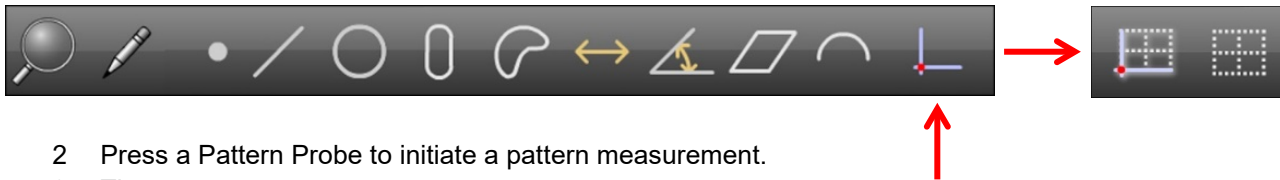


- 2 Press a Pattern Probe to initiate a pattern measurement.
- 3 There are two pattern measurement types:
  - Datum pattern measurement (default type)
  - Standard pattern measurement

## ***Datum Pattern Measurement***

This is the default pattern measurement and sets the measured pattern feature to  $XY=0$  and  $\text{angle}=0$ . To measure (or teach) a datum pattern:



- 1 Select the Measure Datum Pattern tool (default), press and drag to completely enclose the desired pattern. The pattern feature will be shown in the Feature List, and the pattern position and angle will be shown in the detail view, with position and angle set to zero. The pattern will be registered for Program playback as shown in the Part View, and other features can be probed.

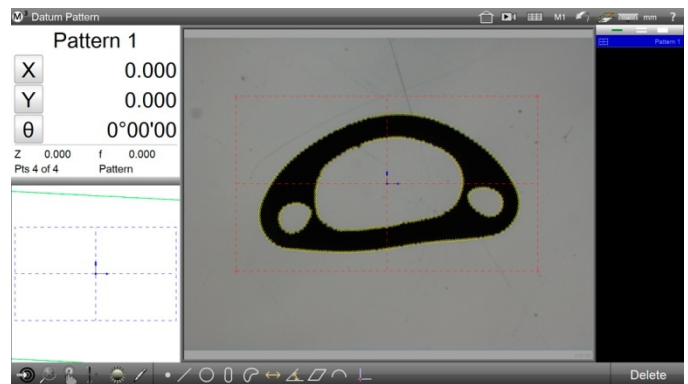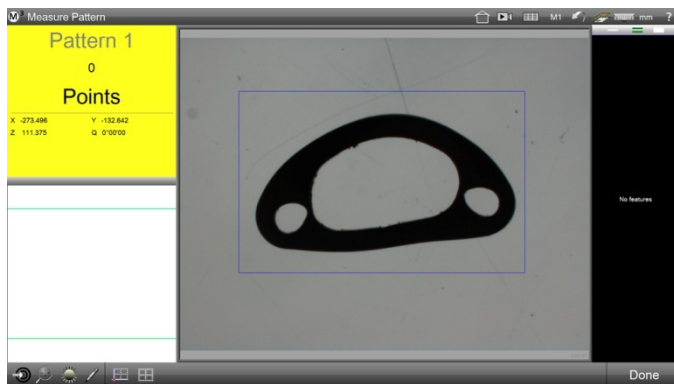

## **Standard Pattern Measurement**

To perform a standard pattern measurement (teach):

- 1 Select the Standard Pattern Tool and then press and drag to completely enclose the desired pattern.

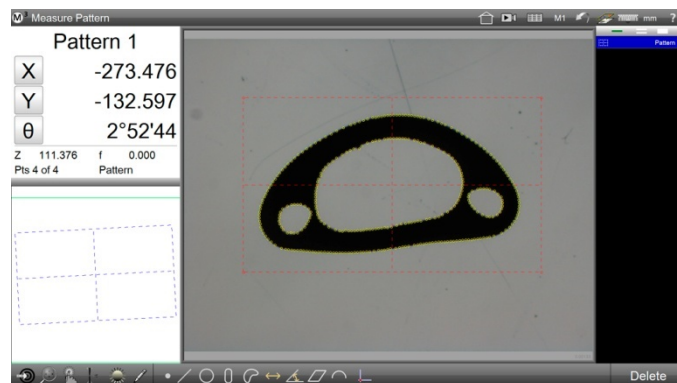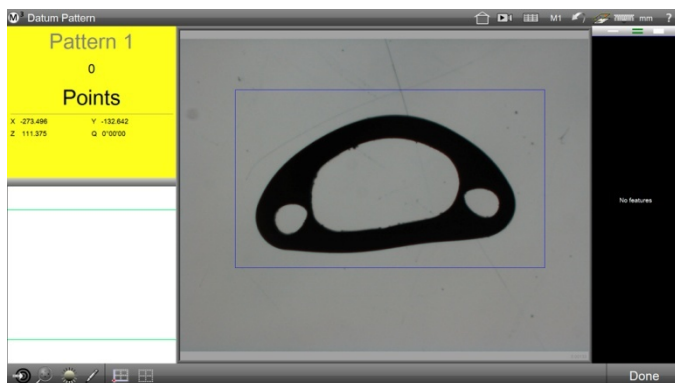

The pattern will be shown in the feature list, and the current stage position and angle will be shown in the detailed view window.




### **Note**

*Standard pattern features are typically used when a datum alignment will be constructed from two or more pattern features.*

## **Pattern Recognition in Program Playback**

Once a fully registered datum pattern has been measured (taught) and other features have been probed, the measuring program can be played back. To play the program:

- 1 Position the datum pattern anywhere in the field of view and then press anywhere in the Live Video window to execute the program. The program will recognize the datum pattern, register the coordinate system and measure any remaining features.

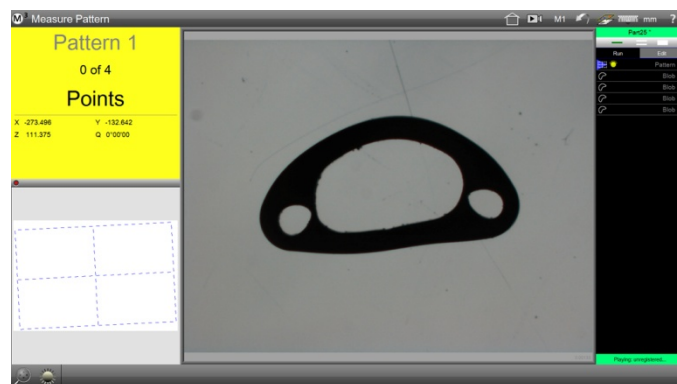

### **Notes**

*In CNC-enabled systems, a message will be displayed asking for playback confirmation prior to any potential stage movement.*


### **Important note for CNC systems**

*The angle of a given pattern is used as a temporary skew in program playback. Because the repeatability of the pattern angle is good only to 1°, subsequent features, particularly when located far from the initial pattern, may not be found automatically. To use the pattern finder most effectively in this case, choose an initial pattern that is located as close to the intended datum features as possible.*

## ***Viewing the Image Source for Pattern Features***

For any measured (taught) pattern feature, the large feature detail screen can be used to view the originally sampled image of a given pattern. To view a pattern:

- 1 Select the pattern feature from the Feature List that you would like to view.
- 2 Press in the small feature detail window at the top left of your screen to access the large feature detail window. The original image sample will be displayed for the selected pattern.

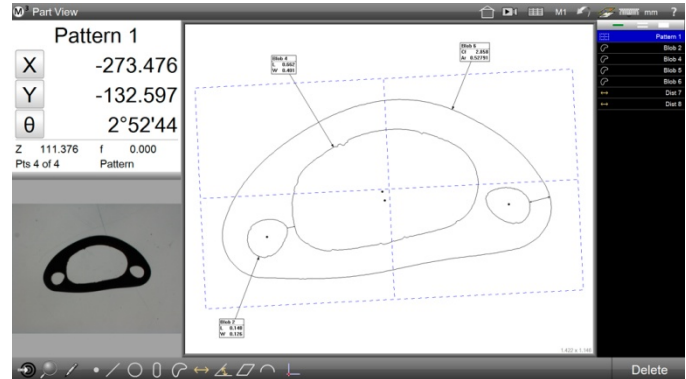

## **Using Touch Probes**

In supporting system touch probes can be used to measure reference skews and datums and 2D and 3D geometric features including points, lines, circles, arcs, slots, rectangles, distances, angles, planes spheres, cylinders and cones. Only the video Measure Blob tool is used to measure blobs.

### ***Straight, Disc, Cylinder and Star Probes***


All touch probes are effectively used in the same way though proper probe selection will be important for certain application where probe tip type and probing direction is critical. To use a touch probe:

- 1 Select the desired touch probe from the Probe menu.  
**Measure toolbar > Probe menu > Touch probe**
- 2 Move the stage to make probe contact at the desired feature location. A point will be entered upon contact.
- 3 Probe the required number of points and then press the Done button to complete a feature measurement.  
**Measure toolbar > Done button**

### **Making Probe Contact**

Probing is optimized by following some simple guidelines:

- Approach the target surface without direction changes in the last 5 to 10 mm
- Try to make the approach direction orthogonal to the target surface
- Do not drag the probe across the surface
- Do not probe sharp edges or allow the tip to slip off an edge

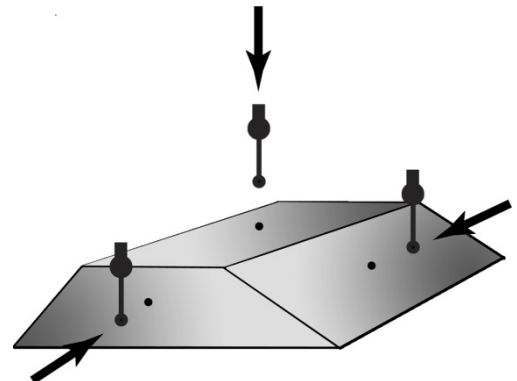

## Touch Probe Setup Operations

Most systems that support the touch probe option are already prepared to probe feature points with a touch probe. However, in some cases it will be necessary to perform some basic probe operations before measuring features:

- Calibrate a probe tip
- Add a probe tip
- Remove a probe tip
- Edit a probe tip
- Change the current probe tip
- Configure probe path data

### Calibrating a Probe Tip

Probe tip diameter and position are calibrated by measuring a certified qualification sphere artifact. Probe tips are calibrated using the:

- Contact Probe Settings screen
- Probe Teach function



#### NOTE


*The system defaults to a sphere artifact but can be configured by the system installer to use a certified ring gauge.*

### Calibrating using the Contact Probe Settings Screen

To access the Contact Probe Settings screen:

- 1 Press the Contact Probe Settings screen button.

**M3 system menu > Settings > Contact Probes**

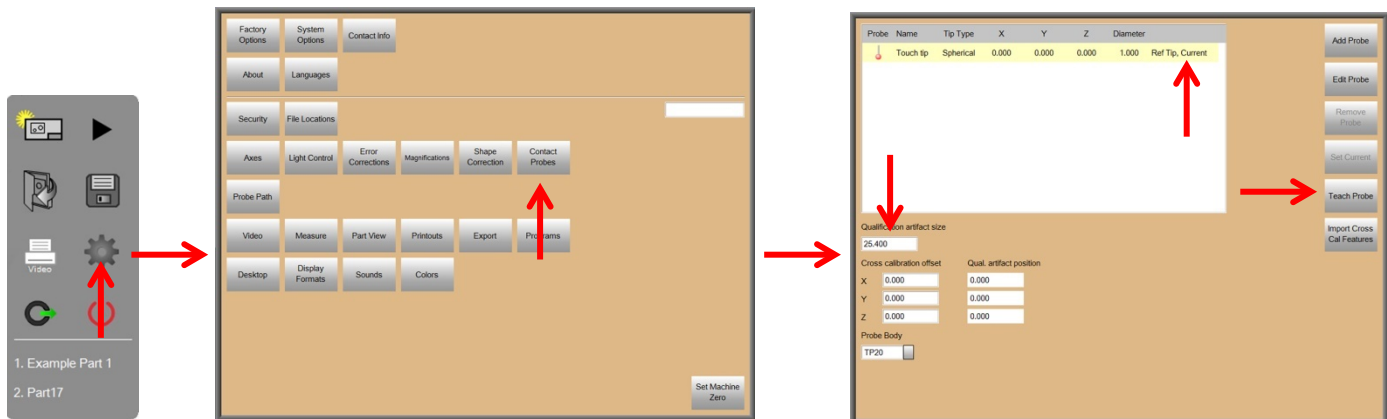

- 2 Confirm that the displayed qualification sphere artifact size matches your qualification sphere diameter in the current unit of measure.
- 3 Verify that the probe tip you wish to calibrate is set as the current probe. If it is not, select it in the probe group and press the Set Current button
- 4 Press the Teach Probe button to display the Teach Probe measure screen.
- 5 Probe a minimum of 4 points well distributed around the qualification sphere and then press Done. The Probe Teach Results dialog will be displayed. The measurement form error should be very small. If the form error is outside acceptable limits, recalibrate the tip. If an unacceptable form error persists, seek technical assistance.

Probe Teach Results


Name	Touch Tip
X	0.000
Y	0.000
Z	0.000
Diameter	1.997
Form	0.003

Done

## Calibrating using the Probe Teach Function

When you are certain that the qualification sphere used in your system is the correct diameter, the Probe Teach function accessed from the Probe Menu may be used to calibrate the probe tip. To initiate the Probe Teach function:



- 1 Press the Probe Menu button and then press the Touch Probe button to select touch probes (if necessary).
- 2 Long-press the Touch Probe button to display the Touch Probe menu, and then select the probe that you wish to calibrate (if necessary).
- 3 Long-press the Touch Probe button to display the Touch Probe menu, and then press the Probe Teach button. The Teach Probe measure screen will be displayed.
- 4 Probe a minimum of 4 points well distributed around the qualification sphere and then press Done. The Probe Teach Results dialog will be displayed. The measurement form error should be very small. If the form error is outside acceptable limits, recalibrate the tip. If an unacceptable form error persists, seek technical assistance.

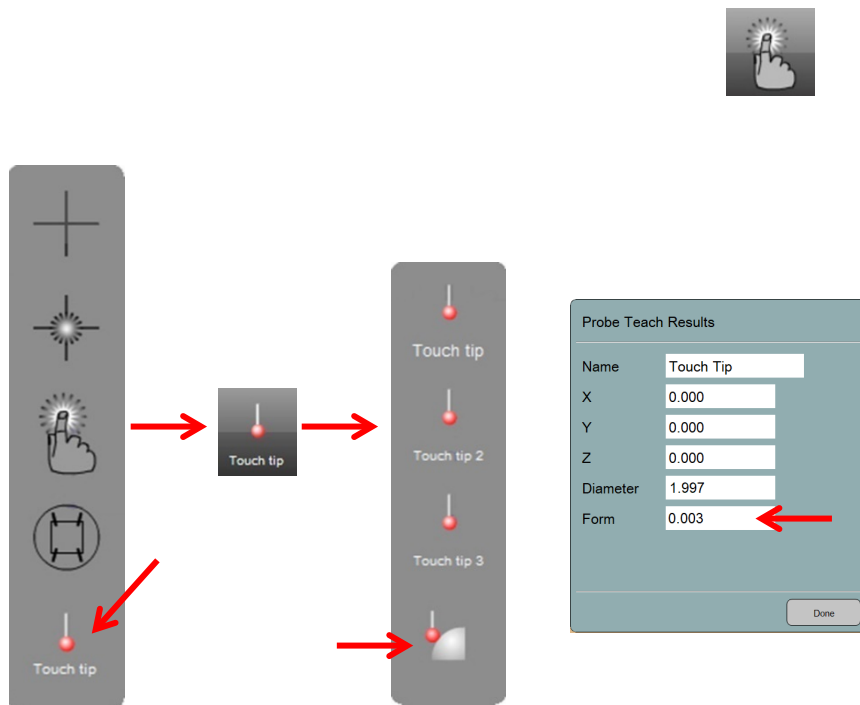

## Adding a Probe Tip

To add a probe tip:

- 1 Press the Contact Probes Settings screen button to access the Contact Probe Settings screen.  
**M3 system menu > Settings > Contact Probes**
- 2 Press the Add Probe button to display the New Contact Probe dialog.

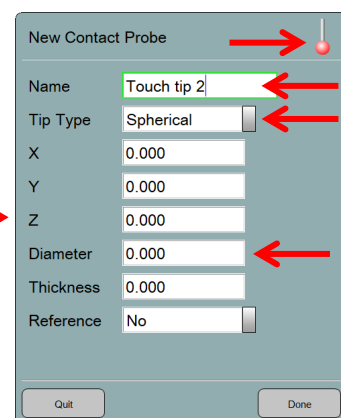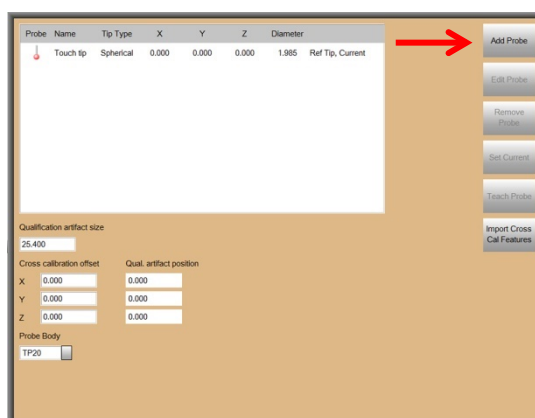

- 3 Press the tip graphic in the upper-right corner of the dialogue to cycle through and select the desired tip orientation. Tip orientations include:
  - Down
  - Left
  - Right
  - Front
  - Back
- 4 Enter a tip name into the Name field.
- 5 Press the Tip Type drop-down button to select a type. Types include:


# Video Inspection Software User's Guide

- Spherical
  - Disk
  - Cylindrical
- 6 Press the Reference drop-down button to designate the probe as the reference if desired.
  - 7 Press Done. The new probe tip will be displayed in the probe group and must now be calibrated. Select the new tip, press the Set Current button, and then press the Teach Probe button to calibrate the tip as explained earlier.

## Removing a Probe Tip

To remove a probe tip:

- 1 Press the Contact Probes Settings screen button to access the Contact Probe Settings screen.  
**M3 system menu > Settings > Contact Probes**
- 2 Select the desired probe in the probe group and press the Remove Probe button.

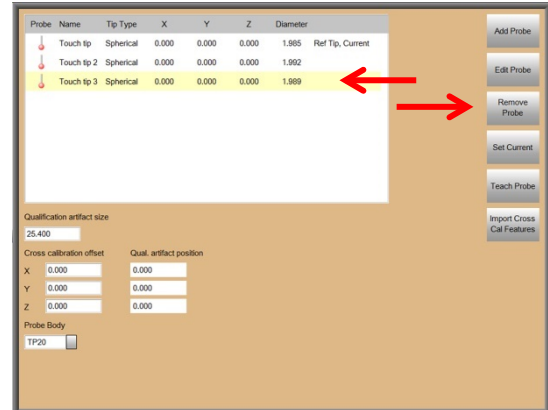

### CAUTION

*When multiple probes are shown in the probe group, it is possible to remove the reference probe. It may be necessary to remove the reference probe if the tip becomes damaged, or there may be instances when the reference probe tip needs to be replaced to address the requirements of a specific application. When the reference probe tip is replaced, the current calibrations of all other tips in the group become invalidated and after the calibration of the new reference tip, new calibrations of all other probes will need to be performed.*



### NOTE

*When the current probe is removed, but is not the reference, the system sets the reference probe as current.*



## Editing a Probe Tip

Probe tips can be edited to:

- Change the name
- Assign a tip type
- Designate the probe as the reference

All probe editing is performed in the Edit Contact Probe dialog of the Contact Probe Settings screen. To display the Edit Contact Probe dialog for the probe to be edited:

- 1 Press the Contact Probes Settings screen button to access the Contact Probe Settings screen.

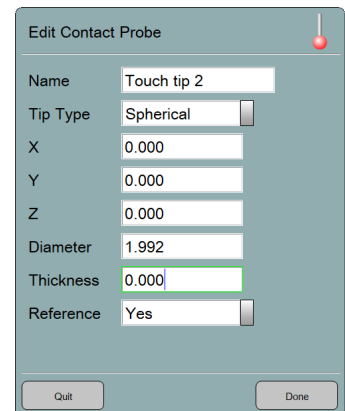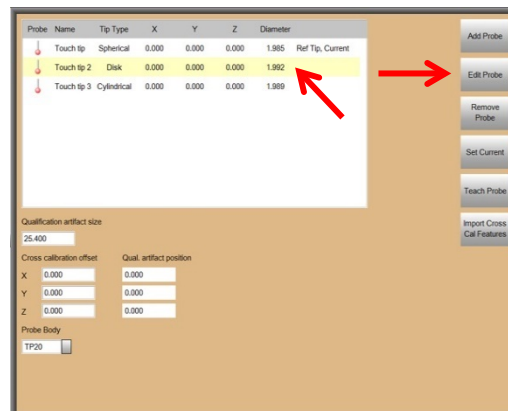



# Video Inspection Software User's Guide

## M3 system menu > Settings > Contact Probes

- 2 Select the probe tip to be edited from the probe group.
- 3 Press the Edit button to display the Edit Contact Probe dialog.

### Changing the probe Tip Name

To change the name:

- 1 Enter the new name into the Name field and press Done.

### Assigning a Tip Type

To assign a tip type:

- 1 Press the Tip Type drop-down box button, select the desired type and press Done. Available tip type assignments include:
  - Spherical
  - Disk
  - Cylindrical

### Designating the Probe as a Reference

Any probe in the probe group can be designated as the reference.



#### **CAUTION**


*When the reference probe tip is changed, the current calibrations of all other tips in the group become invalidated and after the calibration of the new reference tip, new calibrations of all other probes will need to be performed.*

To designate a probe as the reference, press the Reference drop-down box, select Yes and press Done.

### Changing the Current Probe Tip

To change the current probe tip:

- 1 Press the Contact Probes Settings screen button to access the Contact Probe Settings screen.  
**M3 system menu > Settings > Contact Probes**
- 2 Select the desired probe in the probe group and press the Set Current button. The selected probe will now be shown as current in the probe group.

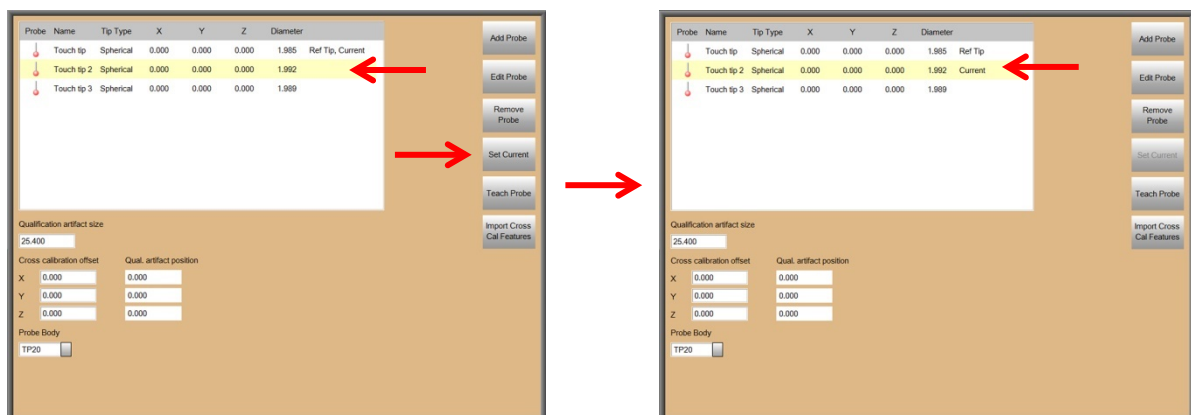



## NOTE

When a probe is selected from the Probe menu of the Measure toolbar it is set as the current probe.

## Configuring Probe Path Data

The probe path data settings define the default probe touch probe behavior for CNC programs. All probes used in programs initially use the default probe path data settings. These settings can be edited in program steps when the default probe behavior needs to be modified to meet the needs of a specific application. Editing probe path data steps is discussed in [Section 11: Programming](#).

Probe path data are configured in the Probe Path Settings screen. To configure probe path data:

- 1 Press the Probe Path Settings screen button. The Probe Path default configuration will be displayed.

**M3 System menu > Settings > Probe path**

Probe path data configuration fields include:

- Approach distance: Distance from the anticipated target surface where probing speed is initiated in the current unit of measure. The approach path is calculated by the system to be approximately orthogonal to the target surface.
- Search distance: Distance added to the approach distance when surface contact is not made at the anticipated location. The measurement fails if contact is not made within the search distance.
- Clearance distance: There are two clearance distances of the same value. One clearance is toward the target and included after the non-probing speed to the target and before the approach distance. The second is away from the target and included after the retract distance and before the next non-probing speed begins to the next target. The clearance moves are intended to locate the probe so that the to-target and from-target moves will be unobstructed. The clearance directions are determined by the system based on the target feature surface being probed and generally moves along the probe tip axis
- Retract distance: Distance that the probe moves immediately after contact is made with the target surface in the current unit of measure. The retract path retraces the approach path for a small distance at higher speed.  
Retract speed: The speed in the retract region expressed in mm per second
- Probing speed: The speed in the approach and search regions expressed in mm per second
- Non-probing speed: The maximum probe speed between features

Approach Distance	3.000
Search Distance	3.000
Clearance Distance	12.000
Retract Distance	3.000
Retract Speed	100.000
Probing Speed	20.000
Non Probing Speed	100.000



## CAUTIONS

When preparing programs for parts that include complex surface variations in 3D space, care must be taken to avoid probe collisions. The clearance distance might not be adequate to eliminate collisions and might need to be replaced or supplemented with manually programmed Goto (safe) moves. Goto moves are discussed in [Section 11: Programming](#).

The default Non-probing speed might be too high for first executions of complex part programs. Debugging complex programs at lower Non-probing speeds reduces the possibility of probe damage. The Non-probing speed can easily be changed in program steps during the program debugging process.



## Section 4: Measuring, Constructing and Creating Features

Measurements can be performed on manual and CNC enabled systems using single point video, multipoint video or touch probes. Measurements can be performed explicitly using any probe or automatically using the MeasureLogic or EyeMeasure probes. Blobs must be measured explicitly using a special tool. The measurement of blobs is a special case discussed later in this section. Additional measurement tools are provided for FOV systems. FOV systems are discussed in detail in [Section 12: Field of View Functions](#).



### NOTES

*Most measurement, construction and feature creation concepts discussed in this section apply equally well to encoder-based moveable stage systems and fixed stage FOV systems. However, some of the material in this section will not apply to FOV systems, such as material regarding CNC control or encoder-based positioning and location. Measurements in FOV systems occur only in a fixed position field of view and are based on video pixel resolution.*

*Touch probes are provided only as an option on CNC systems.*

Measurement activities can include:

- Measuring features by probing
- Constructing features
- Creating new features based on data provided by the user

Users can perform quick checks of individual part features without establishing a reference frame or can establish a reference frame including a part level, part skew and zero datum in preparation for formal measurements that will be compared to part drawings and be recorded as a part program.

## Explicit and Automatic Measurement

Explicit feature measurements are always performed by pressing the desired Measure Feature button and then probing at least a minimum number of required points on the feature's edge. Features measured with the MeasureLogic or EyeMeasure tool can be measured explicitly or can be measured automatically by allowing the M3 software to determine the feature type based on the data points collected. Touch probe measurements are always explicit.

## Feature Constructions

Feature constructions are performed explicitly by pressing the desired Measure Feature button and then selecting the parent features from the Feature List or from the Part View that will be used for the construction. When the feature construction is complete the resulting construction will be added to the Feature List and Part View.

## Feature Creation

Features are created by pressing the desired Measure Feature button, pressing the associated Create Feature button and entering the desired feature parameter data into the fields provided.

## Preparing for Measurement Activities

Preparation for measurement can include the following:


- Lighting adjustment
- Teaching video edge recognition
- Calibrating a touch probe tip
- Configuring (touch) probe path data

### Lighting Adjustment

To make stage lighting adjustments:

- 1 Press the Light Control button to superimpose the light lighting controls over the Live Video part image.
- 2 Adjust the sliders or enter values into the data fields to obtain the desired part lighting.

**Measure toolbar> Light Control button**

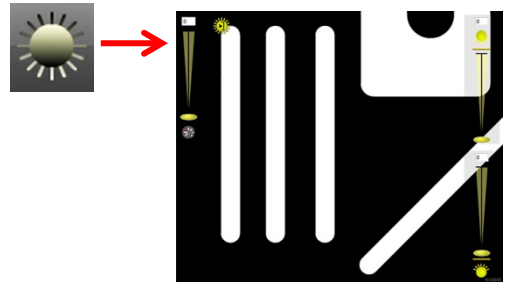


### Image Processing

It is possible for an edge to be the same luminance value but have a color difference. As the VED algorithm only works in luminance and cannot differentiate between different colors, it is essential to process the image under measure to achieve the contrast necessary for a successful edge detection. The system provides four image processing controls: hue, range (lightness), contrast and threshold.



#### NOTE



*The Image Processing function is OFF by default. To turn ON the function, access the system settings, press the Video button then set the Image Processing field to YES. Press the Done button (bottom right), then press Done again to save the changes and exit system settings.*

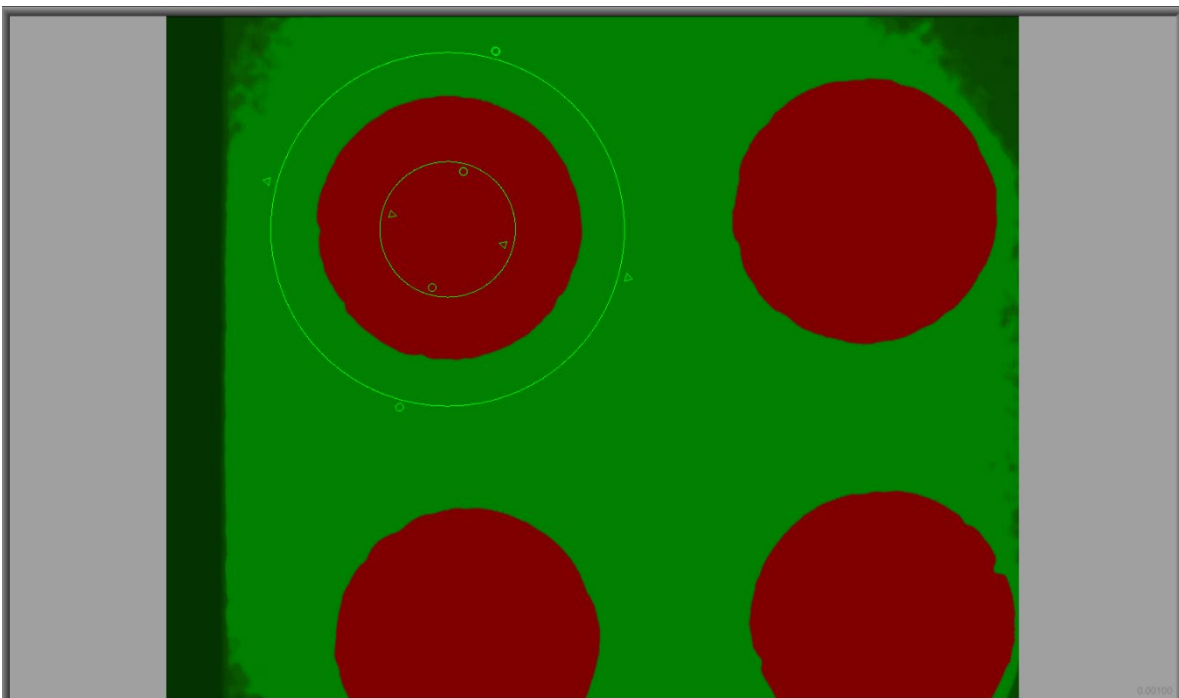

# Video Inspection Software User's Guide

To process an image:

- 1 Press the Light Control button, then press the Image processing to superimpose the image processing controls over the Live Video part image.

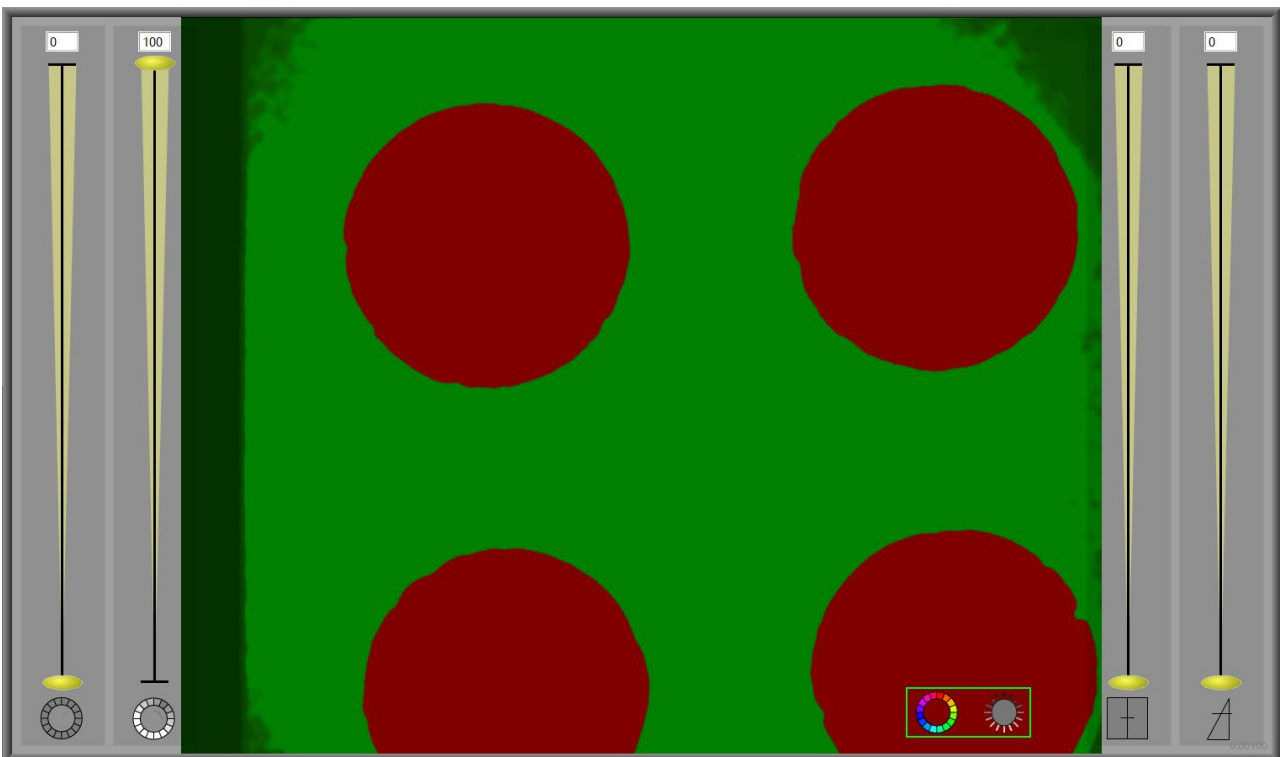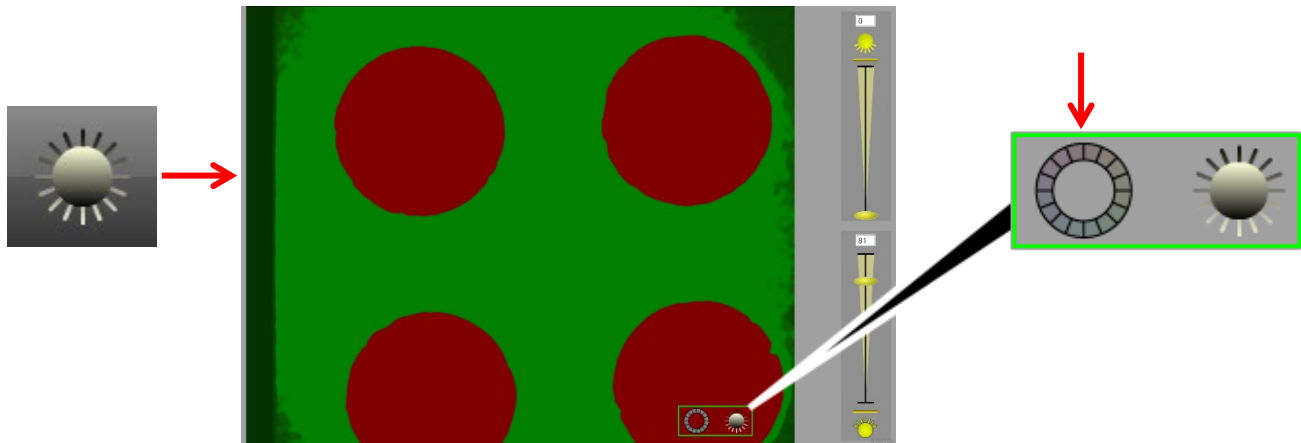



- 2 Adjust the sliders or enter values into the data fields to obtain the desired image contrast.
- 3 Click on the Live Video window to exit image processing.



## NOTE

To toggle image processing ON or OFF, access the image processing sliders by following the steps above then clicking on either rings on the left (to toggle hue and range), and either rectangle or triangle on the right (to toggle contrast and threshold).

# Video Inspection Software User's Guide

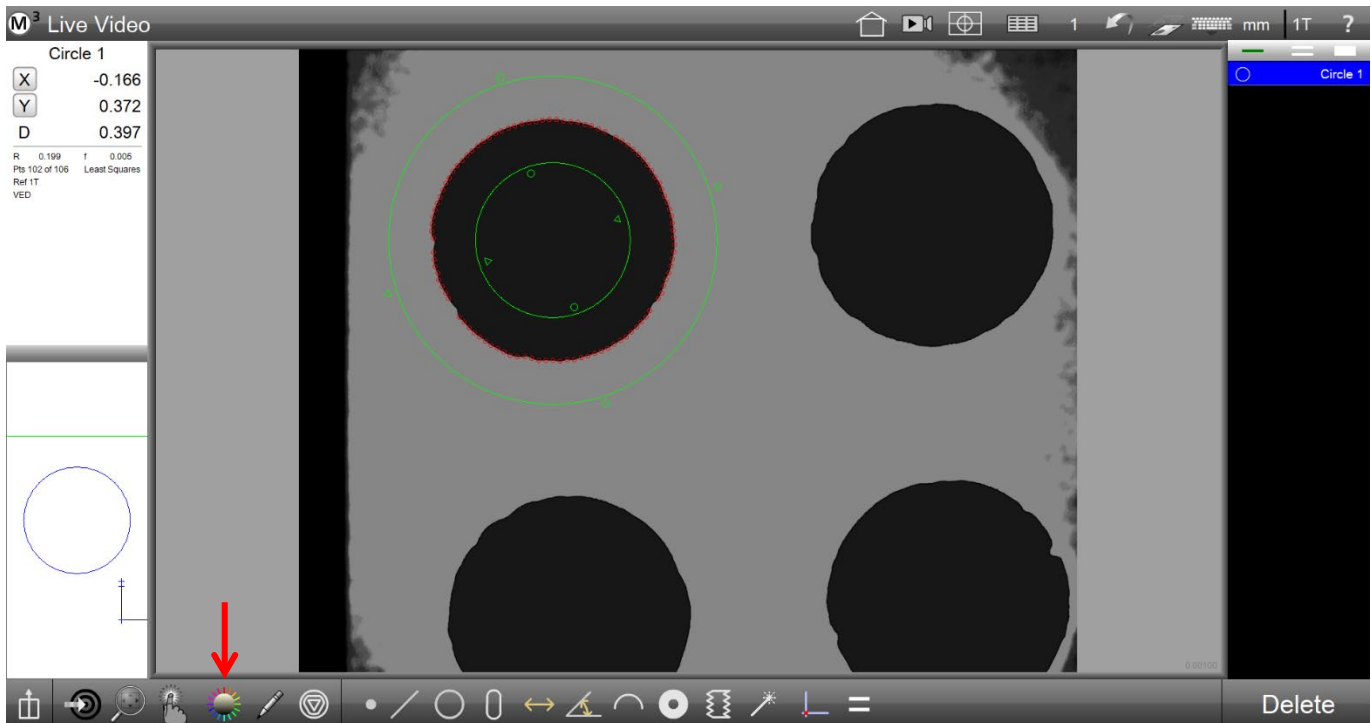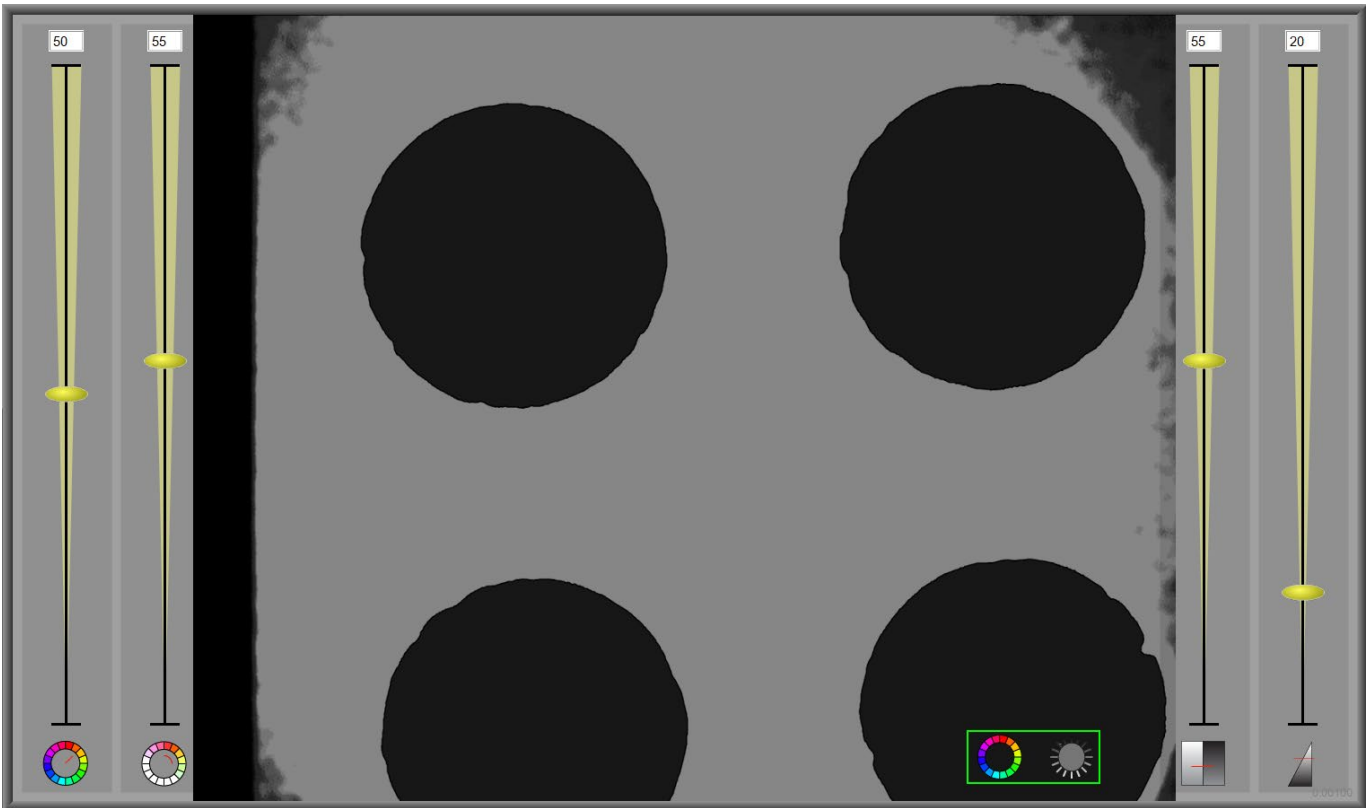

## NOTE

The Light Control button is shown with color palette spikes when image processing is active.



## Calibrating a Touch Probe Tip

Please refer to [Touch Probe Setup Operations](#) in [Section 3: Probes](#).

## Configuring (Touch) Probe Path Data

Please refer to [Configuring Probe Path Data](#) in [Section 3: Probes](#).

## Teaching Video Edge Recognition

Default edge detection parameters are adequate for most applications. However, poor contrast images can make multipoint probing with the edge detection probes difficult or impossible. The edge detection parameters can be changed to optimize probing. Please refer to the *Manual Teach Procedure for the MeasureLogic Probe* discussed earlier in [Section 3: Probes](#) for detailed instructions.

## Establishing a Reference Frame

While a reference frame might be unnecessary for quick checks of part features in prototyping or similar environments, a reliable measurement reference must be established before part features can be measured as part of a formal manufacturing or inspection process. The M3 measurement reference frame can consist of:

- Part leveling (a primary datum plane)
- Skew alignment (secondary alignment)
- Part Datum (measurement coordinate system origin)

## Part Leveling

When the surface plane of a part is not orthogonal to the measuring axes, small cosine errors can be generated during the measurement process. These errors can be eliminated by leveling the part.




### NOTE

*This might not be required in most well-maintained systems. Additionally, for VED measurements, if the depth of field of the camera system is not less than the level error, no benefit can be gained from leveling the part. Part leveling of 15° or more is not permitted.*

To measure a primary datum plane:

- 1 Select the desired probe from the probe menu.  
**Measure toolbar > Probe menu > Desired probe**
- 2 Press the Datum Plane button of the Datum menu.  
**Measure toolbar > Datum menu > Datum plane button**

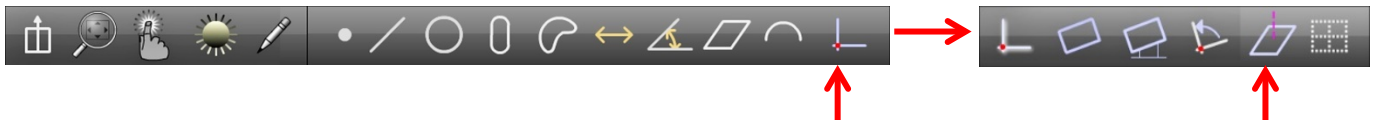

- 3 Probe a minimum of three points evenly distributed across the surface of the part. Probing more than three points increases the accuracy of the measurement.
- 4 Press the Done button to complete the measurement and enter the datum plane into the Feature List.  
**Measure toolbar > Done button**



### NOTE


*Previously measured or constructed plane features can also be leveled by manually zeroing the theta angle coefficient and the Z position coefficient. Pressing the label buttons to the left of these coefficients in either the feature detail screen or the DRO viewports will set the corresponding values to zero.*

## ***Skew Alignment***

When a part is misaligned (twisted) in the XY plane, small cosine errors can be generated during the measurement process. These errors can be eliminated by creating a skew alignment for the part. The skew alignment performs a precise measurement of the part of misalignment in the XY plane. Once the misalignment is known to the system, subsequent feature measurements are automatically compensated to eliminate cosine errors. Measurement data in the feature detail screen and DRO viewports will reflect measurements of a perfectly aligned part.

To create a skew alignment:

- 1 Select the desired probe from the probe menu.  
**Measure toolbar > Probe menu > Desired probe**
- 2 Press the Skew button of the Datum menu.  
**Measure toolbar > Datum menu > Skew button**

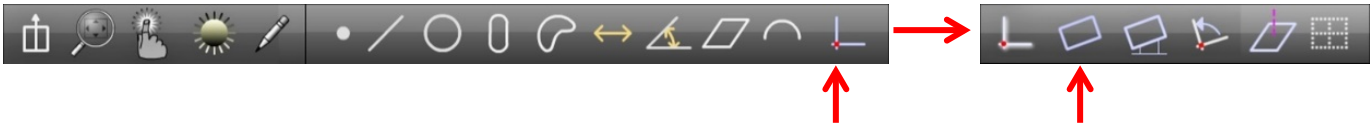

- 3 Probe a minimum of two points well distributed along the entire length of the desired part reference edge.
- 4 Press the Done button to complete the measurement and enter the skew line into the Feature List.  
**Measure toolbar > Done button**

## ***Part Datum***

Creating the part datum point is the final step in establishing a valid reference frame for subsequent measurements. The part datum can be created by:

- Probing a single point
- Constructing a point from one or more parent features
- Manually zeroing the X and Y coefficients of a feature

### **Probing a Part Datum Point**

The part datum can be created directly by probing a point. To probe a part datum point:

- 1 Select the desired probe from the probe menu.  
**Measure toolbar > Probe menu > Desired probe**
- 2 Press the Datum button.  
**Measure toolbar > Datum button**
- 3 Probe the desired point and press the Enter button or in the Measure Prompt window. The point will be probed.  
**Measure toolbar > Enter button or Measure Prompt window**
- 4 Press the Done button to complete the measurement and enter the part datum point into the Feature List.  
**Measure toolbar > Done button**

## ***Constructing a Skew and Part Datum Point from Parent Features***

The skew alignment and part datum can be constructed from one or more parent features that are contained within the Feature List when simply probing a desired point or skew line is not convenient or possible. Supported point and line constructions are specified in *Constructing Features* later in this section.

### **Skew**

To construct a skew line from a pair of positional features (two circles in this example):

- 1 Press the Skew button.  
**Measure toolbar > Datum button > Skew button**
- 2 Select the desired parent features or features in the Feature List, such as two circles.

# Video Inspection Software User's Guide

- 3 Press the Done button to complete the construction and enter the part skew alignment into the Feature List.  
**Measure toolbar > Done button**

## **Datum Point**

To construct a datum point from a single feature:

- 1 Press the Datum button.

**Measure toolbar > Datum button**

- 2 Select the desired parent feature or features in the Feature List.
- 3 Press the Done button to complete the construction and enter the part datum point into the Feature List.


**Measure toolbar > Done button**

## ***Creating a Datum by Manually Zeroing the X and Y Coefficients of a Feature***


Any of the features contained in the Feature List can be used as a part datum by manually zeroing the X and Y feature coefficients. The X and Y coefficients can be zeroed in the DRO viewport or in the feature detail screen. To zero the X and Y coefficients of a feature:

- 1 Select the desired feature in the Feature List.
- 2 Press the X coefficient button and then the Y coefficient button in the DRO viewport or in the feature detail screen. The X and Y values will become zero establishing the geometric center point of the feature as the part datum point.

In this example, the geometric center point of circle 1 was set to zero and will serve as the part datum point for subsequent measurements.

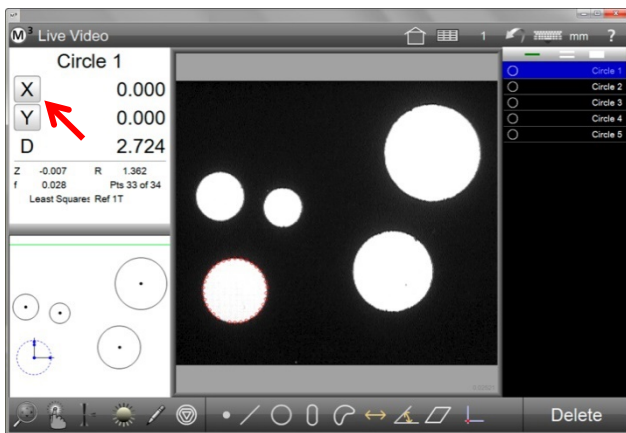

***X and Y set to zero in the DRO***

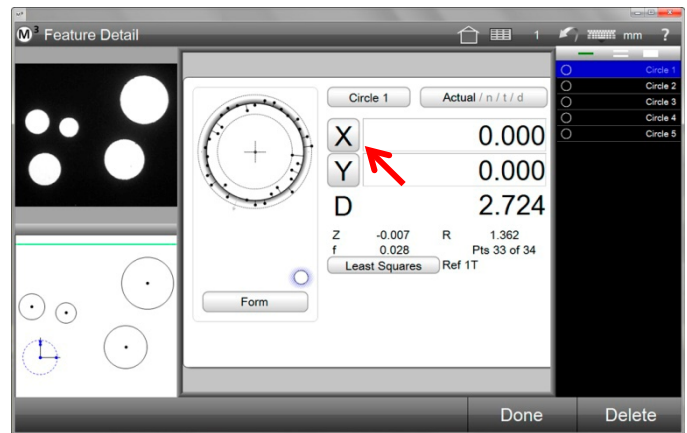

***X and Y set to zero in the feature detail screen***



## Probing and Measuring Features

Part features are measured by probing and collecting points that define the feature shape and location. Features can be measured explicitly using any probe or automatically using the MeasureLogic or EyeMeasure probes. Explicit feature measurements are always performed by pressing the desired Feature Measure button and then probing at least the minimum required number of points on the feature's edge. Features measured with the MeasureLogic probe can be measured explicitly as above, or by allowing the system to determine the feature type automatically based on the data cloud of points collected. Features can be probed manually or automatically as part of a part program using video edge detection or touch probes in CNC enabled systems. Probed features are shown in the Part View and entered into the Feature List. As mentioned earlier, the measurement of blobs is a special case requiring explicit measurements using a special tool.

The following feature measurements are supported by the M3 system:

- Points
- Lines
- Circles and arcs
- Slots and rectangles
- Patterns (teaching patterns for recognition in program playback)
- Distances
- Angles
- Planes
- Blobs
- Spheres
- Cylinders
- Cones



### NOTE

*Pattern recognition is only supported in CNC systems or in manual systems that also have the Digital Comparator option enabled.*

Occasionally the system can misinterpret probed data points, particularly when there is not an even distribution of points collected along the entire feature edge. This can lead to feature identification errors. The Change Feature Type button can be used to change the type of a feature selected in the Feature List or Part View when identification errors occur. For example, a circle feature can be changed to an arc. The Change Feature button is not shown in the Measure toolbar when there are no alternative feature types for the selected feature.



Detailed feature information including coefficients, geometric form, fit type and the data cloud of points probed is always available in the Feature Detail screen discussed in [Section 6: Feature List, Feature Detail and Part View Functions](#). A graphic drawing of the feature and the data cloud of points probed is also available in the Feature Detail screen. Tolerances can always be applied to measured features and are discussed in [Section 8: Tolerancing](#).

### Single Point Probing

Single point probing is performed using the video crosshairs or touch probes. Features are measured by probing one point at a time as the user aligns the probe on the feature edge until at least a minimum number of required points have been probed. The number of points required for single point probing is discussed in detail in *Points Required for Single Point Probing* contained in [Section 3: Probes](#). Feature measurements become more accurate as the number of points probed increases beyond the minimum number required.

### Multipoint Probing

Multipoint probing is performed using the MeasureLogic or EyeMeasure probe. Features are measured by touching a feature edge with the MeasureLogic probe or by pressing and dragging along the edge with the EyeMeasure probe. In either case, many points will be evenly distributed on the feature edge and collected automatically by the probe. Multipoint probes are discussed in detail in [Section 3: Probes](#).



## ***Probing Features***

All features supported by the M3 system can be probed with any of the M3 probes except for the blob, which will be discussed separately in the next few pages. The process of probing a feature with a given probe is identical for all features. Since the use of probes has been discussed thoroughly in [Section 3: Probes](#) and in the beginning of this section, a procedure for probing features with each probe type is provided here and should be sufficient for a complete understanding of probing features.



### **NOTE**

*Please refer to Points Required for Single Point Probing contained in [Section 3: Probes](#) for the minimum number of points required when probing features with crosshairs and touch probes.*

## ***Probing Features with the Crosshair Probes***

To probe features with the crosshair probes:

- 1 Select the crosshair from the probe menu.  
**Measure toolbar > Probe button > Crosshair**
- 2 Press any Measure Feature button in the Measure toolbar.  
**Measure toolbar > Desired Measure Feature button**
- 3 Position the center of the crosshair probe on an edge within the live video window.
- 4 Press Enter or in the measure prompt window button to fire the probe and capture the point.  
**Measure toolbar > Enter button**
- 5 Continue probing until the required number of points has been probed and then press the Done button to complete the measurement. The feature will be shown in the Part View window and added to the Feature List.  
**Measure toolbar > Done button**

## ***Probing Features with a Touch Probe***

Straight down and star probes are used in the same way except for application specific probe tip and probing direction. To probe features with a touch:

- 1 Select the desired touch probe from the Probe menu.  
**Measure toolbar > Probe menu > Touch probe**
- 2 Move the stage to make probe contact at the desired feature location. A point will be entered upon contact.
- 3 Probe the required number of points and then press the Done button to complete a feature measurement.  
**Measure toolbar > Done button**

## ***Probing Features with the Simple Active Crosshair probe***

The simple active crosshair probe is a special application of the active crosshair. To probe features with this probe:

- 1 Select the simple active crosshair probe from the probe menu.  
**Measure toolbar > Probe button > Simple Active crosshair probe**
- 2 Press any Measure Feature button in the Measure toolbar.  
**Measure toolbar > Desired Measure Feature button**
- 3 Press an edge of the feature to be measured within the live video window. The probe will momentarily move to the edge and acquire a point.
- 4 Continue probing until the required number of points has been probed and then press the Done button to complete the measurement. The feature will be shown in the Part View window and added to the Feature List.  
**Measure toolbar > Done button**



## NOTE

*It is also possible to set a direction and color sense for the Simple Active crosshair probe. To perform this action, click on the sizing handle to set the color sense (dark/light) and rotate the probe to achieve the desired direction. The probe will collect points along the crosshair axis that has the arrow handles on it. This allows for collection of specific points along an axis edge scanning.*

## **Probing Features with the MeasureLogic Probe**

To probe features with the MeasureLogic probe:

- 1 Select the MeasureLogic probe from the probe menu.  
**Measure toolbar > Probe button > MeasureLogic probe**
- 2 Press any Measure Feature button in the Measure toolbar.  
**Measure toolbar > Desired Measure Feature button**
- 3 Press an edge of the feature to be measured within the live video window. The MeasureLogic probe will fire many points on the feature edge.
- 4 Press the Done button to complete the measurement. The feature will be shown in the Part View window and added to the Feature List.  
**Measure toolbar > Done button**

The MeasureLogic probe can also be used without designating a feature type first. The system will then detect the feature type automatically and complete the measurement, eliminating the need for steps 2 and 4.

## **Probing Features with the EyeMeasure Probe**

The EyeMeasure probe is a special application of the MeasureLogic probe. The EyeMeasure probe is a special video tool for measuring complex or partially obscured edges. This probe is not selected as the other video probes are. It is drawn on the screen over the desired edge by the user. To probe features with the EyeMeasure probe:

- 1 Select the MeasureLogic probe from the probe menu.  
**Measure toolbar > Probe button > MeasureLogic probe**
- 2 Press any Measure Feature button in the Measure toolbar.  
**Measure toolbar > Desired Measure Feature button**
- 3 Press and drag your finger or the mouse pointer along the edge until the desired tool length and orientation is achieved.
- 4 Lift your finger or release the mouse and the tool will remain visible on the edge. The size and orientation of the tool can now be adjusted as described in [Section 3: Probes](#).
- 5 Press inside the EyeMeasure probe to fire the probe and collect many points along the feature edge.
- 6 Press the Done button to complete the measurement. The feature will be shown in the Part View window and added to the Feature List.  
**Measure toolbar > Done button**

The EyeMeasure probe can also be used without designating a feature type first. The system will then detect the feature type automatically and complete the measurement, eliminating the need for steps 2 and 6.




## NOTE

*Auto point entry, focus assist, and focus measurements can be used with all M3 probes to speed measurements and increase accuracy as described in detail in [Section 3: Probes](#).*


## **Probing and Measuring Blobs**

Blobs are irregular shapes with a potentially complex perimeter. The M3 software measures blobs in the field of view with a special tool that captures an extremely high density of points. Two methods are used to measure blobs using the blob tool: pressing the blob edge or tracing the blob perimeter.

# Video Inspection Software User's Guide

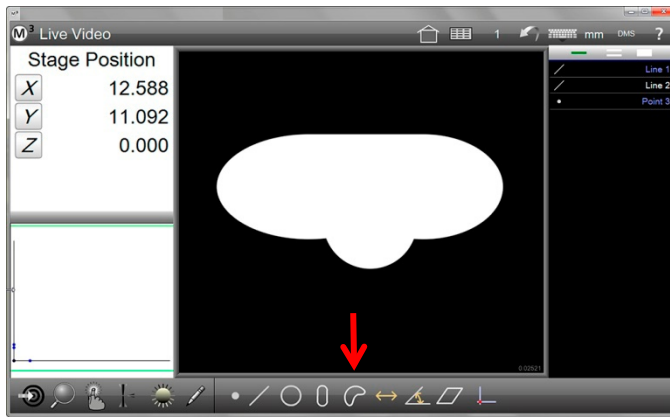

*Press the Measure Blob button*

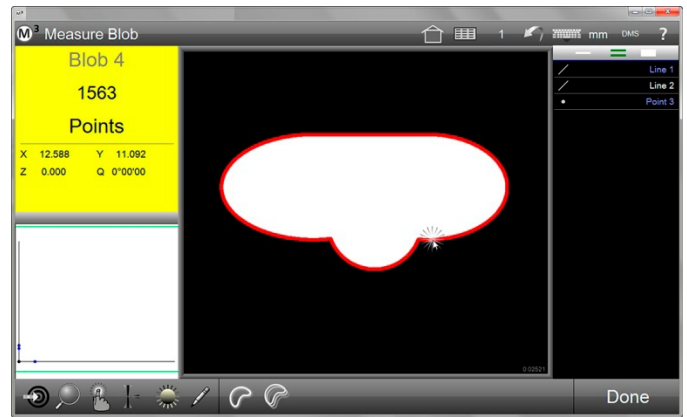

*Press the Blob Edge*

## Press the Blob Edge


To measure a blob by pressing the edge:

- 1 Position the entire blob within the field of view.
- 2 Press the Measure Blob button.

**Measure toolbar > Measure Blob button**

- 3 Press or click the blob edge. The blob tool will probe points on the perimeter of the blob.
- 4 Press the Done button to complete the measurement. The blob will be shown in the Part View and entered into the Feature List.

**Measure toolbar > Done button**

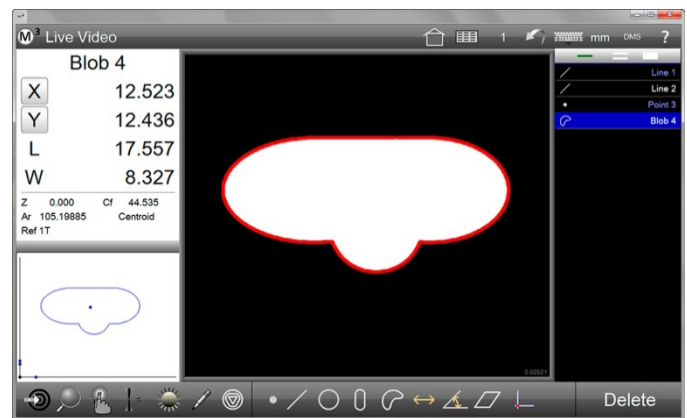



## Trace the Blob Perimeter

To measure a blob by tracing the perimeter:

- 1 Position the entire blob within the field of view.
- 2 Press the Measure Blob button.

**Measure toolbar > Measure Blob button**


- 3 Press or click the blob edge and drag the blob probe around the entire perimeter. Be careful not to leave a gap on the perimeter where the probe beginning and end meet.

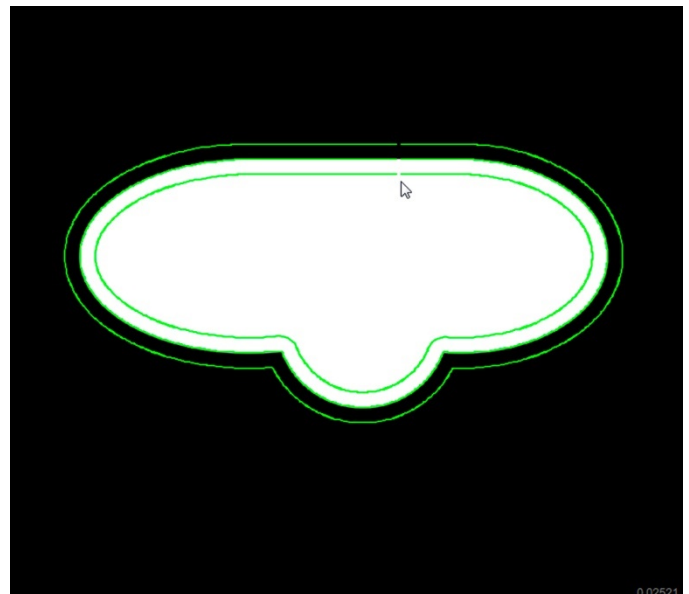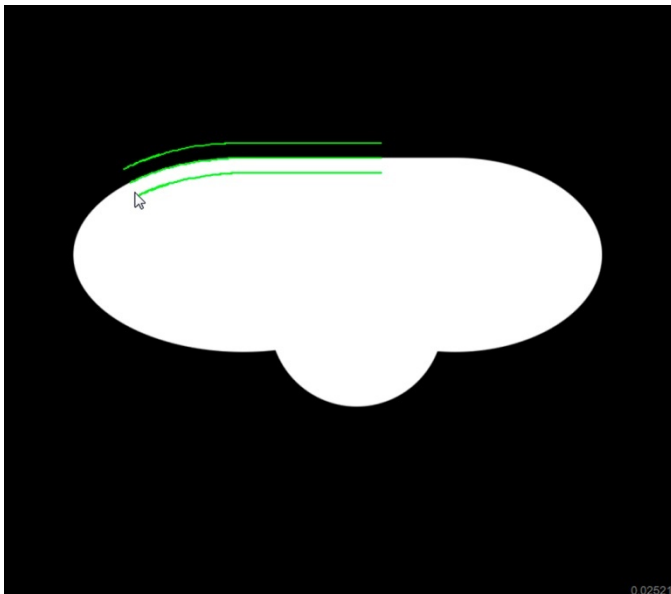

# Video Inspection Software User's Guide

- Press inside the probe boundaries to fire the probe and collect points.
- Press the Done button to complete the measurement. The blob will be shown in the Part View and entered into the Feature List.

**Measure toolbar > Done button**

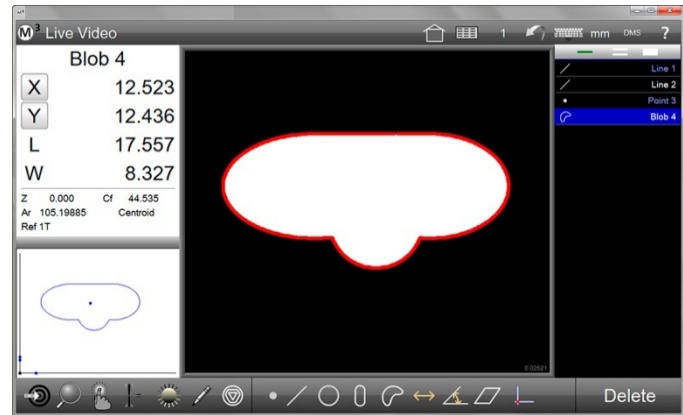

## Repeat Mode Feature Measurements

When measuring in the repeat mode, the Measure Feature button does not need to be pressed between each feature measurement. The system prepares the next feature measurement automatically at the completion of the previous feature measurement. The repeat mode facilitates the measurement of many like features sequentially. The repeat mode is available for all feature types using the following procedure:

- Press the Measure Feature button for the desired feature type (a circle was selected in this example). The submenu for that feature type will be shown.
- Press the Measure Repeat button for that feature.


**Measure toolbar > Desired Measure Feature button > Repeat measure button**

- Select the desired video probe from the probe menu.

**Measure toolbar > Probe button > Desired probe**

- Probe the first feature until the necessary points have been collected.
- Press the Done button to conclude the first measurement. The new feature will appear in the Feature List and Part View. Continue measuring like features and then press the Done button to exit the repeat mode.

**Measure toolbar > Done button**

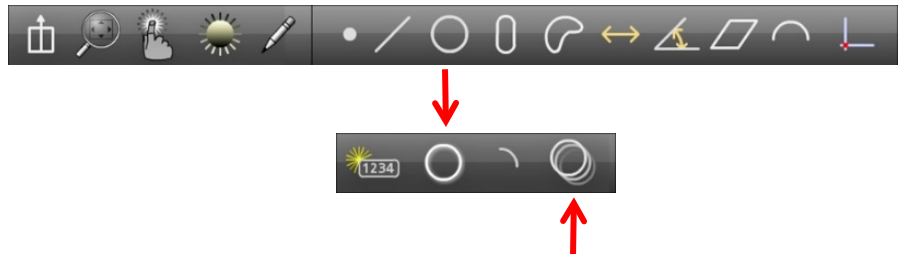


## Probing Features that Extend Beyond the Field of View

Features that extend beyond the field of view must be measured explicitly. To measure a feature that extends beyond the field of view:



- Press the measure feature button for the desired feature type (a slot was selected in this example).  
**Measure toolbar > Desired Measure Feature**
- Select the desired video probe from the probe menu.  
**Measure toolbar > Probe button > Desired probe**
- Probe the portion of the feature that is included in the field of view.
- Move the stage to position the remaining portion of the feature within the field of view and continue probing.
- Press the Done button to conclude the feature measurement.

**Measure toolbar > Done button**

# Video Inspection Software User's Guide

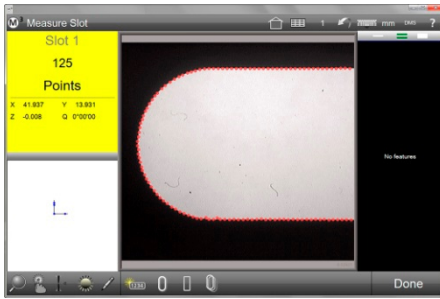

*Probe the portion of the feature included in the field of view*

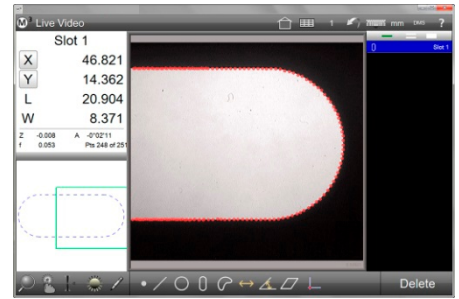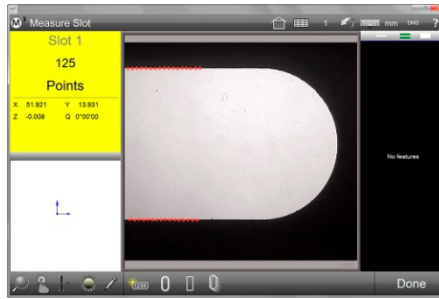

*Probe the remaining portion and press the Done button*



## NOTE

*Features that extend beyond the field of view can also be measured using the image stitching function discussed in [Section 5: Image Stitching](#). Image stitching is most useful when the feature extends far beyond the field of view.*


## Multi-feature measurements

The system supports measuring of multiple features using a Multi-Measure tool. The Multi-feature measuring function works by analyzing edges within a video image and determining the standard fit feature results from the edge contours. The Multi-Measure tool can identify and measure line, circle, arc, and blob features within a field of view or stitched image.

There are three multi-features measurement modes:


### Single Edge Mode

Perform a single edge multi-features measure by selecting the Multi-Measure tool from the bottom toolbar and then pressing on any edge in the Field of View. The tool will scan along the contour of the edge that was clicked on and return all detected features to the feature list.

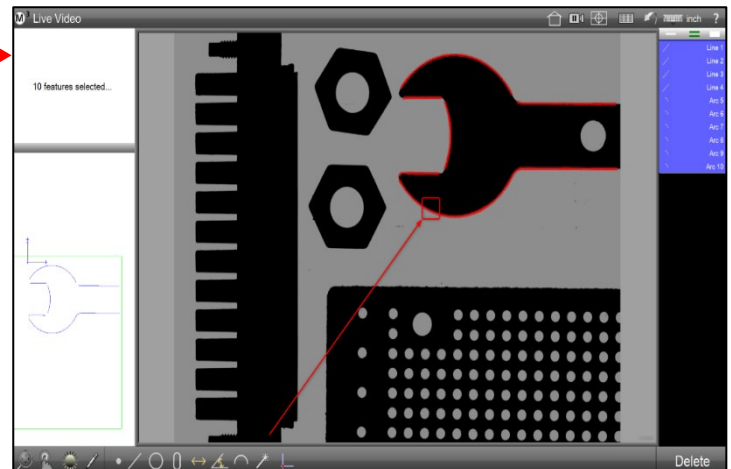


# Video Inspection Software User's Guide

**Marquee Mode** – Perform a marquee multi-features measure by selecting the Multi-Measure tool from the measure toolbar and then clicking and dragging a marquee box around a region of edges within the field of view. The tool will analyze all edges within the rectangular marquee region and return all detected features to the feature list.

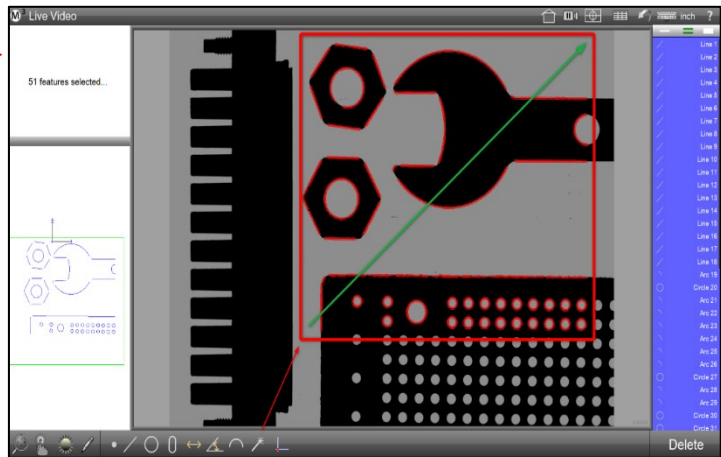

**Full Screen Mode** – Perform a full screen multi-features measure by selecting the Multi-Measure probe from the bottom toolbar and then pressing the Enter button, located in the bottom toolbar. The tool will analyze all edges within the current field of view and return all detected features to the feature list.

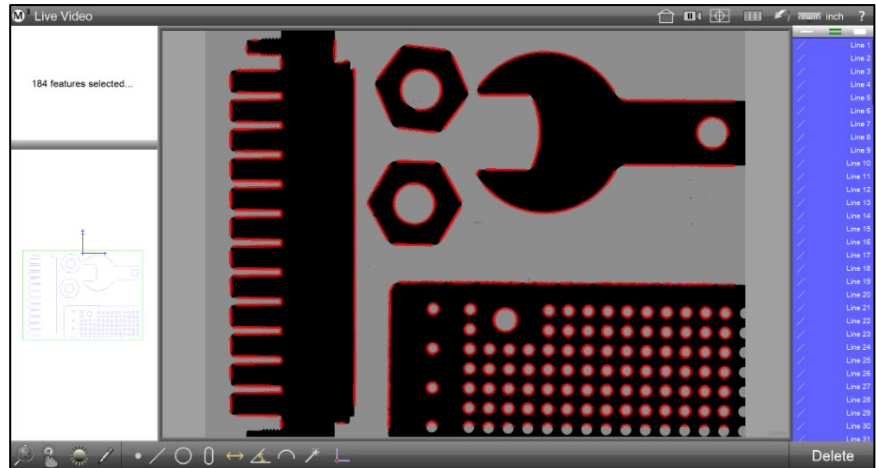

## Note

 
*The Multi-measure tool is disabled by default. It can be enabled by setting the Display Multi-measure tool field in Desktop Setting to "Desktop".*

## Multi-Measure Tool Filters

In some cases when using the Multi-Measure tool, it may be necessary to collect only specific feature types for a single execution of the tool. For this case, the Multi-Measure tool filters can be used to specify which feature types will be measured, and which will be filtered. Filtered features are not added to the feature list.

### Setting a Filter

To set a filter for a feature type, press the Multi-Measure tool button. This will expand the tools sub-menu. To filter out a feature type, press or click on the feature type button. A top-left to bottom-right (or top-right to bottom-left) red line is drawn on the feature type button that was pressed. This feature type will be filtered out of the multi-measure tool probe firings. To toggle it back, press or click on the feature type button again.







## Note



The feature types circle, arc, and line cannot be combined with blob feature type when using Multi-Measure tool.

## An example of using the Multi-Measure tool

1 Press the Multi-Measure button located in the measure tool bar.

2 Press on the Arc and Line feature type buttons to filter out arcs and lines (the blob feature type is already marked to be filtered by default).

3 Press the Enter button in the lower right toolbar to collect all circle features in the current image.

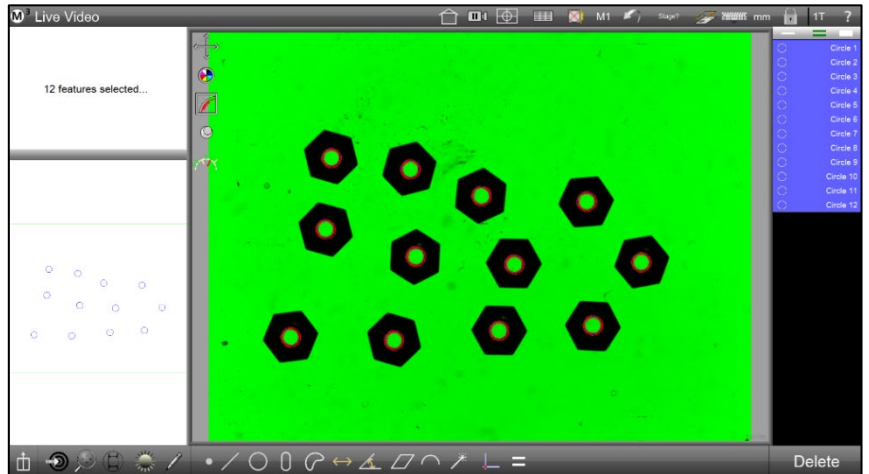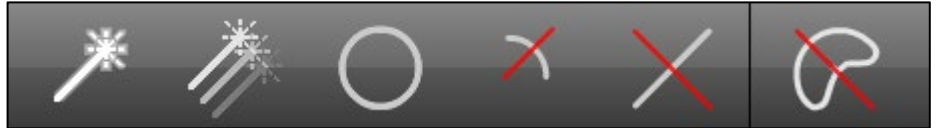

## Pattern Recognition

The M3 pattern recognition function teaches specific image patterns to the system for automatic detection during program playback. Program playback can be improved using a soft-fixture based part alignment routine, utilizing this pattern detection mechanism. Patterns can be measured or taught as datum patterns where the skew and zero positions are set automatically, or as standard pattern features where the part or machine coordinate pattern position and orientation are reported for the pattern feature.



## NOTE

Pattern recognition is supported in CNC systems or in manual systems that also have the Digital Comparator option enabled. Pattern recognition is also supported in non-CNC Field of View systems discussed in Section12: Field of View Functions.

## Teaching a pattern

Select the desired pattern to be used for detection in playback. Ideal candidate patterns should contain image characteristics that are unique relative to the rest of the field of view in which they are taught. In addition, target pattern regions should contain reasonable light to dark pixel contrast and be relatively free of image noise and distortion.

# Video Inspection Software User's Guide

To teach a pattern:

- 1 With the desired pattern in the field of view, press the Datum button in the Measure Toolbar to display the Datum Pattern Menu.

**Measure toolbar > Datum button**





- 2 Press a Pattern Probe to initiate one of two pattern measurements:
  - Registration pattern measurement (default type)
  - Standard pattern measurement

## Registration Pattern Measurement

This is the default pattern measurement and is used to establish program registration for part playback. To measure (or teach) a registration pattern:

With the Measure Registration Pattern tool selected (default), press and drag to completely enclose the desired pattern. The pattern feature will be shown in the Feature List, and the pattern position and angle will be shown in the detail view. The pattern will be registered for Program playback as shown in the Part View, and other features can be probed.


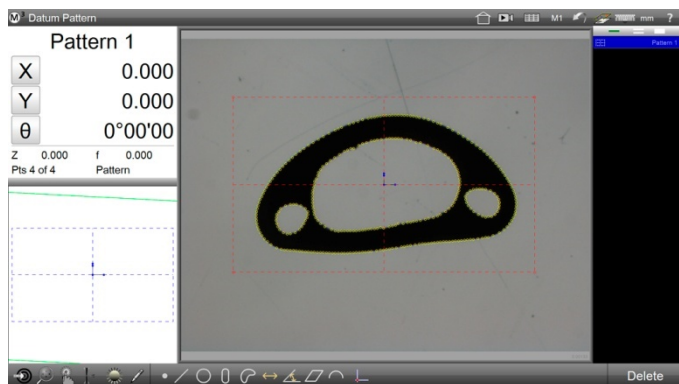
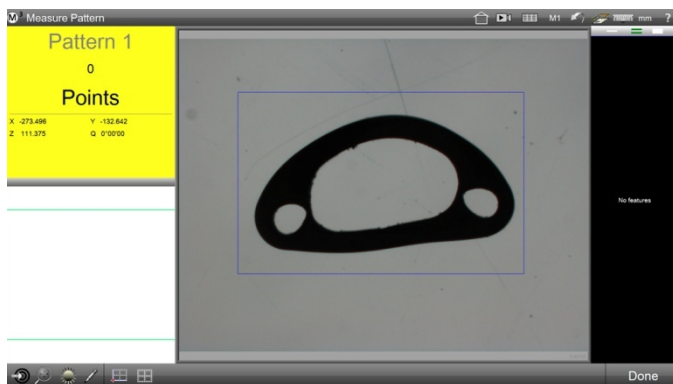


## Standard Pattern Measurement

To perform a standard pattern measurement (teach):

- 1 Select the Standard Pattern Tool and then press and drag to completely enclose the desired pattern.

 The pattern will be shown in the Feature List, and the current stage position and angle will be shown in the detailed view window.

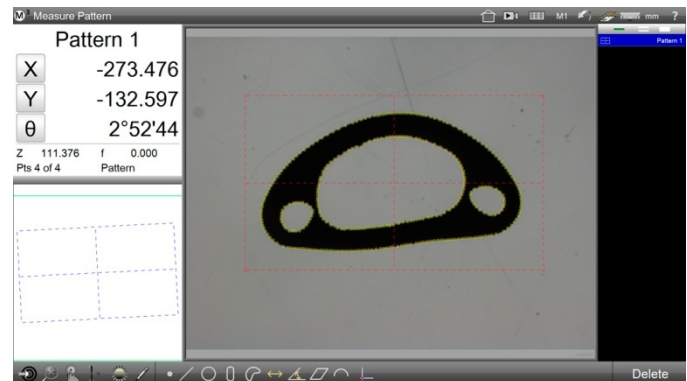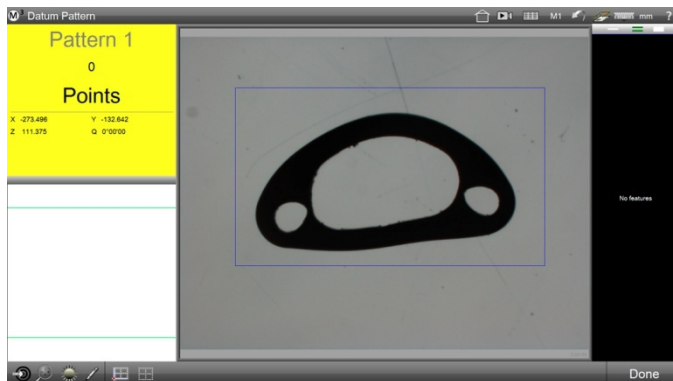






## Note

*Standard pattern features are typically used when a datum alignment will be constructed from two or more pattern features.*

## Pattern Program Playback

Once a registration pattern has been measured (taught) and other features have been probed, the measuring program can be played back. To play the program:

Position the pattern anywhere in the field of view, and then press anywhere in the Live Video window to execute the program. The program will recognize the registration pattern, register the coordinate system, and measure any remaining features.

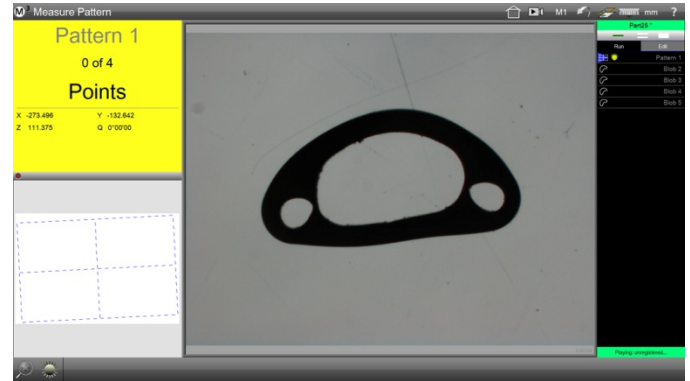

## NOTES

*In CNC-enabled systems, a message will be displayed asking for playback confirmation prior to any potential stage movement.*


### Important note for CNC-enabled systems

*The angle of a given pattern is used as a temporary skew in program playback. Because the repeatability of the pattern angle is good only to 1°, subsequent features, particularly when located far from the initial pattern, may not be found automatically. To use the pattern finder most effectively in this case, choose an initial pattern that is located as close to the intended datum features as possible.*

## Viewing the Image Source for Pattern Features

For any measured (taught) pattern feature, the large feature detail screen can be used to view the originally sampled image of a given pattern.

Select the pattern feature from the Feature List that you would like to view, press in the small feature detail window at the top left of your screen to access the large feature detail window. The original image sample will be displayed for the selected pattern.

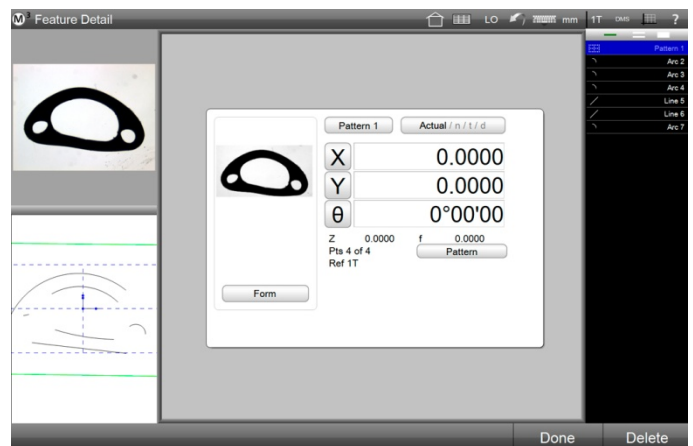

## Goto Move Function

The Goto button prepares CNC enabled systems to perform one of three CNC Goto moves including:

- Goto position
- Goto feature
- Goto Part View location.

### Enabling the Goto Move Function

To enable the Goto Move function:

- 1 Press the Goto button. The button arrow will turn red and the M3 screen will display green control borders around the interface areas where Goto commands can be executed.





**Measure toolbar > Goto button**

### Goto Position (Absolute/Relative)

To execute a Goto position CNC move:

- 1 Press the Goto button when the live video image is displayed in the large viewport.
- 2 Press within the small DRO window, highlighted in green, to display the Goto position dialog.
- 3 Select the Goto type, absolute or relative, and enter the desired values for the X, Y, and Z axes.
- 4 Press Done to execute the Goto move.

**Measure toolbar > Done button**

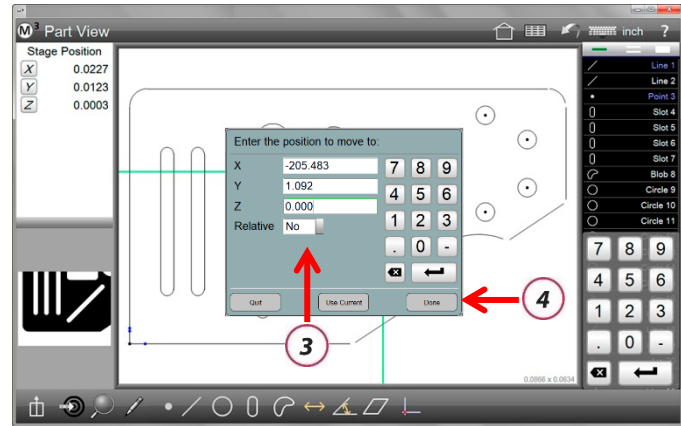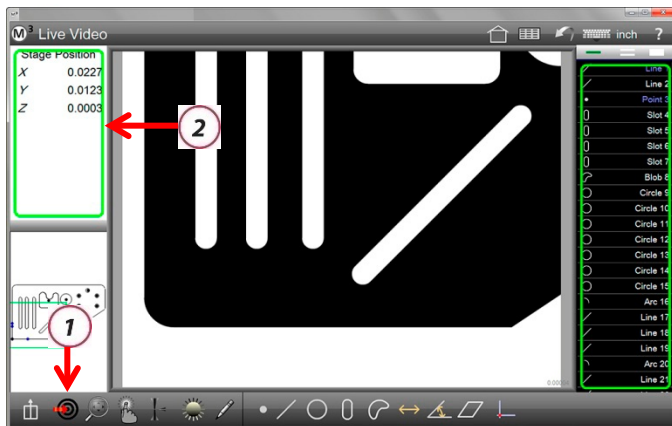

#### NOTE

*Goto absolute position executions are always recorded and will be played back during program execution. These steps can be edited or deleted using the edit and delete program step functions from the program edit mode. Program editing will be discussed in detail in [Section 11: Programming](#).*

## ***Goto Feature***

- 1 Press the Goto button. The green Goto border will be displayed around the Feature List.

**Measure toolbar > Goto button**


- 2 Select the feature from the Feature List you would like to go to.
- 3 The system will execute a Goto move to the selected feature.

## ***Goto Part View location***

- 1 When the Part View is displayed in the large viewport, press the Goto button. The green Goto border will be displayed around the Part View space.

**Measure toolbar > Goto button**

- 2 Press or click within the Part View space in the desired location for the Goto click execution.
- 3 The stage move will be executed immediately, positioning the stage at the specified location.

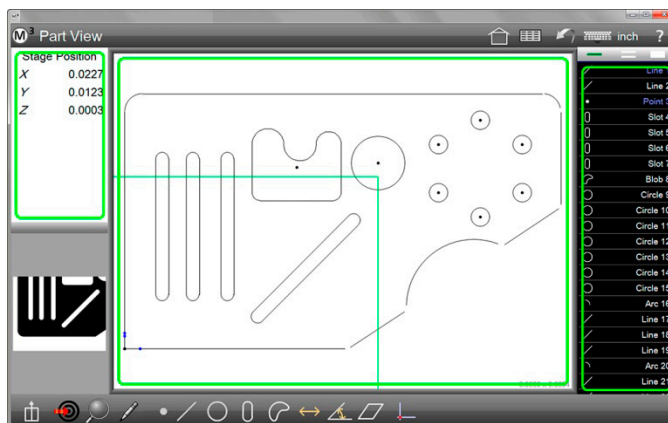

## Constructing Features

Part features are constructed from one or more parent features contained within the Feature List. The following feature constructions are supported by the M3 system:

- Points
- Lines
- Circles and arcs
- Distances
- Angles
- Planes
- Spheres
- Cones
- Cylinders

Features can be constructed from positional and non-positional parents. For the purposes of constructing features, the center points of positional features are used as points. The number of points required for the feature construction is identical to the number required for feature measurement and is discussed in detail in *Points Required for Single Point Probing* contained in [Section 3: Probes](#). Parent features include:

Positional features:

- Points
- Circles and arcs
- Slots and rectangles
- Blobs
- Patterns
- Spheres

Linear features:

- Lines
- Cylinders
- Cones

Other features:

- Planes
- Angles
- Distances

## ***Point Constructions***

Point constructions include:

- Average point from any combination of positional features
- Center point of circle or arc
- Start point, Center point, endpoint, or anchor point of a line. The anchor point is the point on the line closest to the datum.
- Start point and endpoint of a distance
- Apex point of an angle
- Midpoint between two positional features
- Intersection of two lines
- Intersection 1 or 2 between circle and circle, arc and arc or circle and arc
- Intersection 1 or 2 between line and circle or line and arc
- Point online perpendicular to a positional feature

# Video Inspection Software User's Guide

- Tangent point 1 or 2 on circle from a point
- Centroid, +X, -X, +Y, -Y from a blob
- Center plane or sphere
- Midpoint of call or cylinder axis
- Apex of cone
- Intersection of cylinder axis and plane
- Intersection of cone axis and plane
- Perpendicular point positional feature and plane
- Intersection of three planes

## ***Circle Constructions***

Circle constructions include:

- Gauge circle between lines using parent lines and created circle (discussed later)
- Gauge circle between two arcs using parent arcs and created circle (discussed later)
- Gauge circle between three lines with circle tangent to each line
- Bolt circle from three or more circles
- Average circle from three or more circles
- Circle from three or more positional features
- Duplicate circle
- Circle from arc
- Equal circumference and equal area at Centroid, +X, -X, +Y, -Y from a blob
- Middle of cylinder or cone
- Intersection of cone and cylinder
- Intersection of cone and plane
- Intersection of cylinder and plane

## ***Arc Constructions***

Arc constructions include:

- Duplicate arc
- Arc from circle
- Arc from three or more positional features

## ***Line Constructions***

Line constructions include:

- Duplicate line
- Perpendicular line from line
- Gauge line from two parent lines and a created line (discussed later)
- Average of multiple lines
- By sector line and perpendicular by sector
- Line from 2 or more positional features
- Tangent line 1 and 2 between circles
- Tangent line 1 or 2 between point and circle
- Line from a distance
- Perpendicular line to a line through a positional feature
- Line parallel to a line through a positional feature
- Line tangent 1 or 2 to a circle and perpendicular to a line
- Line from a line and angle (rotated by the angle)
- Axis of cylinder or cone projected on any of three work planes

- Intersection of two planes projected on any of three work planes

## ***Axis (3D Line) Constructions***

Axis (3D Line) constructions include:

- Duplicate
- Intersection of planes
- Extraction from cylinders, planes (normal to plane), cones
- Conversion from Lines
- Closest distance from axis to:
  - Cylinder (axis, or surface of a cylinder)
  - Sphere (axis and surface)
  - Cone (axis)
- Points
  - Midpoint between intersecting axes.
  - Pierce point of axis and plane.
- Angles to:
  - Planes
  - Cones
  - Lines (3D angle)
  - Cylinders

## ***Angle Constructions***

Angle constructions include:

- Duplicate angle
- Angle of a line starting at + X direction
- Angle between lines: included, 180-, 180+ and 360-
- Taper angle of cone
- Cone Taper off to concentric circles at different heights and different radii

## ***Distance Constructions***

Distance constructions include:

- Duplicate distance
- Circumference of a circle
- Links of a line
- Distance between two angle apexes
- Minimum, center or maximum between circles or circle and arc or arcs
- Minimum, center or maximum between point and circle or point and arc
- Minimum, center or maximum between line and circle or line and arc (perpendicular distance)
- Minimum, center or maximum between lines
- Perpendicular from point to line
- Sum of two distances

## ***3D Distance Constructions***

3D distance is the “straight line” distance between 3D features, constructed in 3D projection space. The Length coefficient of the distance feature is shown in 3D projection.

In addition to the distance constructions listed above, 3D distance constructions include:

- Surface

- Perpendicular distance

## ***Plane Constructions***

Plane constructions include:

- Duplicate plane
- Least squares of best fit plane from three or more positional features
- A point aligned with XY
- Multipoint from points (fit plane)
- Multipoint from circles (fit plane)
- Two planes (mid-plane)

## ***Sphere Constructions***

- Duplicate
- Multipoint from points (fit sphere)

## ***Cylinder and Cone Constructions***

- Duplicates
- Multipoint fit from points
- Two circles define ends of cylinder or cone

## ***Feature Construction Procedures***

There are two procedures for feature construction:

- Gauge circle and gauge line constructions
- All other feature constructions

## ***Construction Procedures for Gauge Circle and Gauge Line***

Gauge circle and gauge line constructions include:

- Gauge circle between 2 lines
- Gauge circle between 2 arcs
- Gauge line between 2 lines

### ***Gauge circle between two lines***


To construct a gauge circle between two lines:

- 1 Create a circle of the desired diameter (creating features is discussed immediately after this section). The diameter of the created circle must be larger than the minimum distance between the two lines.
- 2 Press the Measure Circle button.

**Measure toolbar > Measure Circle button**

- 3 Select the desired two parent lines and the created circle from the Feature List.
- 4 Press the Done button to complete the construction. The gauge circle will be shown between the two parent lines in the Part View and will be added to the Feature List.

**Measure toolbar > Done button**

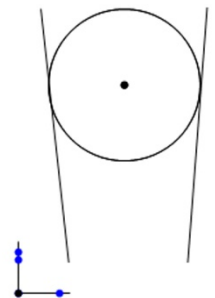

## **Gauge circle between two arcs**


To construct a gauge circle between two arcs:

- 1 Create a circle of the desired diameter (creating features is discussed immediately after this section). The diameter of the created circle must be larger than the distance between the two arc perimeters.
- 2 Press the Measure Circle button.

**Measure toolbar > Measure Circle button**

- 3 Select the desired two parent arcs and the created circle from the Feature List.
- 4 Press the Done button to complete the construction. Gauge circle 1 will be shown between the two parent arcs in the Part View and will be added to the Feature List. Press the Change Feature Type button to alternate between Gauge circle 1 and Gauge circle 2.

**Measure toolbar > Done button**

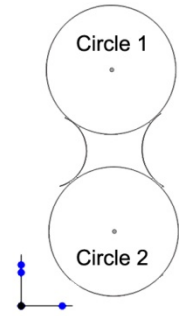

## **Gauge line between two lines**


To construct a gauge line between two lines:

- 1 Create a line of the desired length (creating features is discussed immediately after this section). The length of the created line must be longer than the minimum distance between the two parent lines and must be horizontal or vertical.
- 2 Press the Measure Line button.

**Measure toolbar > Measure Line button**

- 3 Select the desired two parent lines and the created line from the Feature List.
- 4 Press the Done button to complete the construction. The gauge line will be shown between the two parent lines in the Part View and will be added to the Feature List.

**Measure toolbar > Done button**

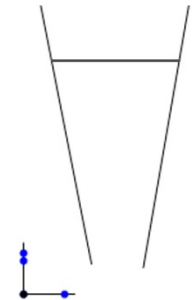

## **Construction Procedures for all Other Features**

All feature constructions (except for gauge circles and gauge lines described earlier) use the following procedure:

- 1 Press the Measure Feature button of the feature type that you wish to construct.
- Measure toolbar > Measure Feature button**
- 2 Select (highlight) the required parent features from the Feature List.
- 3 Press the Done button to complete the construction. The constructed feature will be shown in the Part View and entered in the Feature List.

**Measure toolbar > Done button**

## **Changing Constructed Feature Type**

Many constructed features can have more than one feature type. For example, an angle constructed between two lines can be any one of 4 types: included, 180-, 180+ and 360-. To change the feature type:

- 1 Select the constructed feature in the Part View or from the Feature List.
- 2 Press the Change Type button and note the feature type description shown in the Feature Detail viewport in the upper left portion of the screen.

**Measure toolbar > Change Feature Type button**



### **NOTE**


***The Change Feature Type button is shown in the Measure toolbar when feature type alternatives exist. If the button is not present in the Measure toolbar, only one type of feature exists for the selected construction.***

- 3 The feature type can also be changed in the Feature Detail viewport. Press in the small feature detail viewport in the upper left portion of the screen to display the Feature Detail viewport.




# Video Inspection Software User's Guide



- Press the Feature Type button to change the feature type. Pressing the Feature Type button repeatedly will cycle through all the available feature types.

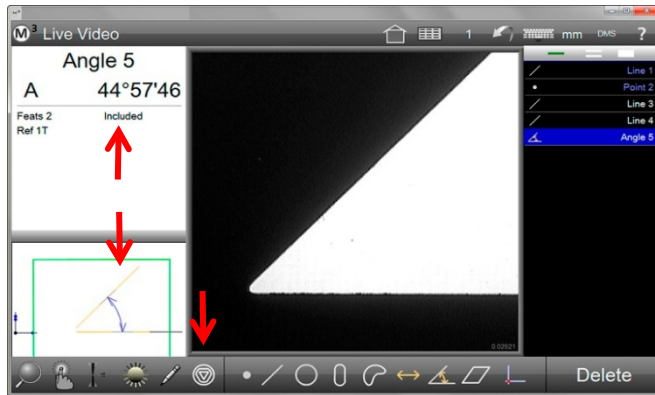

**Note the feature type, then press the Change Feature Type button**

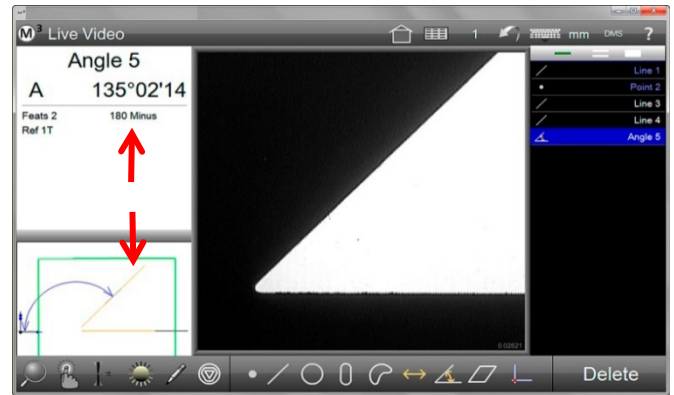

**The feature type will change**

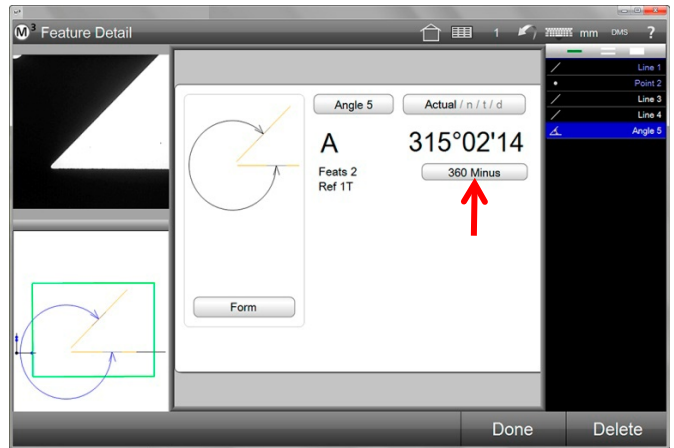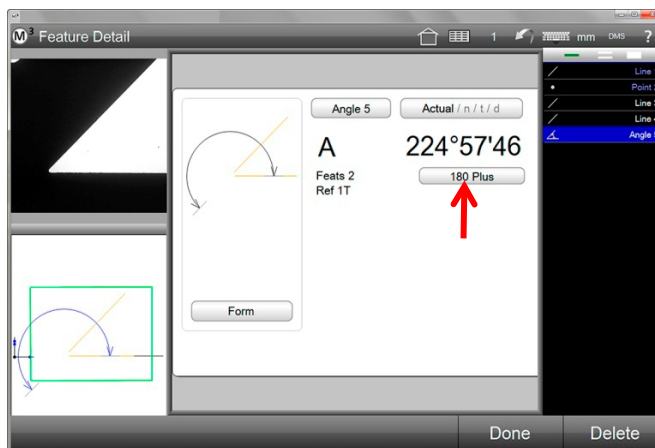

## Creating Features

Features can be created by entering the desired position size and other parameters that describe the feature. The M3 system supports the creation of the following features:

- Points
- Lines
- Circles
- Arcs
- Slots
- Rectangles
- Distances
- Angles
- Planes
- Spheres
- Cylinders
- Cones


The basic procedure for creating features is identical for all feature types, only the required feature parameters change depending on the feature type being created. To create a feature:

- 1 Press the Measure Feature button of the feature that you wish to create. The Measure Feature submenu will be displayed. In this example, a circle will be created.


**Measure toolbar > Measure Feature button**

- 2 Press the Create Feature button. Data fields will be displayed for entering the required feature parameters.
- 3 Enter the required feature parameters and then press the Done button to complete the creation. The new feature will be shown in the Part View and added to the Feature List.

**Measure toolbar > Done button**

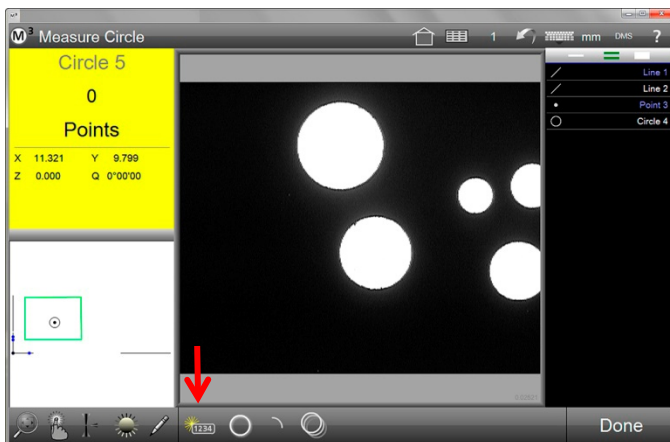

*Press the Create Feature button in the Measure Feature submenu*

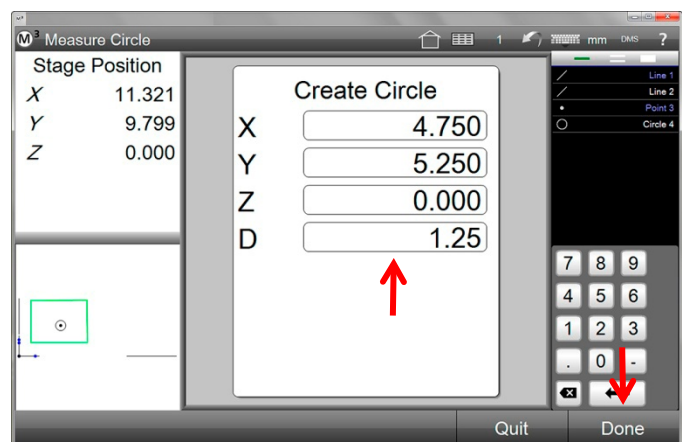

*Enter the required feature data and then press Done*

## Formula Results via Calc Feature

Sophisticated measurement calculations and operations can be achieved using the Calc feature. The Calc feature uses several feature coefficients, then applies various formulas (as designed by the user) to determine the desired results.




### NOTE

*The Calc feature tool is disabled by default. It can be enabled by assigning it to the measure toolbar or Extra menu list. To enable it, set the Display calc measurement button in Desktop screen of system Settings to either Extra or Desktop.*

### An example of using the Calc feature


(Calculating the circumference of a circle using formula  $\pi * \text{Diameter}$ )

- 1 Measure a circle feature.
- 2 Press or click on the Calc button from the measure toolbar.
- 3 The Calc feature formula entry screen will be displayed.
- 4 Enter the name of the Calc feature
- 5 Select the Circle feature in the feature list. A list of selectable coefficients will appear in the upper left viewport.
- 6 Select the D coefficient from the upper left viewport.
- 7 Press the Multiplication operator button.
- 8 Press the Pi button from the Calc keyboard.
- 9 Press the Done button in the lower right toolbar to complete the formula calculation.

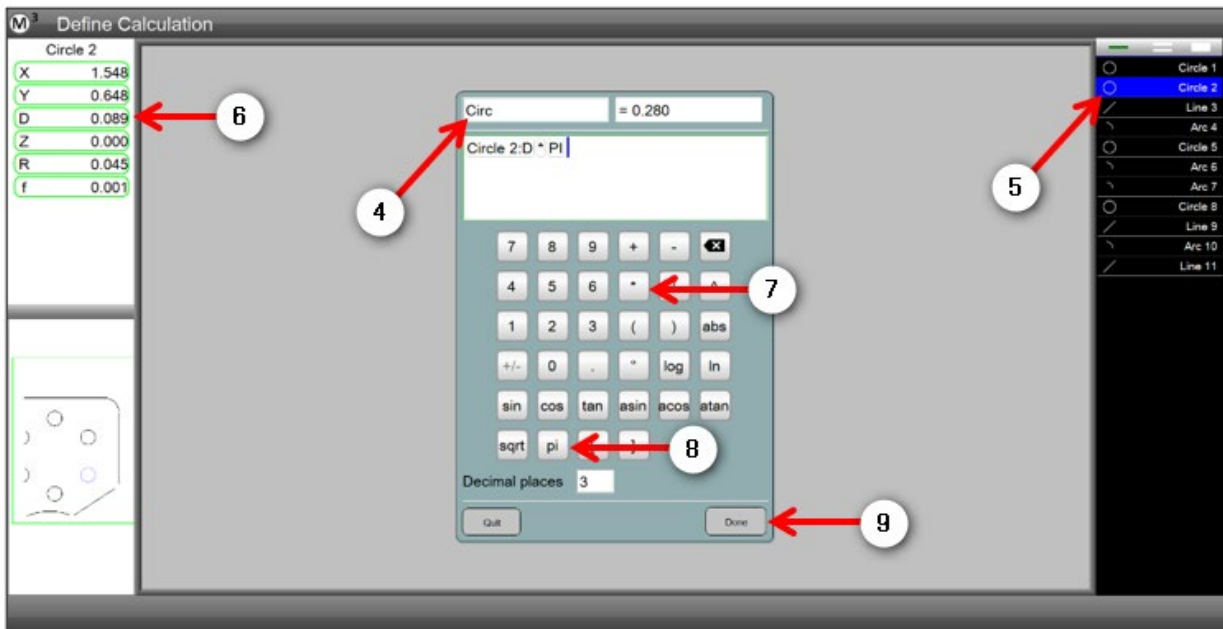

- 10 The Calculation result will be added as a calc feature to the feature list.

# Video Inspection Software User's Guide

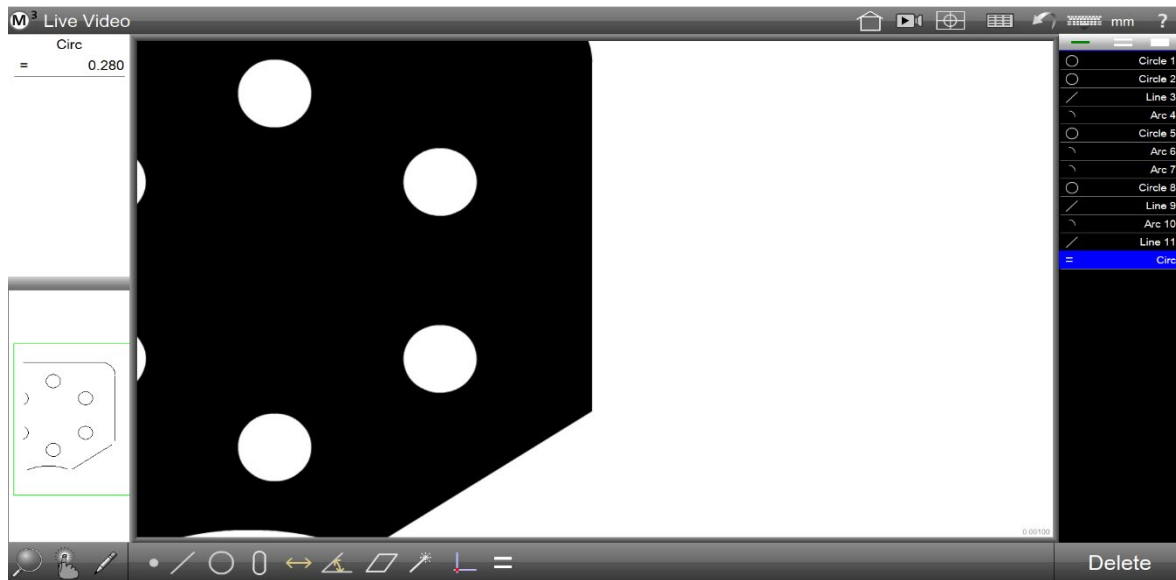

## NOTE


*The Calc feature result can be renamed, tolerance applied to it, and reported.*

## Editing a Calc Feature Result:

A Calc feature result can be edited in either interactive or program edit mode.

To edit a Calc feature result:

- 1 Select the Calc feature in the feature list.
- 2 Using the left mouse button, long press on the Calc feature result view port, located in the upper-left detail viewport. The Calc feature result formula entry screen will be displayed. Modify the name and formula as desired and press Done to finish editing the Calc feature.


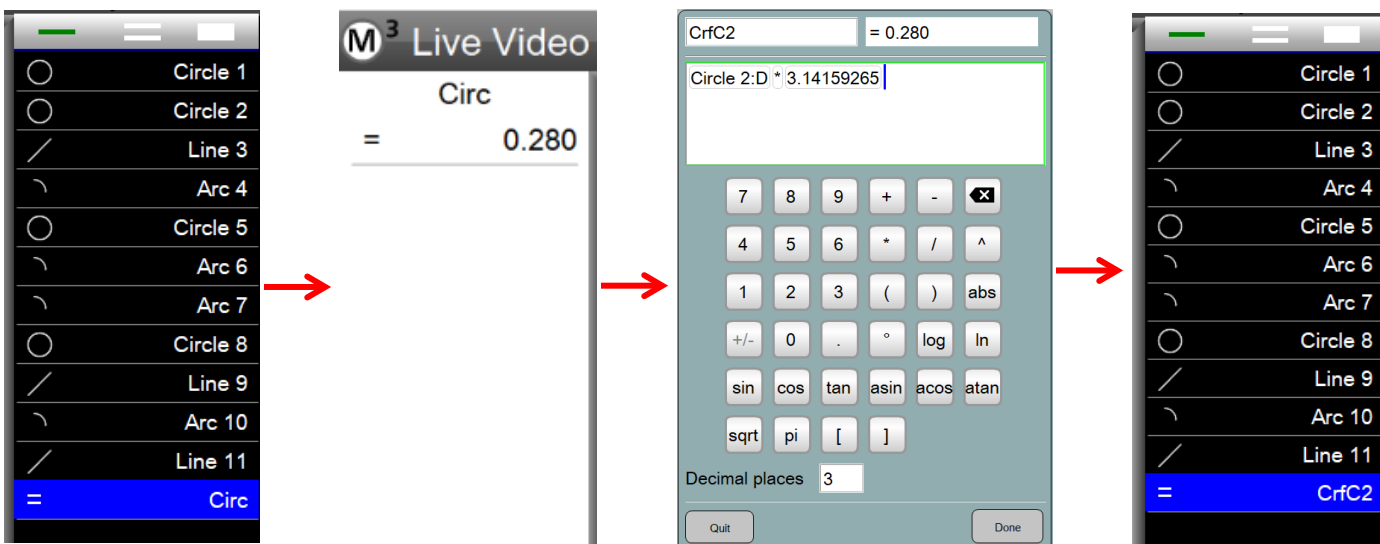


## Using a Calc feature as a variable:

A Calc feature result can be used as a variable in other feature measurement operations such as Goto operations.

To set a Calc feature as a variable:

- 1 Press or click on the Calc button from the measure toolbar.
- 2 The Calc feature formula entry screen will be displayed.
- 3 Enter the name of the Calc feature enclosed in square parenthesis. (This denote the Calc feature as a variable).
- 4 Enter the formula in the formula field.
- 5 Press Done to save the variable and close the Calc definition dialog.




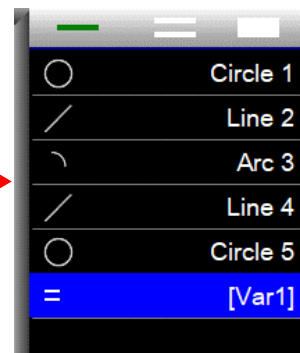
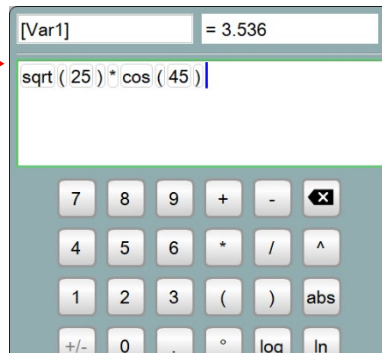


## Using a variable in program GoTo step:

A variable can be used to go to a specific stage position that is dynamically calculated during program execution using CNC GoTo program step. The variable is edited into a GoTo step.

As an example, a program can be set to move to a stage position that is offset from a measured feature. To do this:

- 1 Measure a position feature.
- 2 Create two variables (XPos and YPos) to hold the X and Y values of the stage position.
- 3 Program a GoTo step and edit the X and Y values with the corresponding variables.
- 4 Press Done to save the changes and exit the GoTo definition dialog.

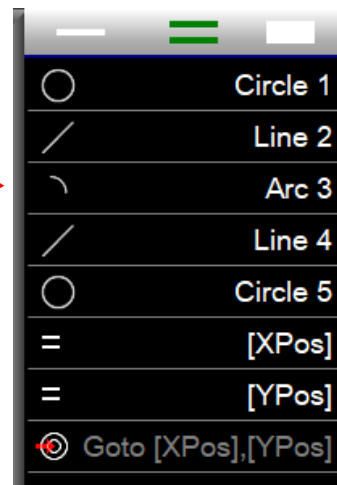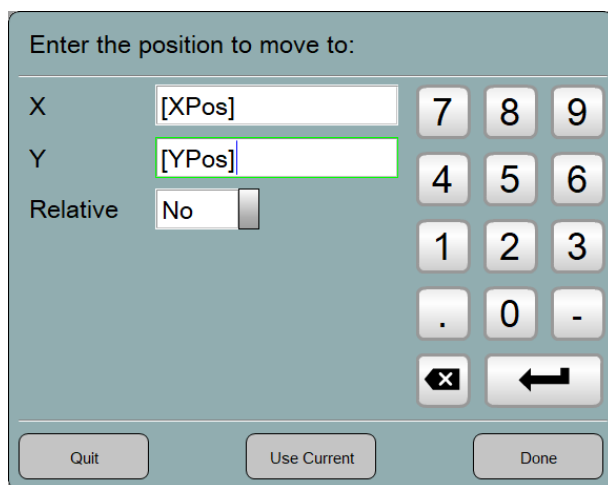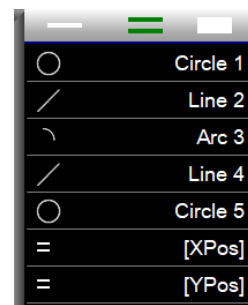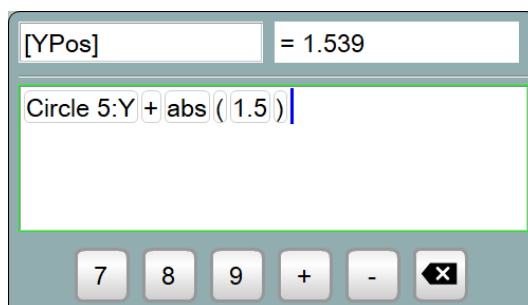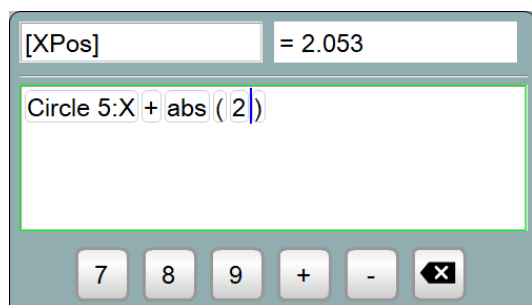

# Video Inspection Software User's Guide

## **Global Variables:**

A variable can be created to persist for the duration of the application cycle. This variable is referred to as a Global Variable. The purpose of a global variable is to pass information between programs that are run in an application cycle, hence, only survives for the duration of the application cycle. A global variable name must begin with **G\_**.

To define and set a global variable:

- 1 Define the global variable as you could any variable but with the name prefixed with G\_.
- 2 When prompted, enter the value in program playback.
- 3 Record another program using the global variables defined in the steps above.
- 4 Notice the global variables carries through the second program.

Enter user message text or prompt below. Specify the desired display timer (set to "0 secs" to disable the timer) or a variable name.

Prompt: Enter global offset

Variable name: G\_Offset

Every pallet: Yes

Cancel Image... Done

[G\_Var1] = 0.108

Circle 2:D \* PI

7 8 9 + - X

Play Rec Edit

Prg Properties

Mag: 1

Light Control

Circle 1

Circle 2

Skew 3

Circle 4

[G\_Offset]

[G\_Var1]

Enter global offset

10

Cancel Done

[G\_Var1]

= 0.108



CrOffstPos = 10.108

[g\_offset] + [g\_var1]

7 8 9 + - X



Play Rec Edit

Circle 1

Circle 2

Skew 3

Datum 4

Circle 5

Circle 6

Line 7

CrOffstPos

## Section 5: Image Stitching

Image stitching is a method of scaling super images that greatly extend beyond the field of view so that they fit within the field of view and can more easily be measured with pattern and other probes. Image stitching is included in manual and CNC encoder-based systems. Image stitching is used to:

- Scale and fit large images into the field of view
- Use DXF overlays on (scaled) super image parts
- Collect (scaled) super images within traditional part programs for use in conjunction with pattern recognition for locating difficult edges and features that vary greatly from part to part

### Stitching a Super Image

Super images can be stitched using four methods:

- Rectangular stitching
- Free form stitching
- Preset stage stitching

#### *Enabling Image stitching*

Before using one of the image stitching methods, image stitching must be enabled. To enable image stitching:

- 1 Click the Stitch Mode button. The Image Stitch toolbar will be displayed at the bottom of the screen. The default method of rectangular stitching will be enabled.


**System toolbar > Stitch button**



#### *Rectangular Image Stitching*

To perform rectangular stitching:





- 1 Press the Rectangular Stitch button to enable rectangular stitching. A red guidance arrow will be shown in the video window.

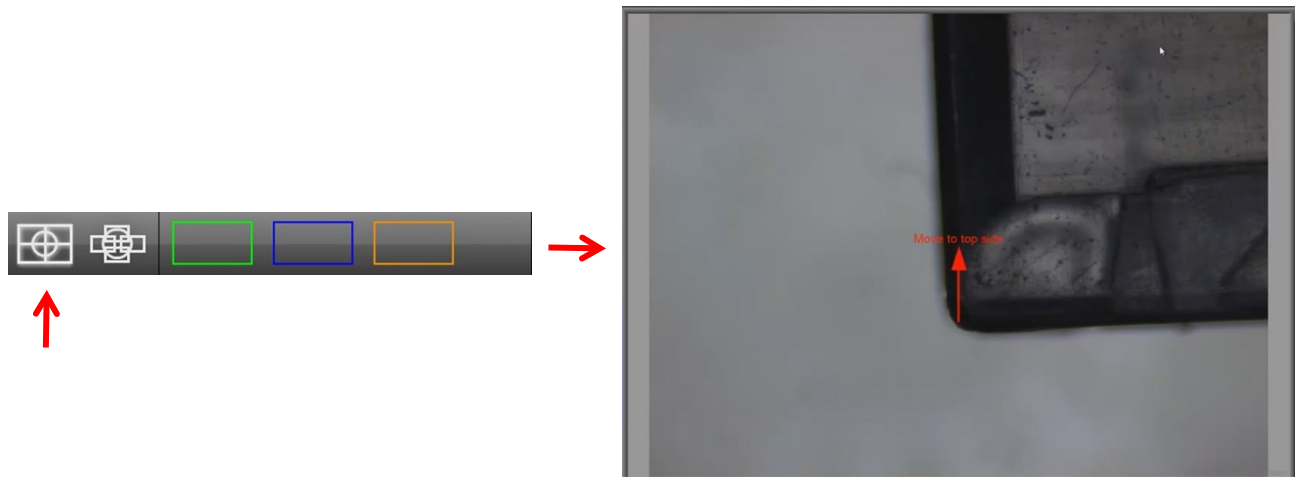




## Video Inspection Software User's Guide

- 2 Move the stage as directed by the red arrow to the four bounding corners of the rectangular image area. Press the screen or Enter button at each corner. The Stitch dialog will be displayed when the image is enclosed.

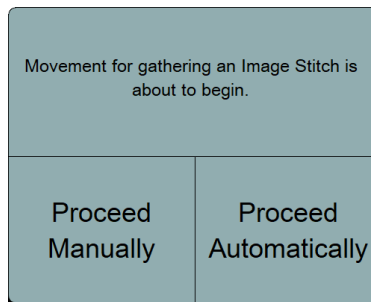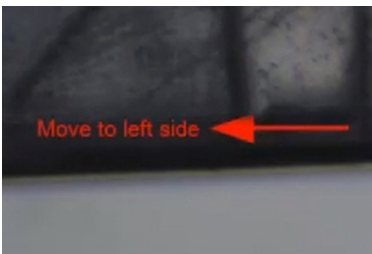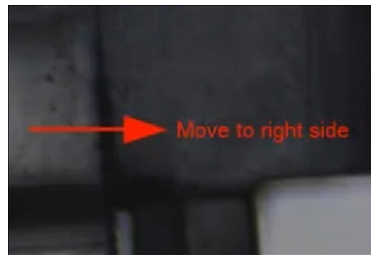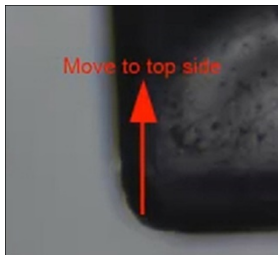

- 3 Press Proceed Automatically for CNC image stitching or Proceed Manual for manual stitching.
- 4 When manual stitching is selected, follow the user guidance arrows to store the stage locations. Move the stage to insert a red arrow into the green target circle. CNC systems will perform this task automatically.
- 5 The final stitched image will appear in the live video and part view windows. The video image can now be probed and measured.

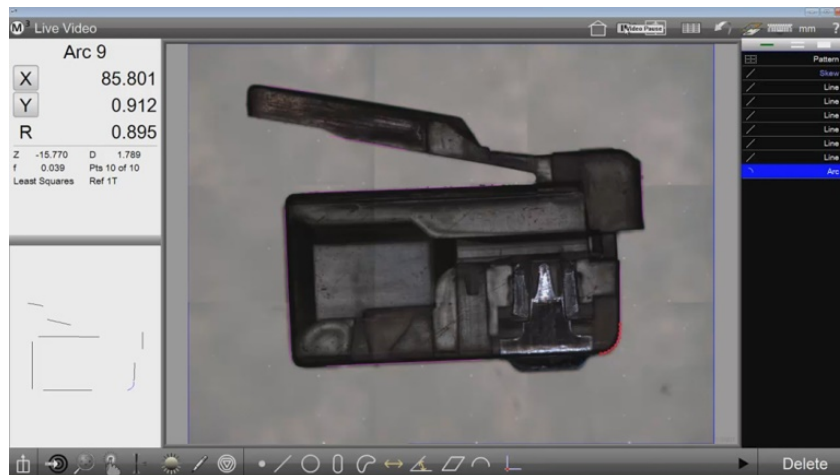

### ***Free Form Image Stitching***

To perform free form stitching:

- 1 Press the Stitch Free button





# Video Inspection Software User's Guide

- 2 Move the stage to position the stitch frames (shown in blue) at the desired locations selecting all or only portions of the image you wish to stitch. Press the screen or Enter button at each frame location. The frames are not required to be adjacent. Frames need only enclose areas that you wish to measure. When the frames enclose the image, the Stitch Dialog will be displayed as in rectangular stitching described above.
- 3 Press Automatically for CNC image stitching or Manual for manual stitching.
- 4 When manual stitching is selected, follow the user guidance arrow to store the stage locations. Move the stage to insert a red arrow into the green target circle. CNC systems will perform this task automatically.
- 5 The final stitched image will appear in the live video and part view windows. The video image can now be probed and measured. In this example, only portions of the super image that are important to the desired feature measurements were collected and stitched (areas shown in blue were not collected).




## Preset Stage Stitching

Three color coded stage areas can be stitched by the user using Preset Stage tools. Used in conjunction with pattern recognition, each of these three stage areas can be used by the system for temporary part fixturing. To perform preset stage stitching:

- 1 Move the stage to the first frame location.
- 2 Long-press the colored rectangle on the screen to store the first stage location of the stitched zone and begin the storage sequence (green in this example).





- 3 Follow the red arrow which is now enclosed by the colored preset rectangle. Press in the preset box or press Enter to store each preset location boundary on the stage. When the presets have enclosed the image, the Stitch dialog will be displayed.

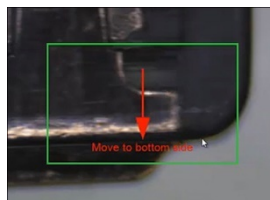

# Video Inspection Software User's Guide

- 4 Press Proceed Automatically for CNC image stitching or Proceed Manually for manual stitching.
- 5 When manual stitching, follow the user guidance arrow to store the locations. Move the stage to insert a red arrow into the green target circle. CNC systems will perform this task automatically. Now a stitched image can be constructed from camera images of the colored preset stage locations.

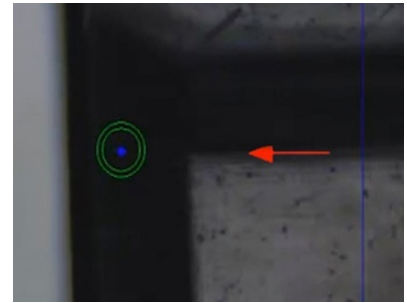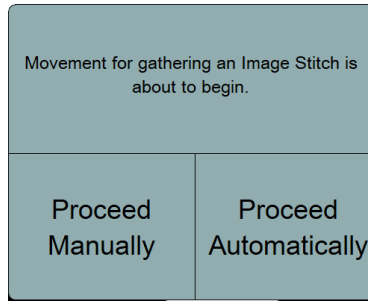

- 6 Later, to stitch a super image located within the preset stage location defined by the steps above, press the Stitch button to enable stitching and then press the appropriate colored preset button (green in this example).

**System toolbar > Stitch button**

**Stitch toolbar > Preset Color button**

- 7 The Stitch dialog will be displayed. Select Proceed Manually or Proceed Automatically to collect and stitch images.

## Opening a DXF Overlay over a Stitched Image


DXF overlays can be superimposed over stitched images within the field of view. To display a DXF overlay over a stitched image:

- 1 Register the super image part and perform feature measurements that will define its location and orientation. The super image part registration should match the registration of the DXF part file that will be used as an overlay.
- 2 Stitch the super image of the part using one of the stitching methods described earlier.
- 3 Press the Feature Overlay button to enable the overlay function if necessary.

**System toolbar > Feature Overlay button**


- 4 Select the Digital Comparator probe.

**Measure toolbar > Probe menu > Digital Comparator probe button**


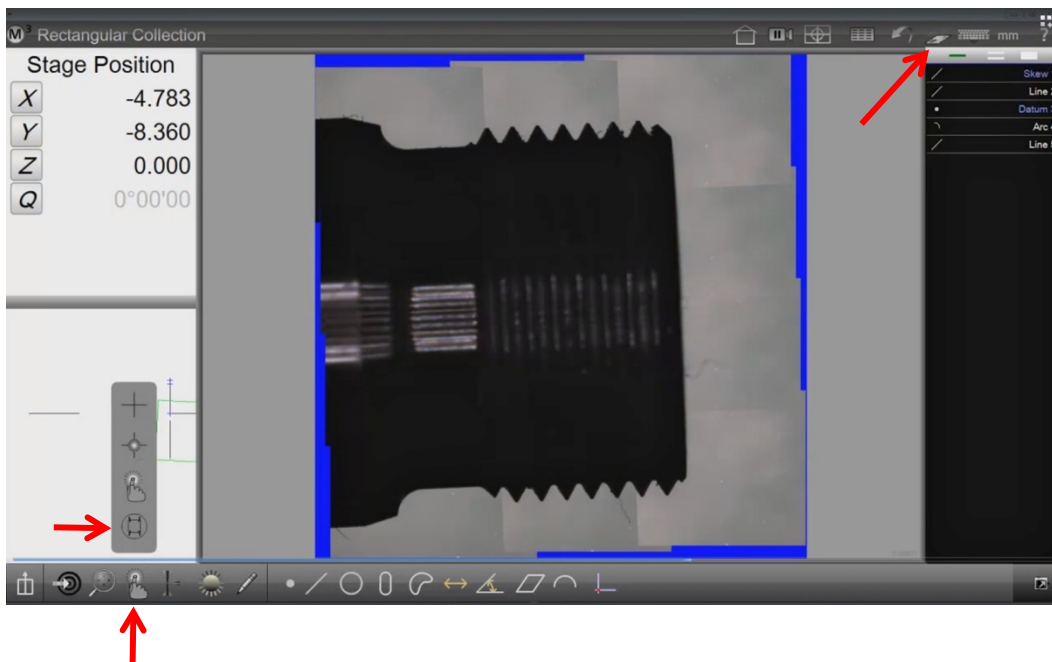


# Video Inspection Software User's Guide

- 5 Long-press the Digital Comparator probe button to display the Open DXF File dialog.
- 6 Navigate to and select the desired DXF file.

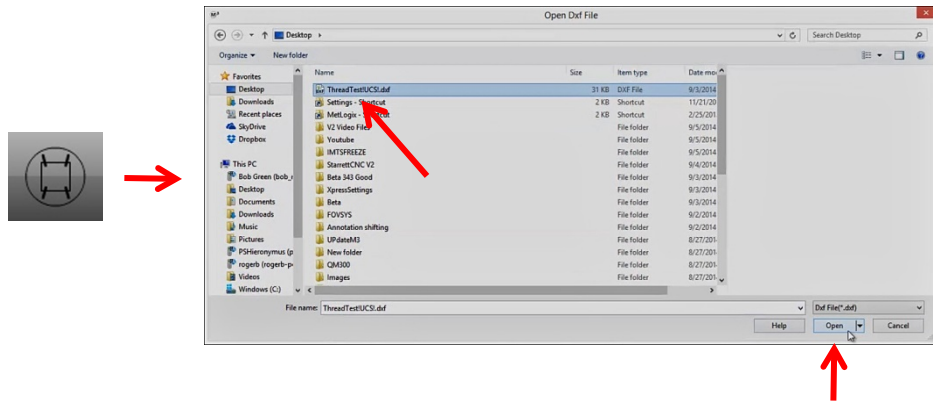

- 7 Press Open to load the DXF file. The DXF overlay will be shown in red over the stitched image.
- 8 Press and drag the DXF overlay to the desired location.

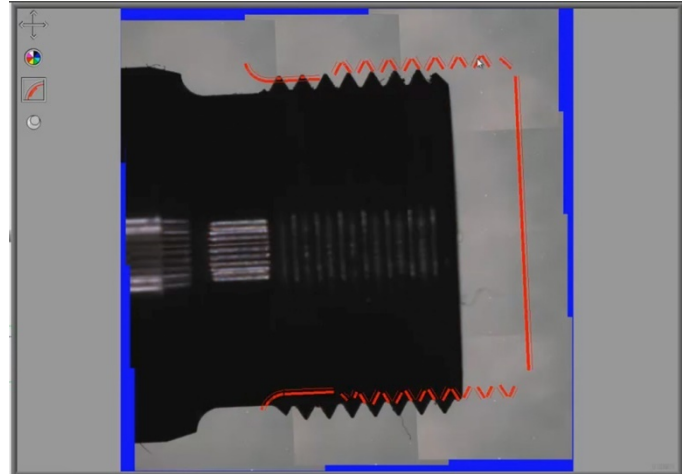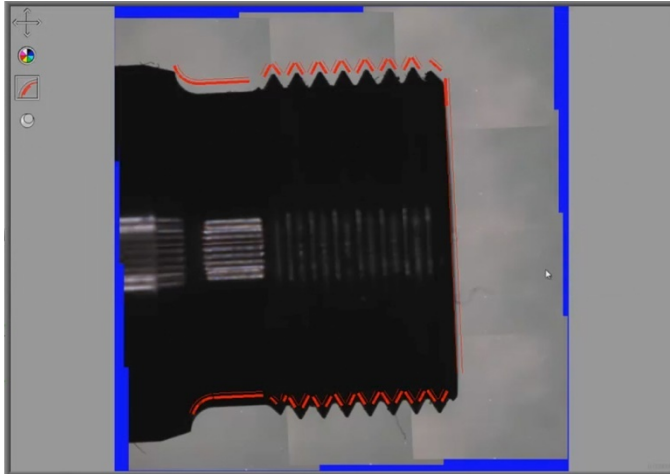



## Stitching a Super image Within a Part Program

Stitching a portion of a super image within a part program is a convenient way to apply pattern recognition so that nominal values of a high variation feature area can be applied in program playback. To include stitching in a program:

- 1 Perform super image measurements that define the part location and orientation at the beginning of the program.
- 2 Stitch an area bounding the high variability features of interest using one of the methods described earlier.
- 3 Measure a pattern to register the area of high variability features within the stitched image.

**Measure toolbar > Datum button > Pattern measure button**

- 4 Measure features that define the highly variable part geometry within the stitched pattern area.
- 5 Press the Freeze Live Video button to release the stitched image and continue overall part measurements.

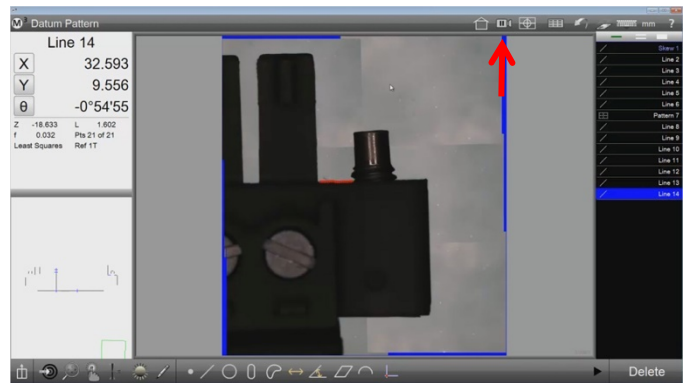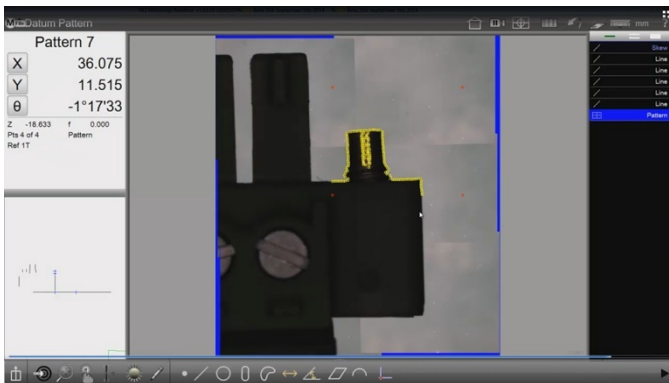

### NOTES

*While the stitched image is displayed, the registration created by teaching the pattern will be a reference for all measurements performed within the stitched image.*

*When the stitched image is released, the original part registration will be restored for subsequent feature measurements.*

## Section 6: Feature List, Feature Detail and Part View Functions

The Feature List, feature detail and Part View are the primary means of viewing and manipulating features that have been measured, constructed or created in the M3 software. The Feature List facilitates feature construction, provides access to the feature detail views and provides a means of selecting and deleting features.

The feature detail screens display all dimension, position, form and tolerance information for features selected in the Feature List or in the Part View. A feature graphic is also displayed that shows the data cloud of probed points. The feature detail also provides the means to change data fit and feature type.

The Part View is a graphical display of all measured, constructed or created features in the current reference frame. The Part View can also contain additional graphic elements such as feature annotations, a reference frame indicator and grid lines. The Part View supports feature selection for constructions using the same simple method as the Feature List. Feature selection from the Part View also provides a means of dimensioning features. A simple set of tools are provided for zooming and panning in the Part View. For touch screen enabled systems, pinch zooming and two finger panning are also supported.


### The Feature List

The Feature List always appears at the right side of the screen and changes slightly to support the current user activities. The primary functions of the Feature List include:

- Displaying part name and run numbers
- Displaying features
- Selecting features
- Deleting features
- Displaying program steps in the programming mode

### *Displaying Part Name and Run Numbers*

The top of the Feature List displays a generic part name when a program is run for the first time. A run number is also displayed when the program is run again. Run numbers are incremented in subsequent program executions. After the program is saved, the generic program name is replaced by the saved name.

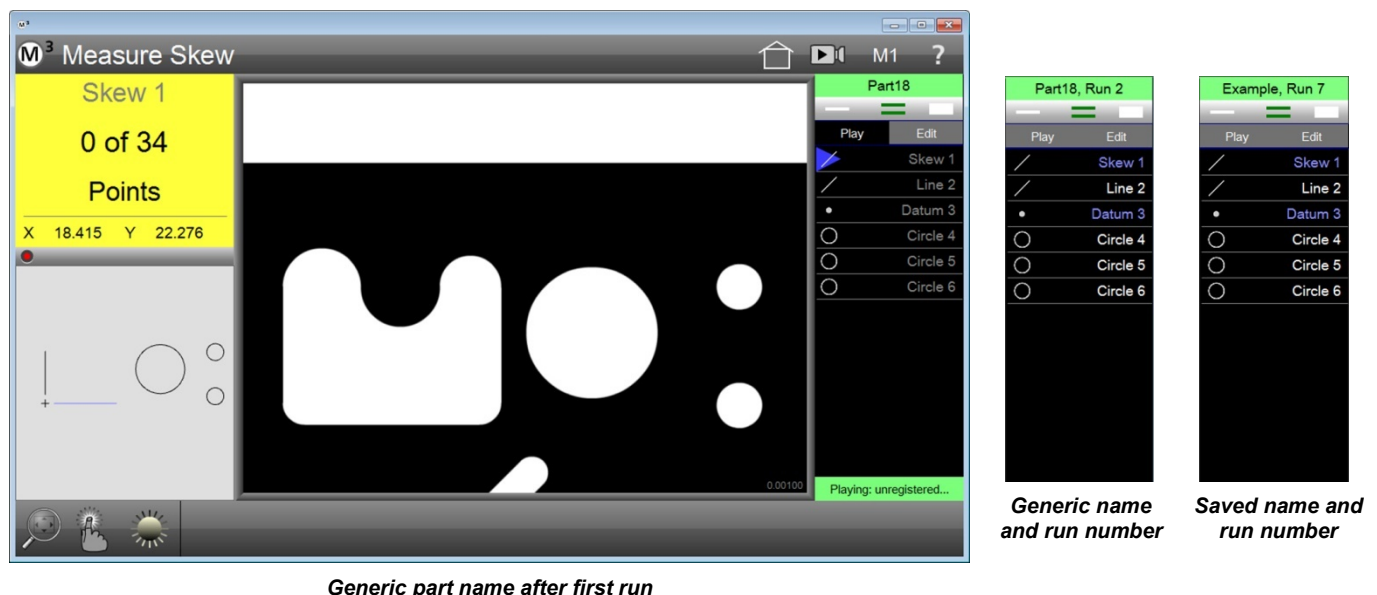

## ***Displaying Features***

All features that have been measured, constructed, or created are displayed in the feature list with their tolerance status indicated by color. Features that have passed tolerance tests are shown in white and features that have failed tolerance test are shown in red. Datum features such as levels, skews and datum points are shown in blue. These color representations of tolerance status and datum features are also shown in the Part View.

## ***Scrolling the Feature List***

When the feature list contains too many features to be displayed simultaneously on the screen, press and drag the feature list up or down to display features that are beyond the field of view.

## ***Selecting features***


Features are selected and deselected individually or in groups by pressing or clicking features. The Feature Selection tool located at the top of the feature list determines the number of features that can be selected either sequentially or simultaneously as follows:

- Press the narrow single bar for individual feature selection or de-selection
- Press the double bar for multiple feature selection or de-selection in sequence
- Press the wide single bar for group feature selection as a range. In addition, the wide single bar allows all features to be selected simultaneously.



**Feature Selection tool**

When features are selected, they are highlighted in blue in the feature list, the original probed points are shown in the live video window and the selected features are highlighted in blue in the Part View.

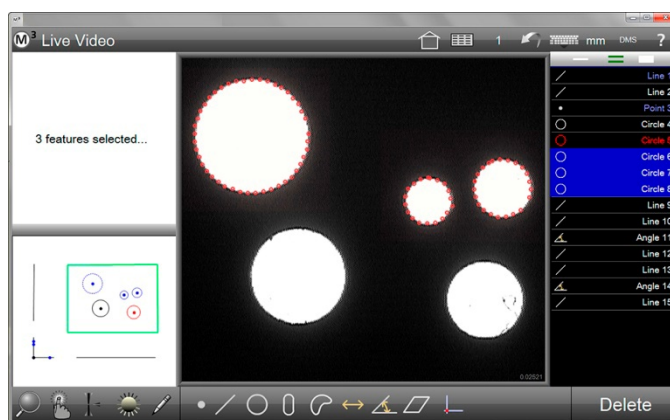

**Selected features are highlighted in blue**


## ***Feature Finder***

The Feature Finder is a special application of the Feature Selection tool. The Feature Finder is used to find and select specific features by name, groups of features with similar names or groups of like features that meet certain minimum dimensional criteria. To use the Feature Finder:


- 1 Long press the Feature Selection tool to display the Find Feature dialog
- 2 To find a single specific feature, enter the full feature name into the Name field and then press Done. The specified feature will be highlighted in the feature list.



# Video Inspection Software User's Guide

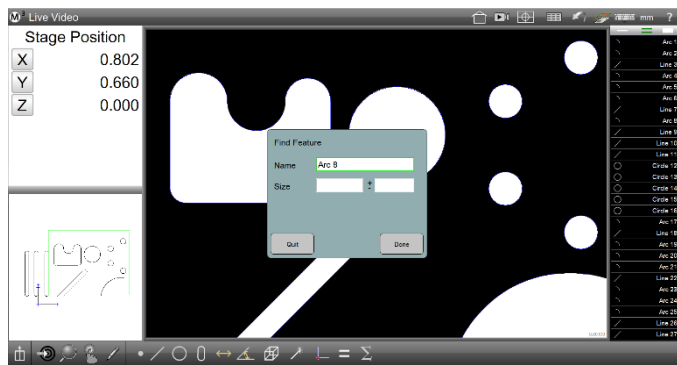


*Enter the full name of a specific feature*

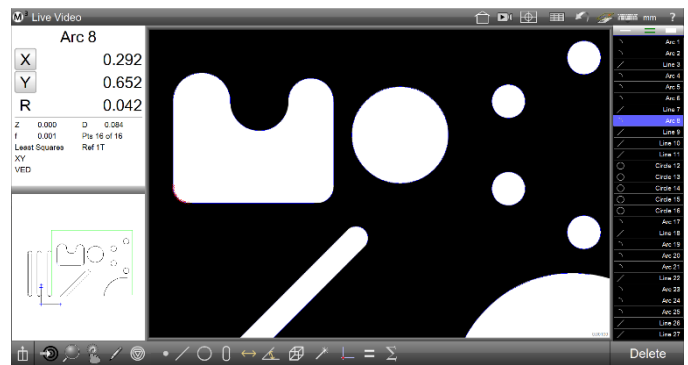


*The specified feature will be highlighted in the Feature List*

- 3 To find a group of features with similar names, enter the first part of a feature type name into the Name field and then press done. The specified group of features will be highlighted in the feature list.


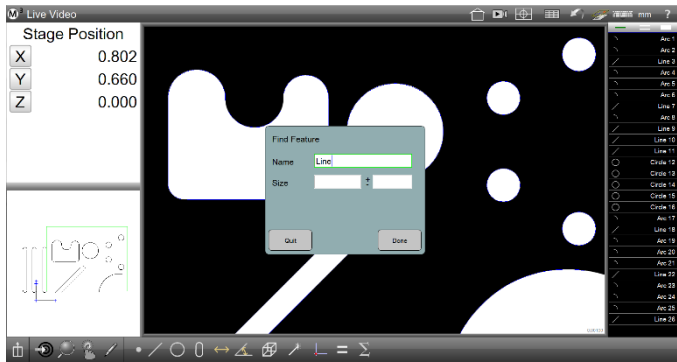


*Enter the first part of a feature type name*

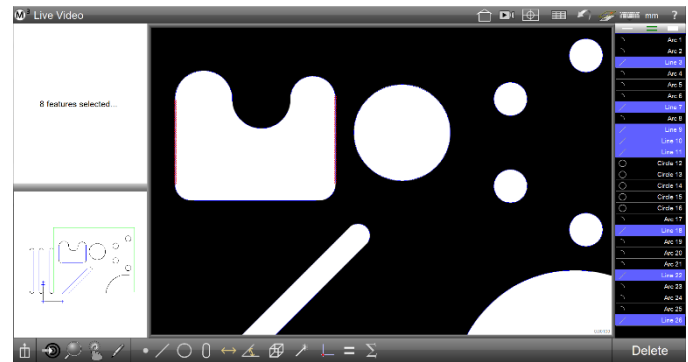

*The specified group will be highlighted in the feature list*

- 4 To find a group of like features that meet certain dimensional criteria, enter the feature type name into the Name field and then enter the size and variation criteria into the Size and  $\pm$  fields. Size and variation criteria apply to circles, arcs, lines and distances as follows:
  - Circles: size refers to diameter
  - Arcs: size refers to radius
  - Lines: size refers to length
  - Distances: size refers to length
- 5 Press done to complete the find operation.

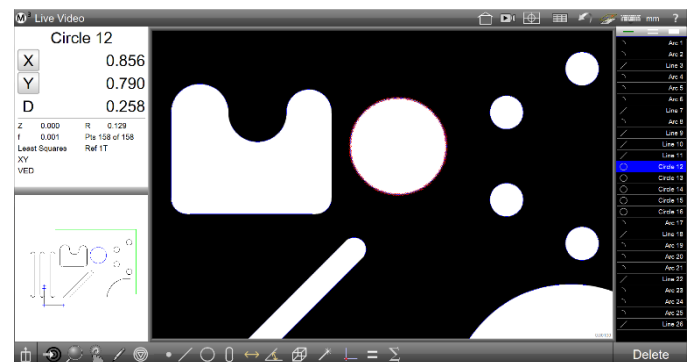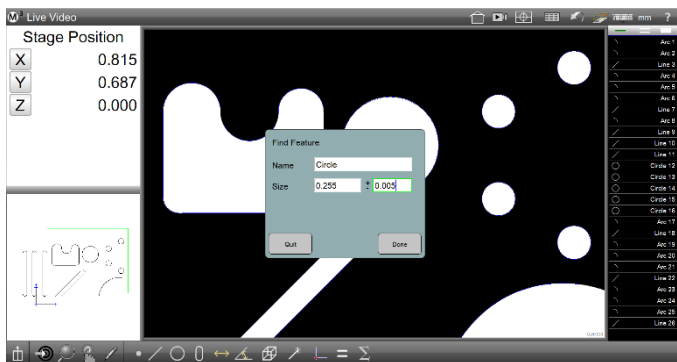

## ***Deleting Features from the Feature List***

When one or more features are selected and highlighted in the Feature List, a Delete button is shown in the Measure Toolbar. To delete one or more highlighted features:

- 1 Select the features that you wish to delete
- 2 Press the Delete button. The delete key on the keyboard may also be used.

**Measure toolbar > Delete**

OR

**Computer keyboard > Delete**

To delete all the features of the Feature List:

- 1 Press and hold the Delete button.

**Measure toolbar > Delete**



### ***NOTES***

*Features can also be deleted in the program edit mode discussed later in Section 11: Programming.*

*Features that have been deleted can be restored by pressing the Undo button in the System toolbar.*




## Feature Detail screen


The Feature Detail screen displays the measurement results for the feature selected in the Feature List or in the Part View. A graphic view of the feature is displayed that shows the data cloud of probed points. The feature detail screen also provides access to tolerancing and datuming functions and the means to change data fit and feature type. Tolerancing is discussed in detail in [Section 8: Tolerancing](#). Datuming was discussed in [Section 4: Measuring, Constructing and Creating Features](#), and will be discussed again in [Section 7: Reference Frames](#).

To access the Feature Detail screen:

- 1 Select the desired feature in the Feature List and then press the DRO/Feature Detail viewport in the upper left portion of the screen. The Feature Detail screen will be shown in the center viewport.

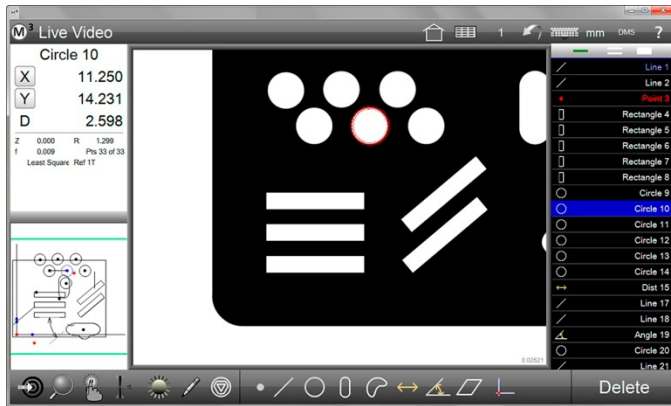

*Select a feature and then press the Feature Detail viewport*

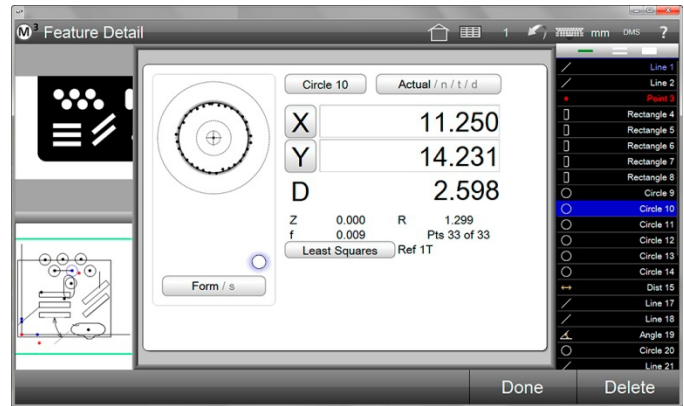

*The Feature Detail screen will be displayed*

As shown in this example of a Feature Detail screen for a circle, feature parameters are shown that includes:

- Feature name
- Position (X, Y and Z)
- Dimension: diameter and radius for this circle
- Form
- Number of points in the data cloud
- Access to tolerance screens
- Data cloud fit
- Graphic of feature data cloud
- Reference frame number


The data cloud fit can be changed when other fits are available by pressing the data cloud fit button (labeled Least Squares for this circle). When the data cloud fit is changed, the graphic of the feature and other feature parameters will change in response.

Pressing the Tolerance buttons (Actual, Nominal, Tolerance and Deviation) provides access to the tolerance screens for this feature. Tolerance screens include:


- Nominal
- Tolerance
- Deviation

Press the Tolerance button repeatedly to cycle through all of the tolerance screens.


# Video Inspection Software User's Guide

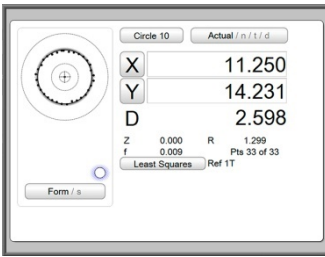


**Pressing Actual displays the Nominal screen**

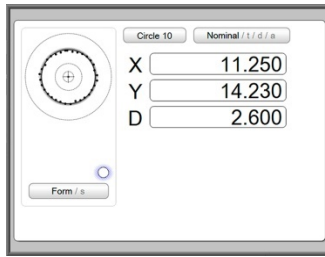

**Pressing Nominal displays the Tolerance screen**

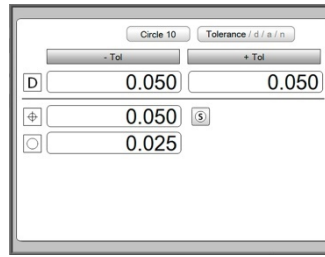

**Pressing Tolerance displays the Deviation screen**

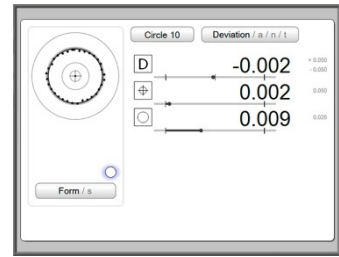

**Pressing Deviation displays the Actual screen**



## **NOTE**

**The tolerance screens are discussed in detail in Section 8: Tolerancing**

## Part View Screen

The Part View screen is a graphical display of all measured, constructed or created features for the current measurement session. The Part View can also contain feature annotations, a reference frame indicator, the run number and grid lines. Features can be selected for constructions using the same method as the Feature List. Feature selection from the Part View also provides a means of dimensioning features. Tools are provided for zooming and panning in the Part View. For touch screen enabled systems, pinch zooming and two finger panning are also supported.


Part View functions include:

- Selecting features
- Panning and zooming features
- Feature annotation
- Box markup
- Text markup
- 3D views


### Accessing the Part View screen

To access the Part View screen:

- 1 Press the small part view in the lower left viewport. The Part View screen will be presented in the center viewport.

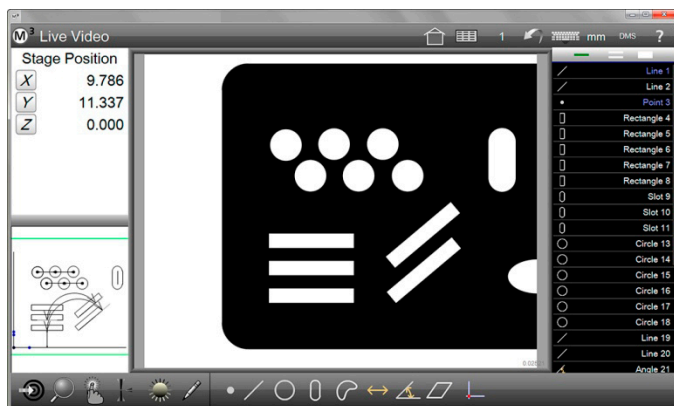

*Press the small part view in the lower left viewport*

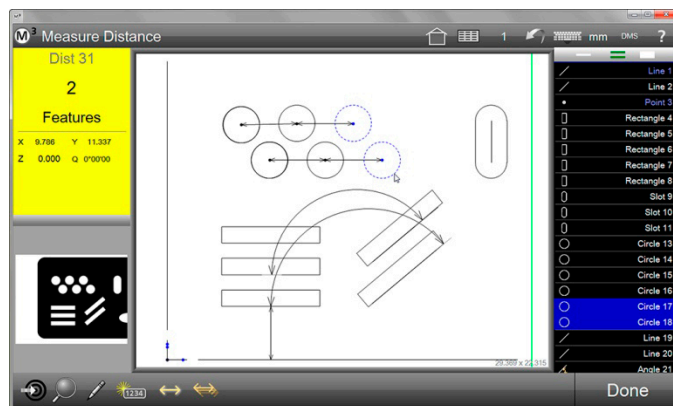

*The Part View screen will be presented in the center viewport*

### Selecting Features in the Part View screen

Features are selected in the Part View screen to perform operations including:


- Constructions
- Feature deletions
- Markups of feature parameters

To select features and Part View screen:


- 1 Press or click the features in the Part View screen. Selected features will appear as blue dashed lines. The features are selected as if they had been selected in the Feature List and will be highlighted in the Feature List.

# Video Inspection Software User's Guide

In this example, two circles were selected in order to create a distance construction between them. When a construction is completed, the constructed feature is shown as a blue dashed line and the parent features are shown as solid orange lines.

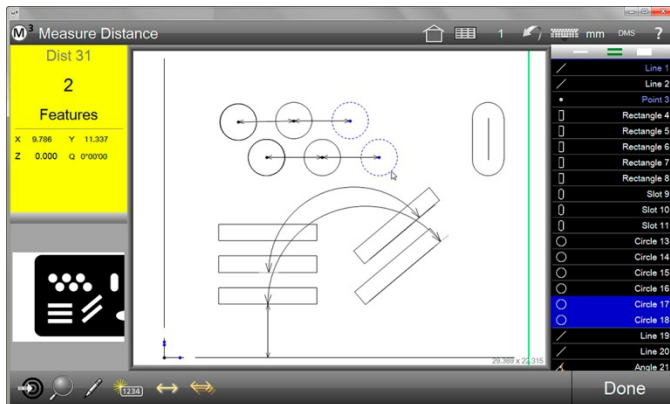

*Press or click features to select them*

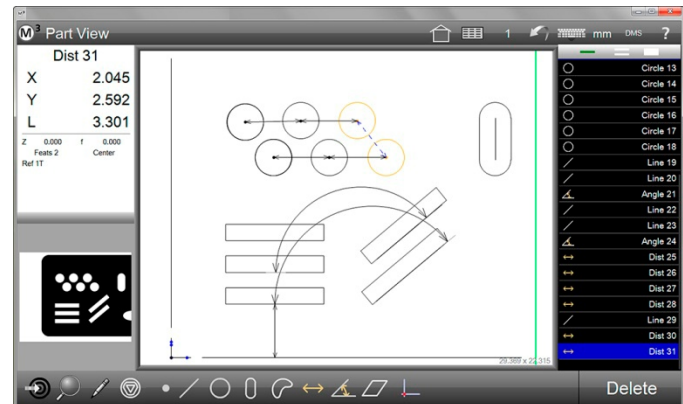

*A construction between two circles is shown*

## Zooming and Panning

As features are measured, constructed and created, they will populate the Part View screen. Depending on the zoom level, features may extend beyond the viewable area of the Part View. Features that extend beyond the Part View can be brought into viewable range by using one of the several available zoom commands in the Zoom menu found in the Measure toolbar. Pinch-zooming can also be performed in systems with multitouch support. Panning allows the user to move the Part View in any direction using fingertips or the mouse cursor.


To zoom in or out:

- 1 Select the desired Zoom function from the zoom menu.  
**Measure toolbar > Zoom button > Zoom function**
- 2 Or alternatively in multitouch systems, press two fingers to the screen and expand or pinch to zoom out or in.

To pan the Part View:

- 1 Right-click the mouse cursor in the part view and drag the part view image in any direction.
- 2 Or alternatively in multitouch systems, press the screen and drag the image in any direction.

In this example, the Part View was zoomed and panned to show the two circles and constructed distance shown earlier in greater detail.

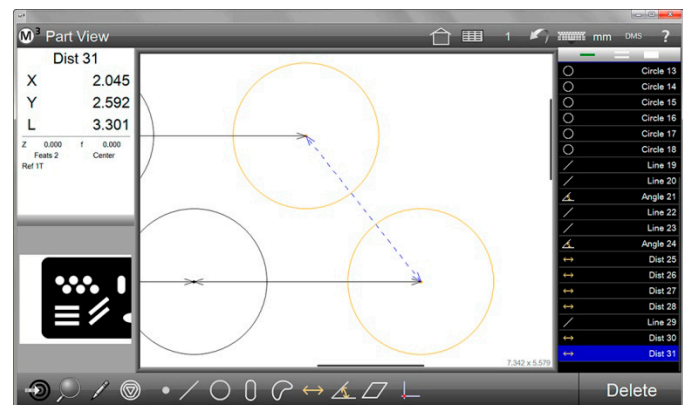

## Adding Feature Annotations

Feature annotations can be used to add valuable information to the part view. To annotate a feature in the Part View:

- 1 Select the feature that you wish to annotate.
- 2 Press the Markup button to display the Markup menu in the Part View.

**Measure toolbar > Markup button**


A menu of items will appear on the right-hand side of the Part View. Select the markup items to apply to the selected feature. The Markup menu changes to support the selected feature type.

- Auto will draw a single representative coefficient for the selected feature

# Video Inspection Software User's Guide

- Name will include the feature name in the annotation box
  - Tolerances will include nominal and deviation values for the feature
- 3 Press the selected feature where you would like to place the annotation box and drag the box away from the feature. An annotation box will appear with an arrow line attached to the feature. Move the annotation box to the desired location and release your finger or mouse cursor.

In this example, annotations were made to one circle and one distance.

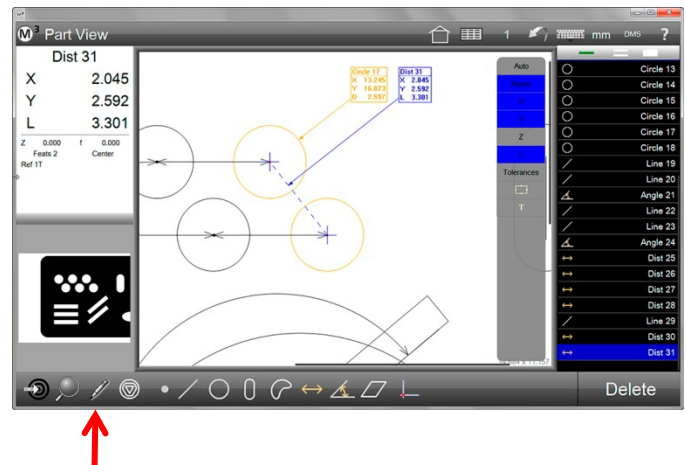

## Adding Box Markups


Boxes can be added to the Part View in one of four colors. To add a box to the Part View:

- 1 Press the Markup button (pencil) to display the Markup menu in the Part View.  
**Measure toolbar > Markup button**

A menu of items will appear on the right-hand side of the Part View.

- 2 Select the Box Markup button from the bottom of the menu.
- 3 Press or click on the screen and drag to create a box of the desired shape. Release your finger or the mouse cursor to complete the box graphic.
- 4 Once the box annotation is complete, it can be resized using the circular handles at the corners or can be moved by pressing or clicking in the box and dragging it to the desired location.
- 5 To change the color of the box, select the box and then choose the desired color from the color selector dots displayed below the box.

In this example, a red box was added to the bottom right of the part view.

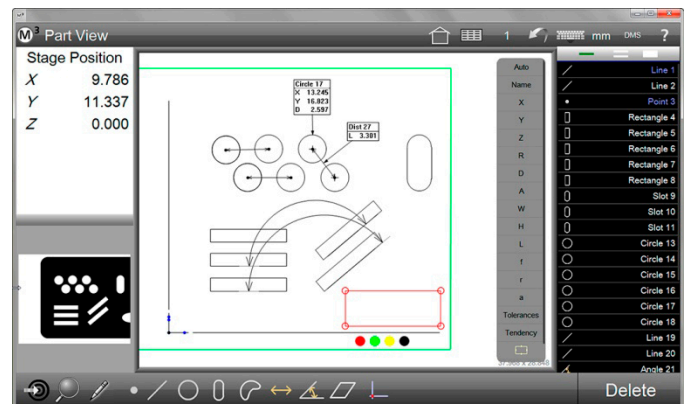


## Adding Text Markups


Text can be added to the Part View to convey important information regarding measurements and other observations. To add a text markup:

- 1 Select the feature that you wish to attach the text markup to.
- 2 Press the Markup button (pencil) to display the Markup menu in the Part View.  
**Measure toolbar > Markup button**  
A menu of items will appear on the right-hand side of the Part View. Select the coefficients or tolerances to apply to the selected feature.
- 3 Select the Text Markup (T) button at the bottom of the menu and press or click a point on the feature where you would like to attach the text markup.
- 4 Drag the text markup box away from the feature. The text markup box will appear with an arrow line attached to the feature. Move the box to the desired location and release your finger or mouse cursor.
- 5 To change the color of the box, select the box and then choose the desired color from the color selector dots displayed below the box.
- 6 Enter text into the box using the keyboard.

# Video Inspection Software User's Guide

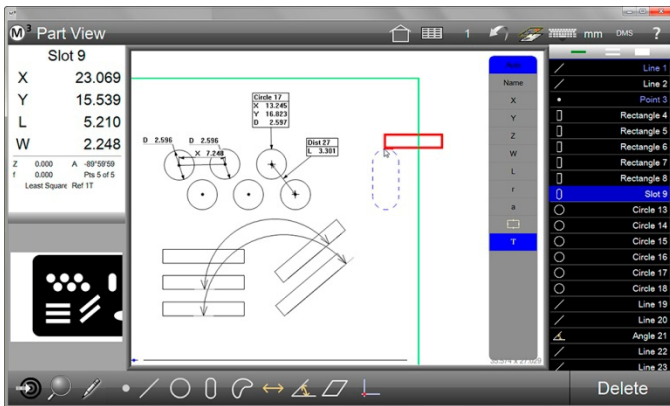


**Text markup box attached to the feature**

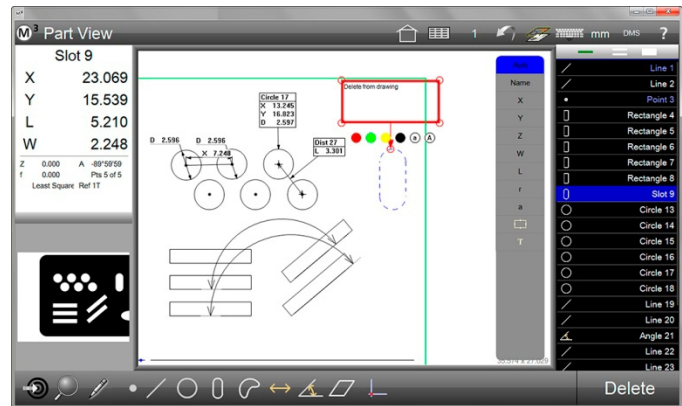

**Markup box resized and text entered**

- 7 Resize the text if necessary, by pressing or clicking on the lowercase or uppercase character under the markup box.


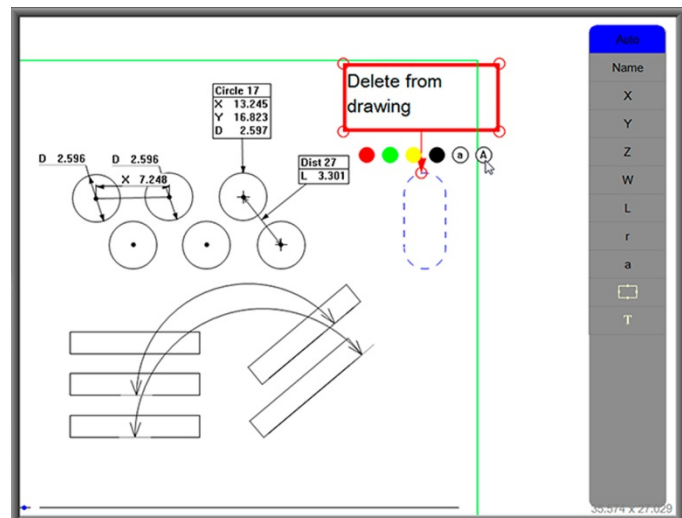


**Markup text resized**

## Enhanced Data Cloud Display

Data clouds from measured features can be displayed directly on the feature graphic in the main part view, and as an overlay on the live video image. Data cloud inspection tools such as point display scaling, and best/worst point finder tool help quickly analyze VED measurement results.

The Enhanced Data Cloud tools are accessed via the “Show Data Points” button, available in the Annotation menu.

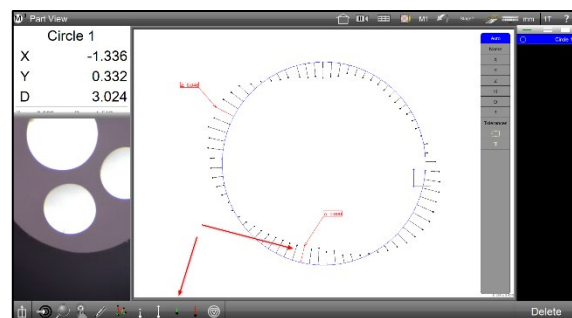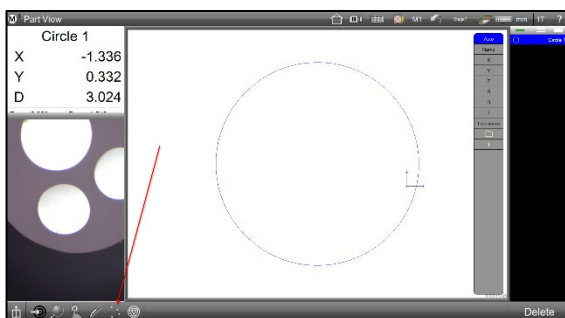



# Video Inspection Software User's Guide


The following identifies and describes the functionality of the data cloud tool bar buttons.



- (1) Annotation Menu Button – Opens and closes the Annotation Menu
- (2) Show/Hide Data Points Button – Toggles the selected feature(s) datapoints between shown and hidden.
- (3) Decrease Whisker Mag Button – Decreases the magnification(scaling) of all datapoints in the selected feature. Long-press the button to display a numeric entry dialog. Enter the numeric magnification you would like to use. Press Done to set the specified magnification.
- (4) Increase Whisker Mag Button – Increases the magnification(scaling) of all datapoints in the selected feature. Long-press the button to display a numeric entry dialog. Enter the numeric magnification you would like to use. Press Done to set the specified magnification.
- (5) Better/Best Whisker Button – Steps through the selected features data cloud, point by point, in the direction of smaller/less form error. Long-press the button to automatically select the data point with the least form error.
- (6) Worse/Worst Whisker Button – Steps through the selected features data cloud, point by point, in the direction of greater/more form error. Long-press the button to automatically select the data point with the greatest form error.



## **An example for adding Data Cloud Markup to the part view**

- 1 Measure a feature, preferably with a moderate to high point density, to use for demonstration in the following procedure.
- 2 Press in the small part view to bring it to the large center viewport.
- 3 Press the Annotation Menu button to open the annotation toolbar.
- 4 Select the features from the feature list that you would like to enable data point display for.
- 5 Press the Show/Hide Data Points button to display data points and whiskers for the selected features.
- 6 Press the Increase and Decrease Whisker Mag buttons to set the desired scaling for the display of data point whiskers. Features with very low total form error may benefit from increased magnification in order to more easily observe variation in form error graphically. The inverse is true for features of very large total form error.

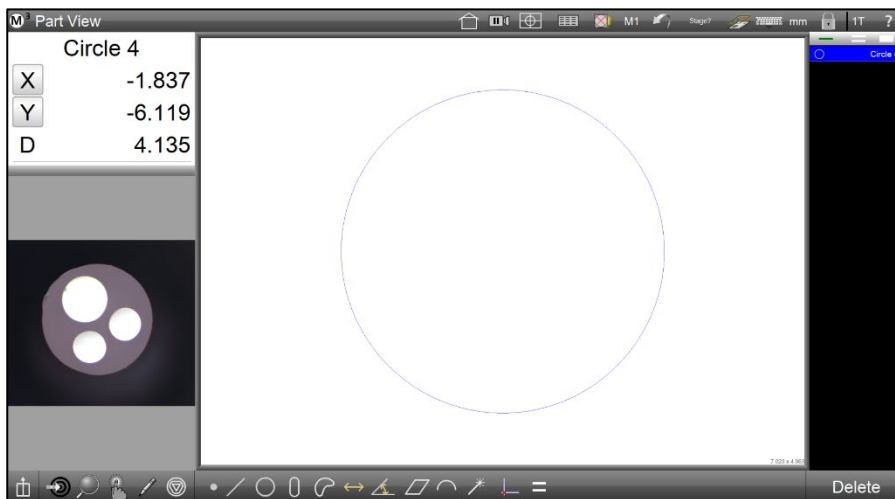

# Video Inspection Software User's Guide


- 7 Long-press on either the Increase or Decrease Whisker Mag button to display the numeric entry dialog for manually setting whisker magnification. Magnification can be set to individual features, or to a selected group of features.
- 8 Select a single feature in the feature list, then a single data point in its data cloud. An annotation label displaying the datapoints "delta from fit" will be added for that data point. Press delete to remove the annotation label or select additional data points to add more labels. Press annotation items from the list at the right to add and remove data from the label.

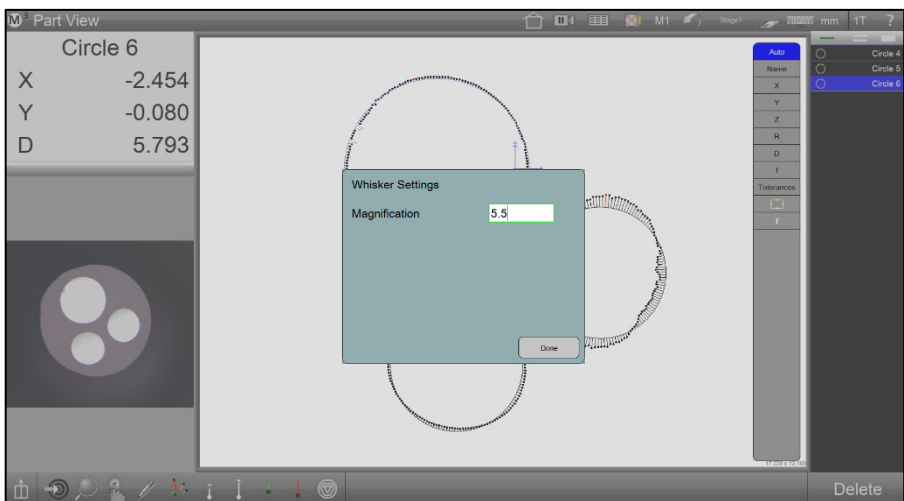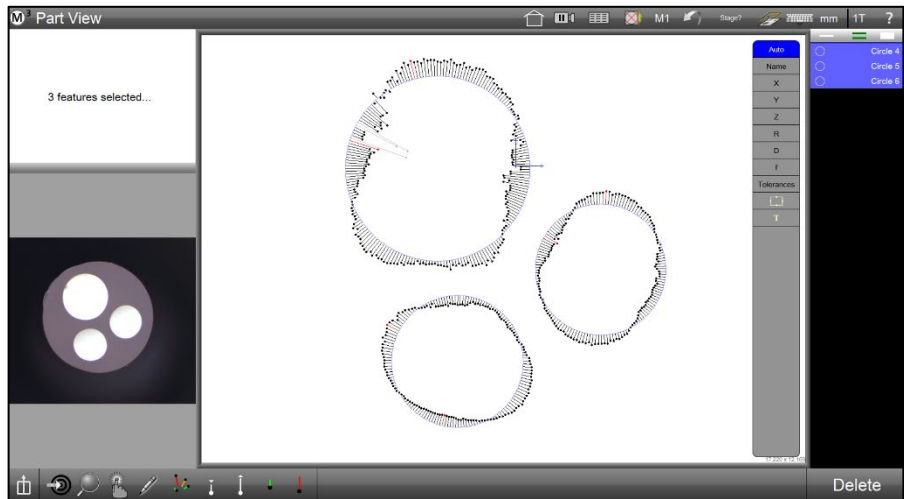

## NOTE


*The data point with the greatest delta from the fit, per side, will be displayed in red. Added annotation labels are also displayed in red.*

- 9 Long press the form error buttons to automatically select the whisker with the least or most form error.
- 10 Press in the live video viewport to bring the live video into the large center viewport.
- 11 Press the Part View Overlay button in the top right toolbar to display the data point markup on top of the live video image.
- 12 Data cloud markup can be printed along with the part view or live video by pressing the print button from the M3 menu.

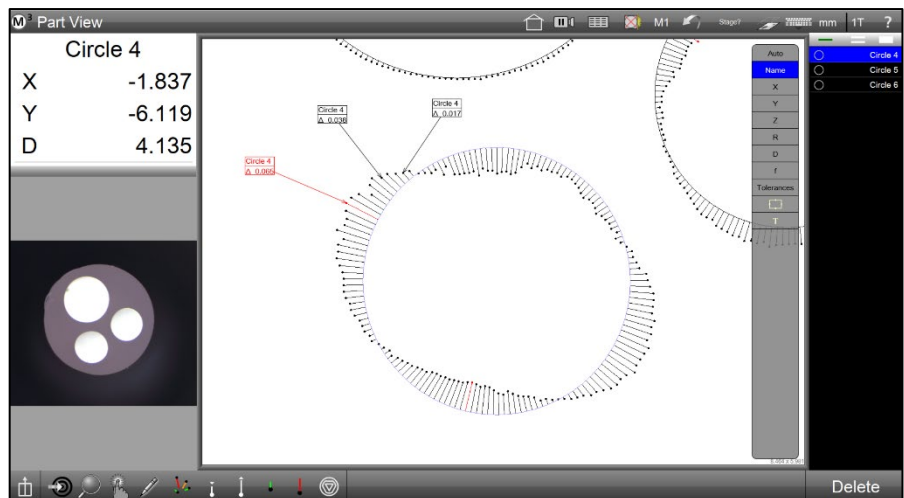



# Video Inspection Software User's Guide

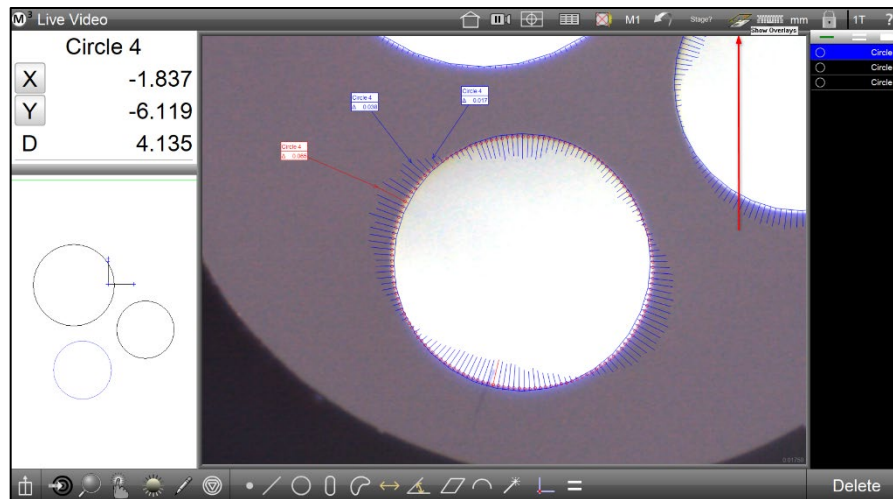

## 3D Viewing



Systems that include the touch probe option also include 3D viewing functions. 3D part drawings are displayed in the Part View window and include all the viewing tools and functions of 2D drawings, such as Zooming, Panning and Annotation. Additional 3D functions include:

- Displaying 3D part views
- Changing 3D horizontal and vertical rotation
- Displaying preset 3D views

## Displaying 3D Part Views

To display the 3D part view:

- 1 Press the small Part View window. The Part View will be displayed in the center window as a 2D image in the top view.

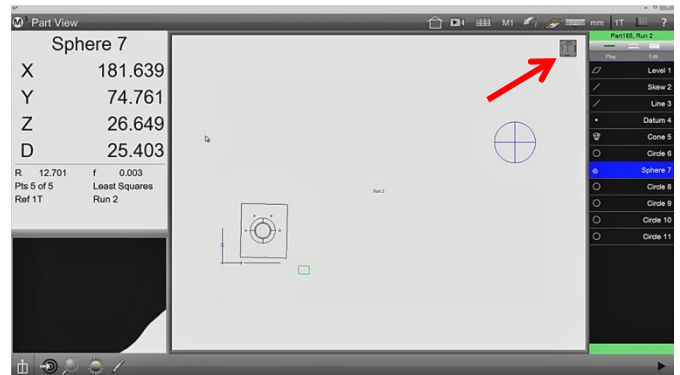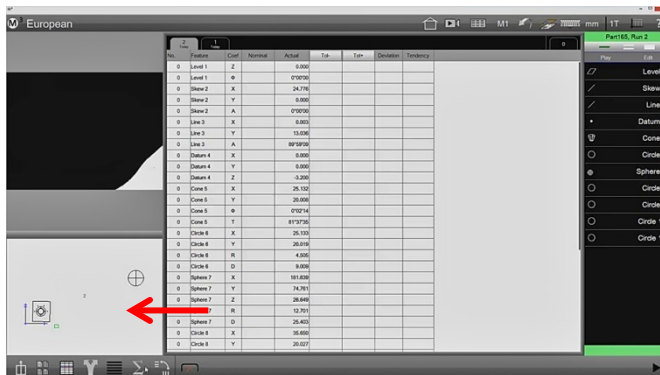

- 2 Long-press and hold the control key to enable 3D viewing.



OR

- 2 In touch probe enabled systems, long-press and release the View Cube at the top-right of the center window to enable 3D viewing.

In either case, the View Cube will change to show 3D drawing orientation and the part view will change to 3D.

- 3 Use the Pan and Zoom functions to optimize the display of features.

# Video Inspection Software User's Guide

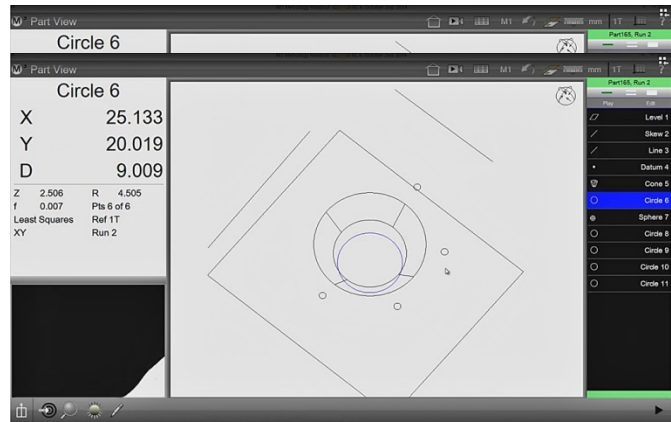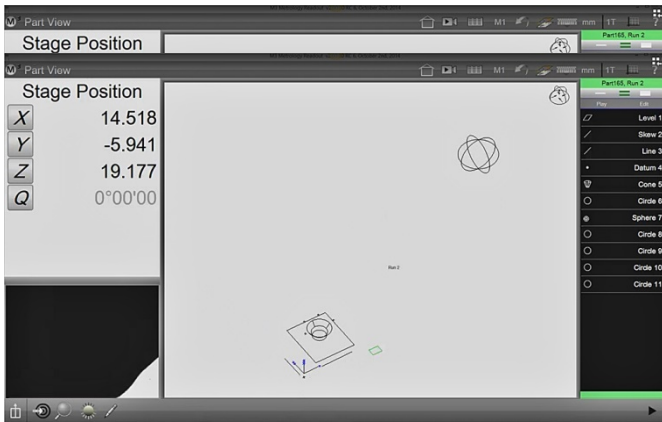


## **Rotation and elevation view controls**

When 3D viewing is enabled by control key or View Cube, rotation and elevation of the view are controlled by pressing and dragging on the screen.


### **Changing the Horizontal Rotation**

To change the horizontal rotation:


Press and drag horizontally on the screen. Drag to the left to rotate the front to the left.

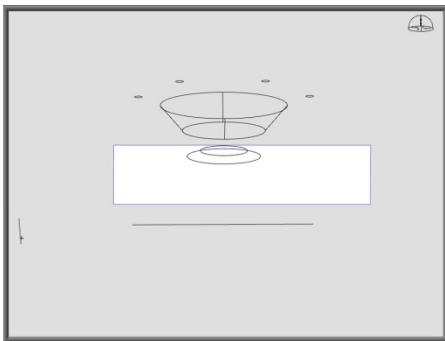

***Not rotated***

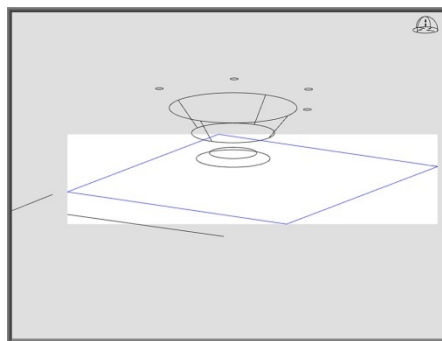

***Rotated left***

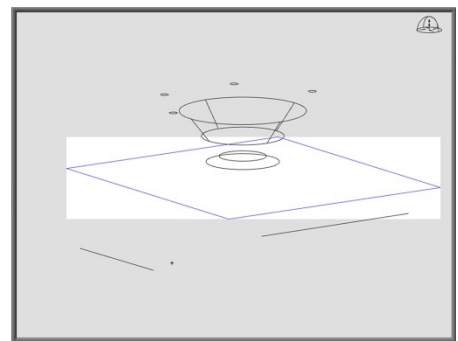


***Rotated right***


### **Changing the Vertical Rotation**

To change the vertical rotation:


Press and drag vertically on the screen. Drag up and down.

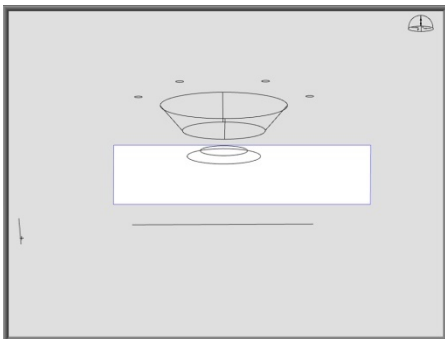

***Not rotated***

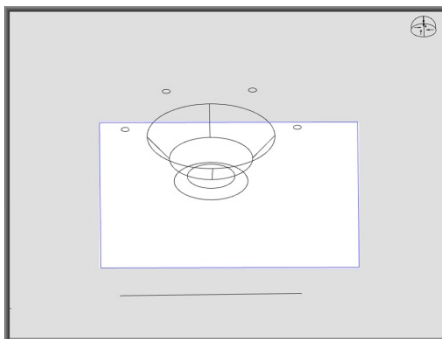


***Rotated down***

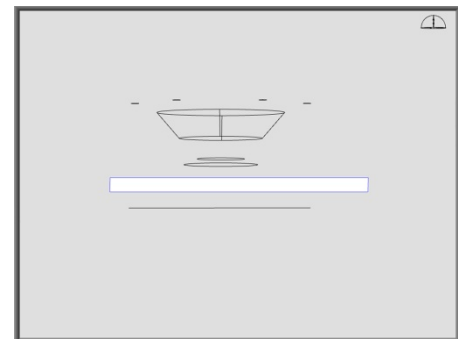

***Rotated up***

# Video Inspection Software User's Guide

Markups retain their position and readability throughout rotation changes.


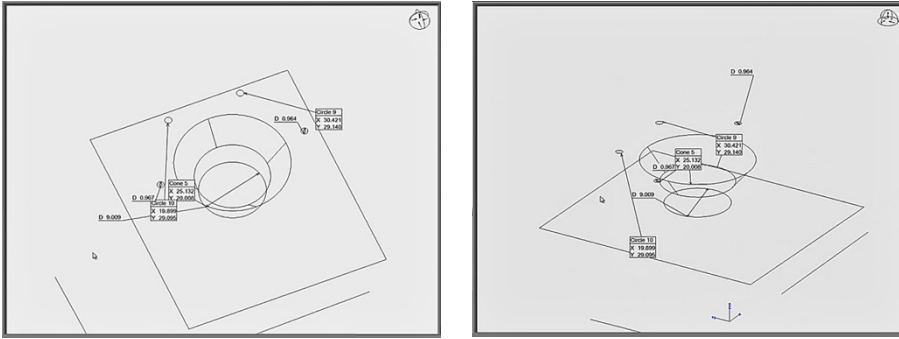


## Preset 3D Views

Standard preset viewing orientations can be selected from the 3D Preset menu.

To select a viewing orientation:


- 1 Long-press the Zoom menu button. The Preset menu will be displayed.
- 2 Press the desired preset view. This example shows the SW (southwest) view.

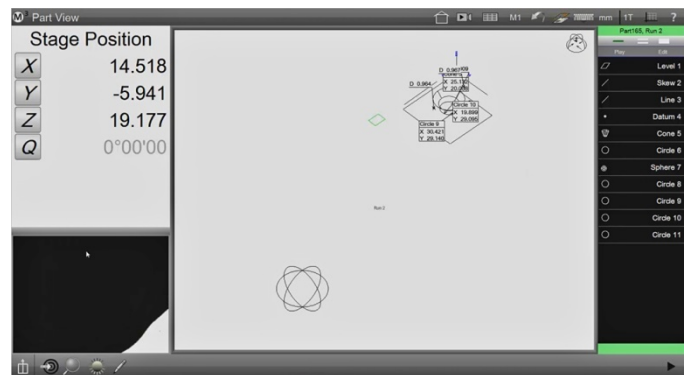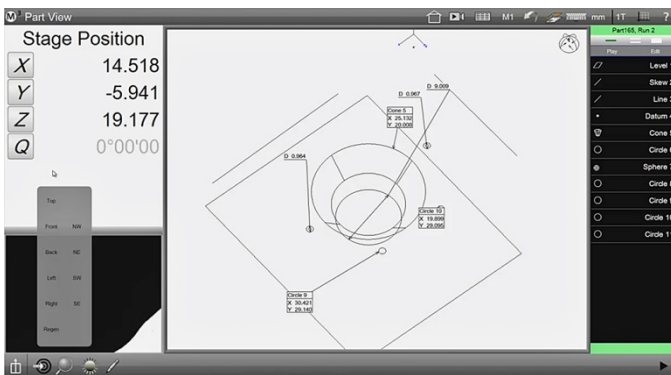

## *The Part View Overlay*

Once the Part View has been marked up with measurement parameters in text, the marked-up view can be used as an overlay to add valuable information to the live video window view. To display the Part View overlay:

- 1 Press the Home button to display the live video feed in the center viewport.  
**System toolbar > Home button**
- 2 Press the Overlay button to position the Part View markup over the live video image of the part.  
**System toolbar > Overlay button**

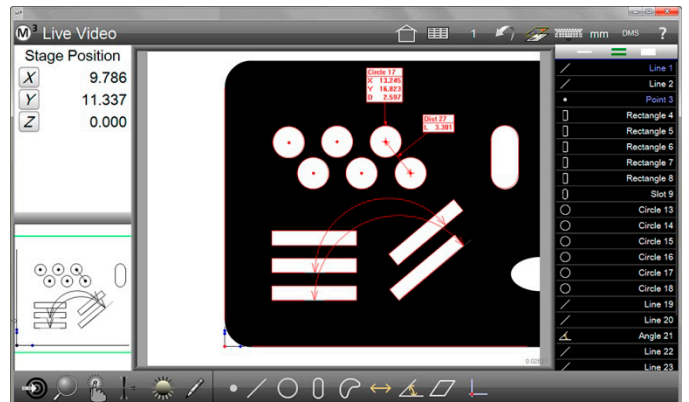



## Section 7: Reference Frames

Establishing a reference frame and datuming are accomplished using a variety of alignment operations. These operations may be used individually or in combination and will be based upon the capability of the measuring machine as well as the alignment requirements of the application.

Datuming operations can be performed in the form of explicit datum feature measurements, by modifying the individual coefficient values of previously measured features or by constructing datums from existing features.

In three axis systems, the M3 can perform a primary part alignment by evaluating the surface-level of the part, a secondary x-axis part skew alignment and finally establish a datum point which is the origin of the 2D or 3D coordinate system.

When measuring a datum-dependent part, it is advisable to establish a level, skew and datum alignment first, and then measure the features associated with that datum. If multiple datums or reference frames are required, establish the initial datum and measure the associated features. Then proceed to the next datum and measure the features associated with it. Always try to follow the sequence of establishing a datum and then measuring the features associated with that datum.

The skew, or secondary alignment, can be offset by the user when the skew line position is located where it cannot be measured directly by the system. This offset skew position is identified by values from other measured or constructed features. The skew alignment can also be rotated to specified angular values by the user to facilitate measurements based on angular secondary alignments.



### NOTES

*Establishing a complete primary, secondary and tertiary reference frame may not always be required, even in three axis systems. Some three axis systems and the associated applications will not require that a level be performed. In these cases, a skew alignment and datum zero point are typically adequate for successful part of alignment and measurements.*

*Most well-maintained systems include stage surfaces that are level with only extremely minor variations. In video systems that have level variations across the surface of the stage that are smaller than the video camera depth of field, performing a video leveling operation is not beneficial.*

## Establishing a Reference Frame

The M3 measurement reference frame can consist of:

- Part leveling (a primary datum plane)
- Skew alignment (secondary alignment)
- Part Datum (measurement coordinate system origin)


### ***Part Leveling***

When the surface plane of a part is not orthogonal to the measuring axes, small cosine errors can be generated during the measurement process. These errors can be eliminated by leveling the part.

To measure a primary datum plane:

- 1 Select the desired probe from the probe menu.  
**Measure toolbar > Probe menu > Desired probe**
- 2 Press the Datum Plane button of the Datum menu.  
**Measure toolbar > Datum menu > Datum plane button**

# Video Inspection Software User's Guide

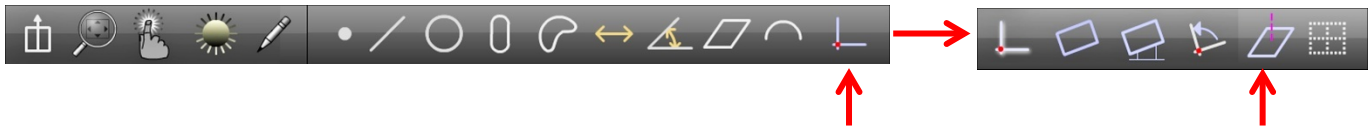

- 3 Probe a minimum of three points evenly distributed across the surface of the part. Probing more than three points increases the accuracy of the measurement.
- 4 Press the Done button to complete the measurement and enter the datum plane into the Feature List.

**Measure toolbar > Done button**



## NOTE

 
*Previously measured or constructed plane features can also be leveled by manually zeroing the theta angle coefficient and the Z position coefficient. Pressing the label buttons to the left of these coefficients in either the feature detail screen or the DRO viewports will set the corresponding values to zero.*

## Skew alignment

When a part is misaligned (twisted) in the XY plane, small cosine errors can be generated during the measurement process. These errors can be eliminated by creating a skew alignment for the part. The skew alignment performs a precise measurement of the part of misalignment in the XY plane. Once the misalignment is known to the system, subsequent feature measurements are automatically compensated to eliminate cosine errors. Measurement data in the feature detail screen and DRO viewports will reflect measurements of a perfectly aligned part.

To create a skew alignment:

- 1 Select the desired probe from the probe menu.  
**Measure toolbar > Probe menu > Desired probe**
- 2 Press the Skew button of the Datum menu.  
**Measure toolbar > Datum menu > Skew button**



- 3 Probe a minimum of two points well distributed along the entire length of the desired part reference edge.
- 4 Press the Done button to complete the measurement and enter the skew line into the Feature List.

**Measure toolbar > Done button**



## NOTE

*Previously measured or constructed features can also be used to perform a skew alignment by manually zeroing the theta angle coefficient and the X or Y axis coefficient. Pressing the label buttons to the left of these coefficients in either the Feature Detail screen or the DRO viewport will set the corresponding values to zero.*

## Datum Creation

Creating the part datum point (origin) is the final step in establishing a valid reference frame for subsequent measurements. The part datum can be created by:

- Probing a single point
- Constructing a point from one or more parent features
- Manually zeroing the X and Y coefficients of a feature

## ***Probing a Part Datum Point***

The part datum can be created directly by probing a point. To probe a part datum point:

- 1 Select the desired probe from the probe menu.  
**Measure toolbar > Probe menu > Desired probe**
- 2 Press the Datum button.  
**Measure toolbar > Datum button**
- 3 Probe the desired point and press the Enter button or the probe prompt window.  
**Measure toolbar > Enter button**
- 4 Press the Done button to complete the measurement and enter the part datum point into the Feature List.  
**Measure toolbar > Done button**

## ***Constructing a Part Datum Point from one or more Parent Features***

The part datum can be constructed from one or more parent features when simply probing the desired point is not convenient or possible. Supported point constructions are specified in [Section 4: Measuring, Constructing and Creating Features](#). To construct a datum point from a single feature:


- 1 Press the Datum button.  
**Measure toolbar > Datum button**
- 2 Select (highlight) the desired parent feature or features in the Feature List or Part View.
- 3 Press the Done button to complete the construction and enter the part datum point into the Feature List.  
**Measure toolbar > Done button**

## ***Creating a Datum by Manually Zeroing the X and Y Coefficients of a Feature***


Any of the features contained in the Feature List can be used as a part datum by manually zeroing the X and Y feature coefficients. The X and Y coefficients can be zeroed in the DRO viewport or in the feature detail screen. To zero the X and Y coefficients of a feature:

- 1 Select (highlight) the desired feature in the Feature List.
- 2 Press the X coefficient button and then the Y coefficient button in the DRO viewport or in the feature detail screen. The X and Y values will become zero establishing the geometric center point of the feature as the part datum point.

In this example, the geometric center point of circle 1 was set to zero and will serve as the part datum point for subsequent measurements.

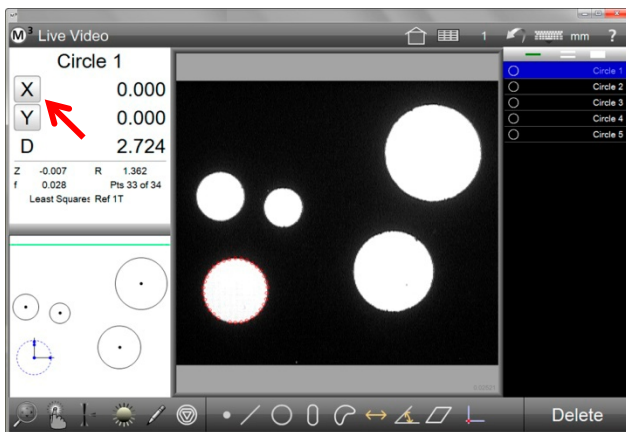

***X and Y set to zero in the DRO viewport***

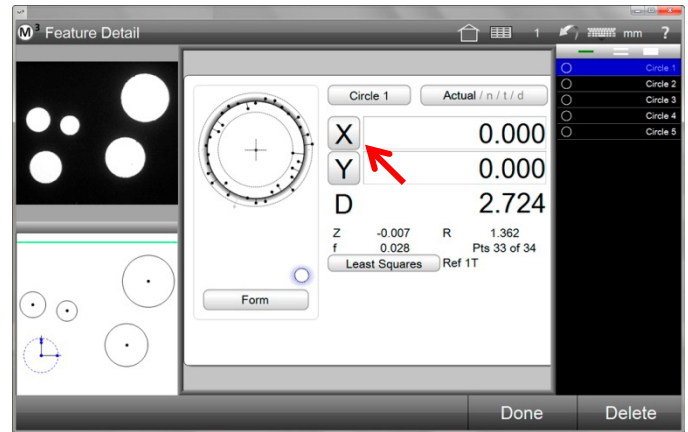

***X and Y set to zero in the Feature Detail screen***



## Rotating and Offsetting a Reference Frame

 
The M3 reference frame can be rotated and offset to accommodate custom measurement applications.

### *Rotating the Measurement Reference Frame*

The measurement reference frame can be rotated about the part datum in clockwise or counterclockwise directions and in angular increments as small as one second or 1/1000 of a degree depending on a unit of measure being used. To rotate the measurement reference frame:


- 1 Press the Rotate Coordinates button of the Datum menu

**Measure toolbar > Datum menu > Rotate coordinates button**




- 2 Enter the desired angular rotation value into the Angle field. Clockwise angles are positive, and counterclockwise angles are negative.
- 3 Press the done button to complete the reference frame rotation. A rotation feature will be added to the Feature List.

**Measure toolbar > Done button**

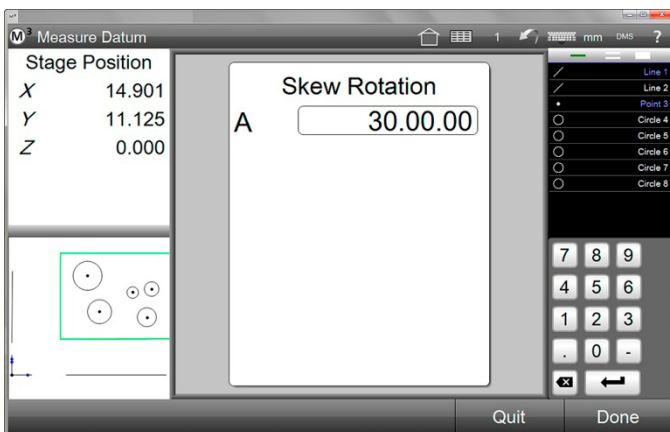

*Enter the desired rotation angle and press Done*

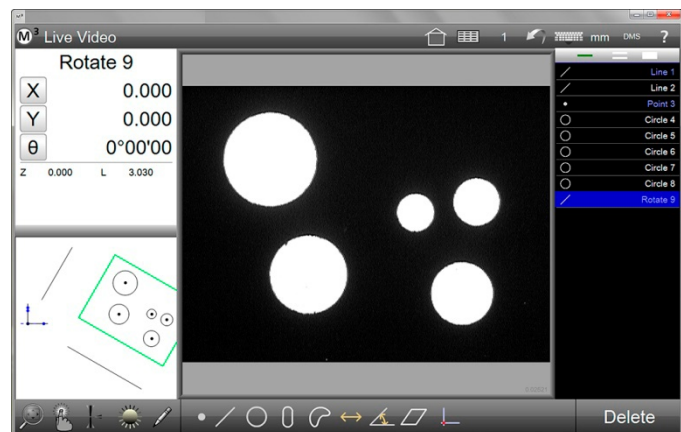

*Reference frame rotated*

To reset the reference frame to the original rotation:

- 1 Delete the rotation feature from the Feature List.
- 2 Repeat the process described above but enter a skew rotation equal in value but opposite in polarity to the initial Skew Rotation value.

3

### *Offsetting the Skew Alignment*


The skew alignment can be offset from the X or Y coordinates by increments as small as one micron or 1/10,000 of an inch depending on the unit of measure being used. To offset the part skew alignment:

- 1 Measure two features that will determine the skew offset. Make a note of the X and Y values of each feature. These features will be referred to as Feature #1 and Feature #2 in this procedure. During the procedure, the user will specify offsets from these two features to the skew axis. The system will then construct a line between the two features which will be used as the new part skew alignment.
- 2 Press the Offset Skew button of the Datum menu

**Measure toolbar > Datum menu > Offset Skew button**



# Video Inspection Software User's Guide

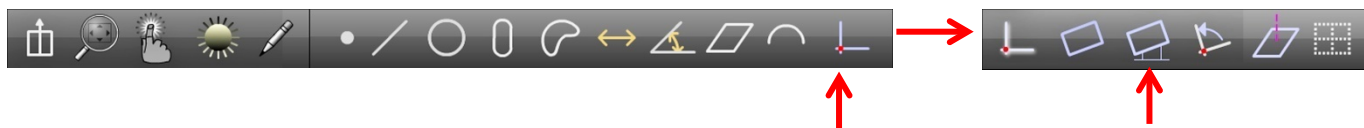


- 3 Select an alignment axis from the Axis drop-down list. In the next step, offsets will be specified extending from the two features previously measured to this axis. In this example the X axis was selected.
- 4 Enter the desired skew offsets from Feature #1 and Feature #2 to the selected axis in the same order in which the features were measured. These offsets are the distances from the geometric centers of the features to the selected axis.
- 5 Press the Done button to complete the skew offset value entry. The system will proceed to the measure mode.


## Measure toolbar > Done button

- 6 Select Feature #1 and Feature #2 in the Feature List in the same order in which they were measured and then press the Done button. The offsets entered in the previous step will be applied to the features and a new offset part skew will be created by the system. An offset feature will also be added to the Feature List.

## Measure toolbar > Done button

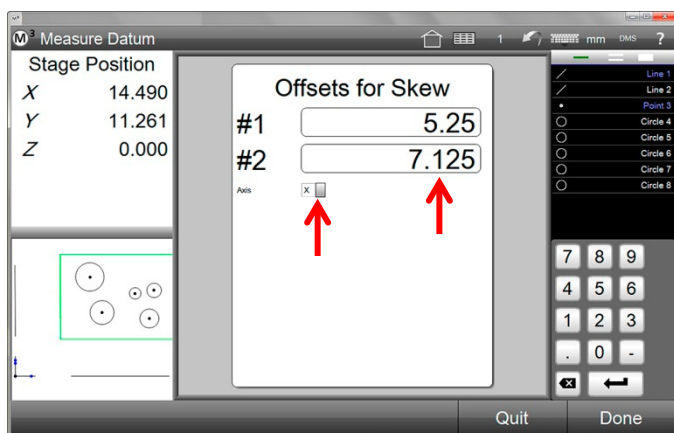

Select a skew axis and enter offsets

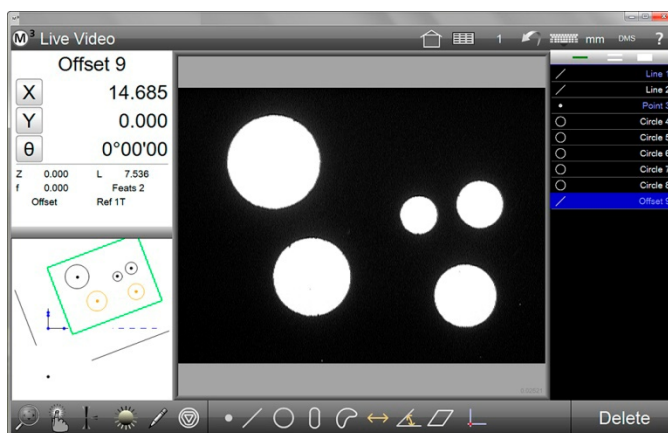

The skew alignment will be offset

To reset the part skew to its original orientation:

- 1 Delete the offset feature from the Feature List.
- 2 Repeat the process described above but enter the original X or Y value offset of Feature #1 and Feature #2 noted from step 1.

## Managing Multiple Reference Frames

The M3 system supports multiple reference frames as follows:

- By default, while several reference frames can be created during a measurement session, the reference frames are not automatically saved, and all measurements will be referred to the last reference frame created (the current reference frame).
- When multiple reference frames are created and then saved, either manually or automatically, measurements will be referred to their own reference frames.
- Reference frames are identified in the small Feature Detail viewport, in the large Feature Detail screen that appears in the center viewport and in the System toolbar or Extra menu when the Reference Frame button is enabled in the Desktop Settings screen.
- Saved reference frames and their related measurements are displayed with color coded bars in the Feature List and in the System toolbar.

# Video Inspection Software User's Guide

- Measurements can be temporarily unlocked from saved reference frames by the user. Unlocked measurements are no longer referred to their own reference frames and will be referred to the current reference frame. Measurements can be relocked to their saved reference frames later by the user.
- All reference frame operations will become part of recorded programs and can be played back later. However, no new reference frame creation is permitted in the program edit mode.

## Unsaved Reference Frames

As mentioned earlier, by default, reference frames are not saved automatically and while several reference frames might have been created, all measurements will be referred to the last reference frame created (the current reference frame). Reference frames created earlier cannot be saved later, only the last reference frame can be saved.

## Saving Reference Frames


Reference frames can be saved manually by the user or automatically by the system. In either case, measurement results are associated with their own reference frames. However, saving a reference frame manually requires a user operation and relies on the user to remember to do it. Saving reference frames automatically eliminates these issues.

To save a reference frame manually:

- 1 Confirm that the Reference Frame button is shown in the Extra menu or in the System toolbar. If it is not, configure the button in the Desktop Settings screen.

**System toolbar > System menu > Desktop Settings screen > Reference Frame button > Desktop or Extra**

- 2 After the creation of one reference frame, and before the creation of another, long-press the Reference Frame button. The reference frame indication will change from temporary (1T) to permanent (1), indicating that the reference frame was saved and a color-coded bar will appear in front of the datum and associated feature measurements.

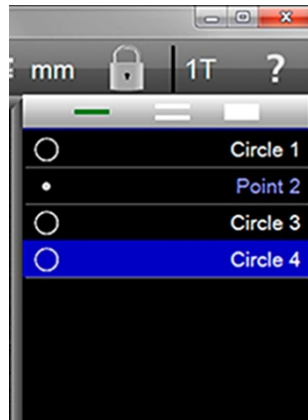

Reference frame button is 1T



Reference frame button is changed to 1

To save a reference frame automatically:

- 1 Set Automatically Save UCS (Universal Coordinate System) to yes in the Measure Settings screen.

**System toolbar > System menu > Measure Settings screen > Automatically Save UCS > Yes**

When the reference frame is saved automatically, the observed behavior of the system is the same as shown above except that no user intervention is required to save any reference frame.

## Locking and Unlocking Features from their Reference Frames

Feature measurements can be locked or unlocked from saved reference frames by the user. Unlocked measurements are no longer referred to their own reference frames and will be referred to the current reference frame. To lock or unlock feature measurements:

- 1 Confirm that the Feature Lock button is shown in the Extra menu or in the System toolbar. If it is not, configure the button in the Measure Settings screen.


**System toolbar > System menu > Measure Settings screen > Feature Lock button > Desktop or Extra**

- 2 The default condition of the Feature Lock button is locked. Press the Feature Lock button to toggle between locked and unlocked.




## Registration Datum

A registration datum can be used to accommodate some parts that have significant manufacturing variability with large positional tolerance, to have flexibility during program execution. Registration datum is created from a positional feature (point arc circle). It adjusts the playback of features that follow to maintain their positional relationship from this feature as measured. The registration datum acts like a datum, without modifying the measured results like an ordinary datum does. The registration datum feature is not a measurement datum. During program playback the difference between the freshly measured actuals, and the feature nominals will be used as an offset to the existing registration frame. The registration datum can also be used to cause "registration complete", which completes the registration requirement for program execution.

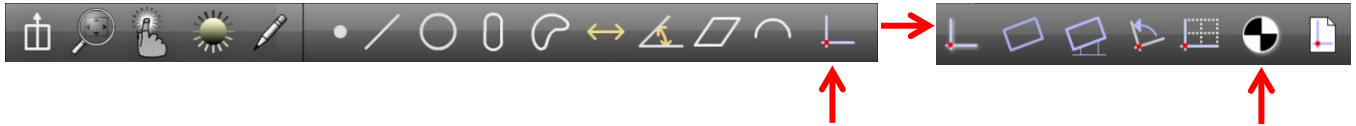

To record a registration datum:


- 1 Perform a part skew and datum. Then measure several features. Measure a position feature to be used for registration datum.
- 2 Press the Registration datum button, then select the positional feature.
- 3 Press Done to complete the datum registration.
- 4 Continue measuring more features as desired.

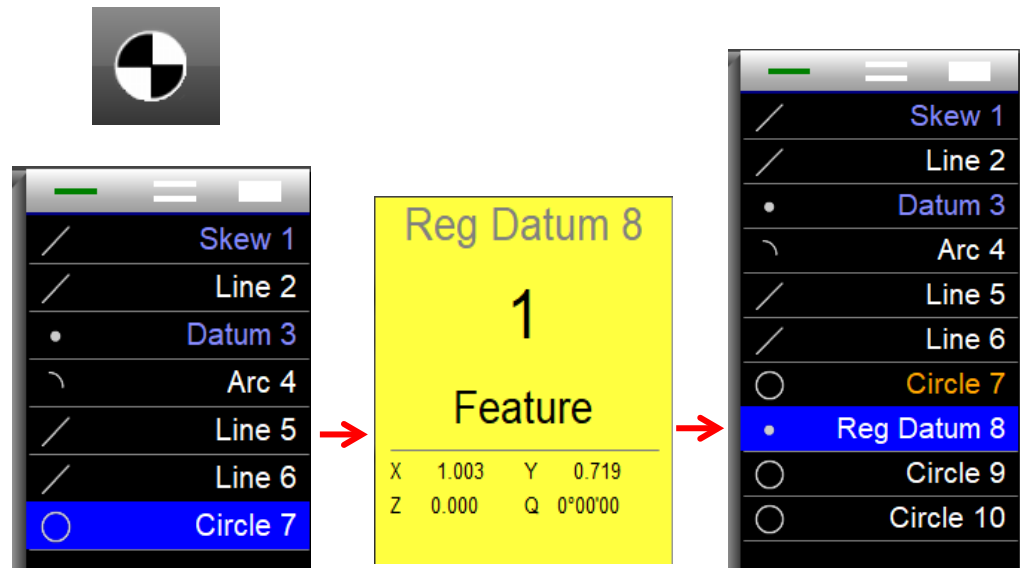

In this example, Circle 9 and 10 data cloud will be based on the Reg Datum 8 feature.

## Saving and loading reference frames to and from a file



Reference frames can be saved to a file. These saved reference frames can then be recalled into a new part program and used for fixturing.

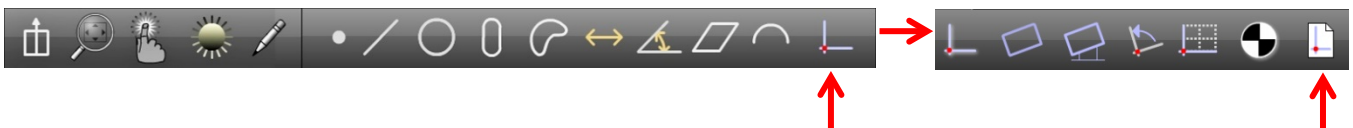

To save a reference frame to file:

- 1 Define a reference frame by measuring a skew and datum on a part.
- 2 Press the Save reference frame to file button in the datuming menu. Safe reference frame dialog is displayed.
- 3 Enter the reference frame filename in the prompt and then press the Save button to save the file and close the dialog.

# Video Inspection Software User's Guide

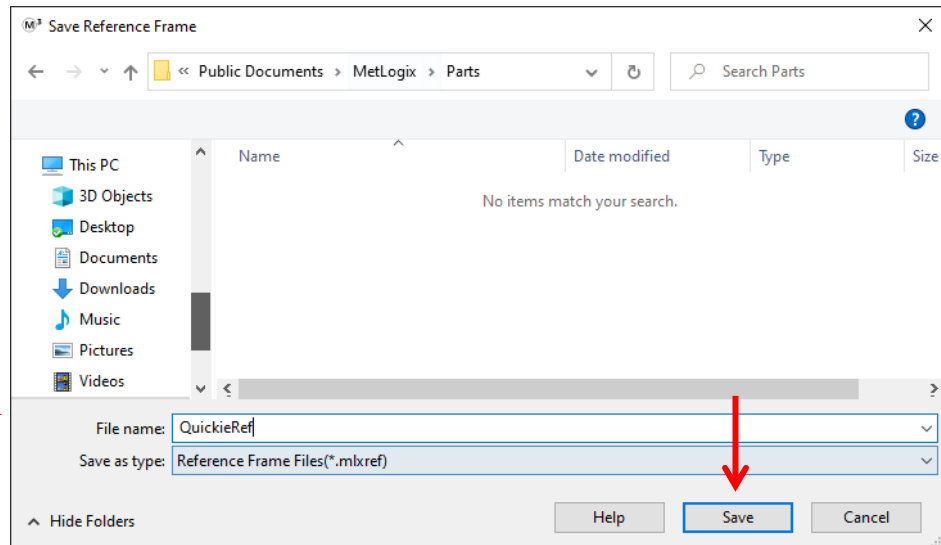
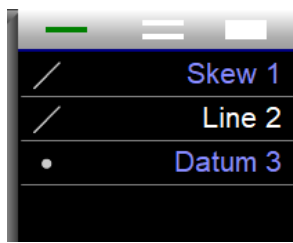


A message is displayed to confirm that the reference frame file was successfully saved.

To load (recall) a saved reference frame from file into a program:

- 1 Start a new part.
- 2 Press the Recall reference frame from file button in the datuming menu. Recall reference frame dialog is displayed.
- 3 Select the desired reference frame file from the list, then click the Open button.

The reference frame file has been successfully saved.

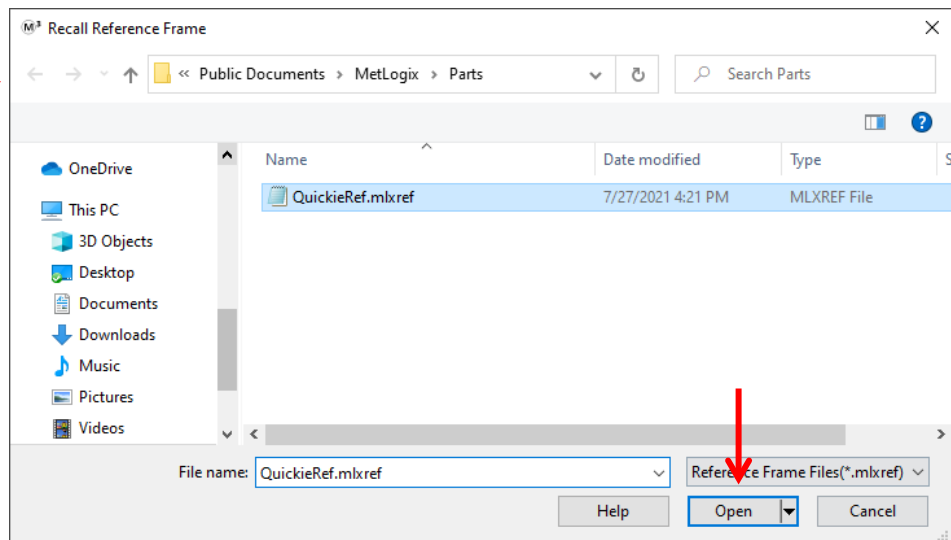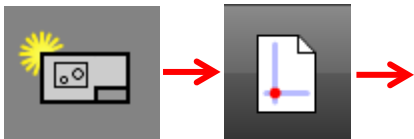

A message is displayed to confirm that the reference frame file was successfully loaded. Subsequent features that depend on the loaded reference frame can be measured into the program.

The reference frame file has been successfully loaded.



## NOTE

*A program with a loaded reference frame will have fixturing mode of "File" and the part will be registered.*

## Section 8: Tolerancing

Tolerances are applied to the feature measurements in the Feature Detail screen. While some tolerances are independent of a reference frame, typically tolerances are applied after a valid reference frame has been established. Tolerances can be applied to measured and constructed features. Each feature type has a specific set of tolerances that can be applied. Tolerances can be applied to features interactively or as part of program editing and are included in part programs for playback later. Tolerance status is indicated by color in the Feature List, Part View, Feature Detail screen and in the Report screen. Tolerance failures are displayed in red.

Tolerances can be applied to single features or to a group of like features. Nominal values for tolerances can be entered by the user or imported from DXF drawing files. Tolerances can be applied on a feature-to-feature basis, or by using the place tolerancing system. Engineering drawings might indicate that all features reported to two significant digits will receive one tolerance value while other features reported to three significant digits will receive another. The M3 software supports the application of universal tolerance values according to these tolerance groupings.

### Supported Tolerances

Tolerances supported by the M3 system are shown in the table below.


Angle (theta)		Angle, Line, Pattern
Angularity		Angle
Area		Blob
Circumference		Blob
Concentricity		Circle, Cylinder
Cylindricity		Cylinder
Diameter		Arc, Circle
Flatness		Plane
Form		Rectangle, Slot, Cone
Length		Blob, Distance, Rectangle, Slot
Parallelism		Line, Plane
Perpendicularity		Line
Radius		Arc
Roundness		Circle
Runout		Circle
Sphericity		Sphere
Straightness		Line
Symmetry		Line
Taper		Cone
True position		Arc, Circle, Point, Rectangle, Slot, Sphere, Cylinder, Cone
Width		Blob, Rectangle, Slot
X position		Plane
Y position		Plane
Z position		Plane
XY position		Arc, Blob, Circle, Line Rectangle, Slot, Cylinder, Cone, Pattern
XZ position		Arc, Circle, Line Rectangle, Slot, Cylinder, Cone
YZ position		Arc, Circle, Line Rectangle, Slot, Cylinder, Cone
XYZ position		Distance, Point Sphere

## Applying Tolerances to a Single Feature

The process of applying tolerances to features is nearly identical for all feature types, only the tolerance type and the entry of nominal values are different. The four methods of entering nominal values and applying tolerances include:

- Enter nominal values using keypad
- Auto round actual values
- Enter values with keypad or auto round and then use place tolerancing
- Import nominal values from a DXF drawing file

The four methods are diagrammed here. The differences between these methods are shown in shaded blocks. The contents of each block will be explained in detail. The blocks that are common to all processes will be explained as part of an example of tolerancing a circle. The blocks that are unique in each process will be explained separately.

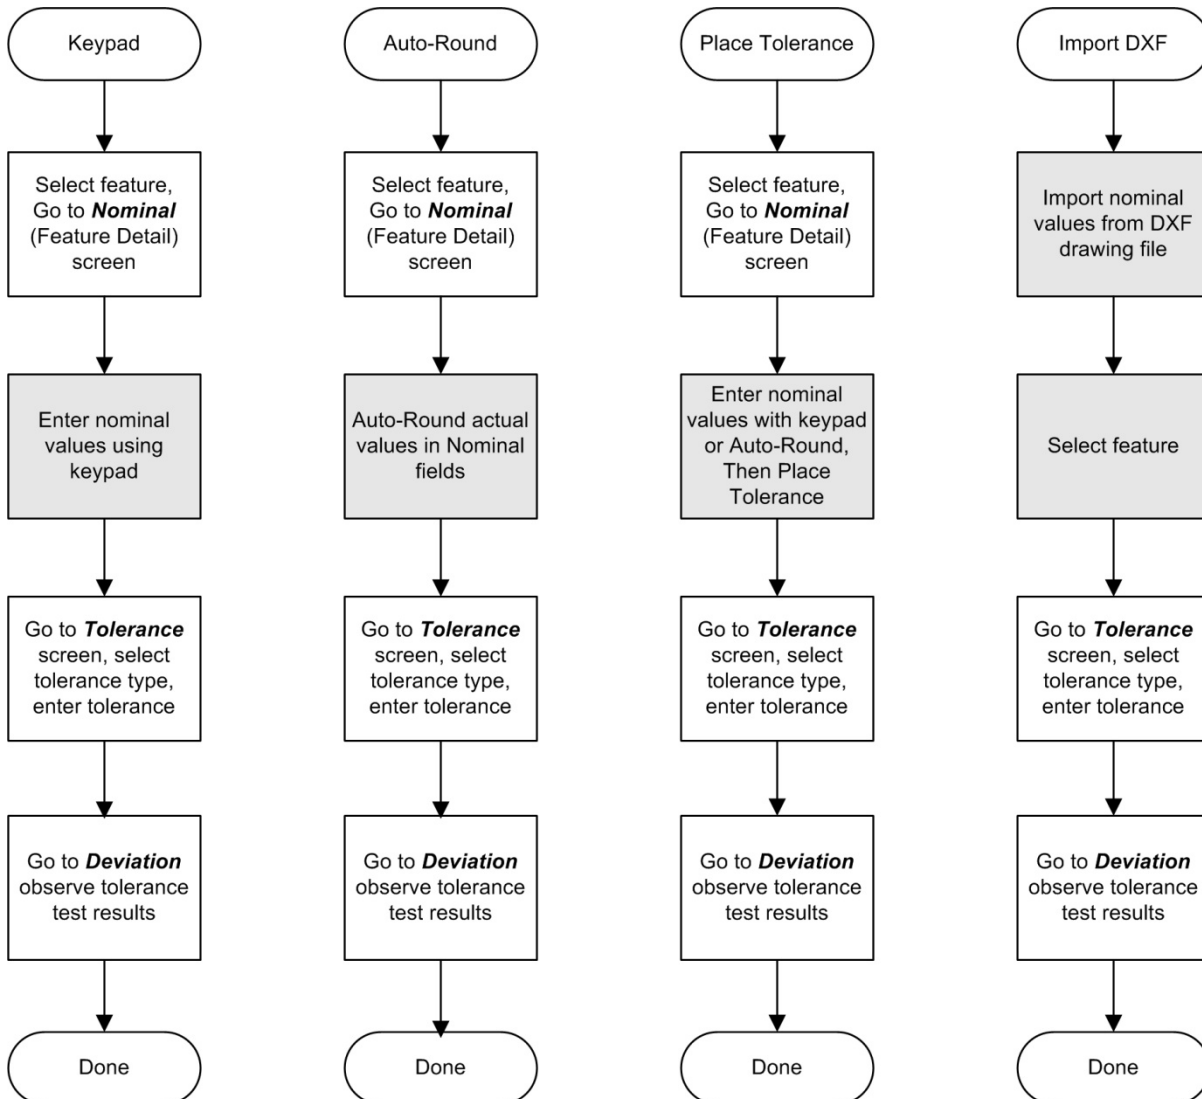

### NOTE

*Tolerances can also be applied using the Quick Tolerance functions discussed at the end of this section.*



## ***Keypad Entry of Nominal Values***

In all cases the first step of the tolerancing process is navigating to the Nominal Feature Detail screen and will only be shown once. This example shows nominal values entered using the keypad and tolerances being applied to a circle.


### ***Select Feature and go to the Nominal Feature Detail screen***

To select a feature and go to the Nominal screen:


- 1 Select the desired feature from the Feature List and press in the small Feature Detail viewport to display the Feature Detail screen in the center viewport. Actual feature measurement values will be shown.
- 2 Press the Actual button to go to the Nominal screen.



*Select a feature and press in the small Feature Detail viewport*

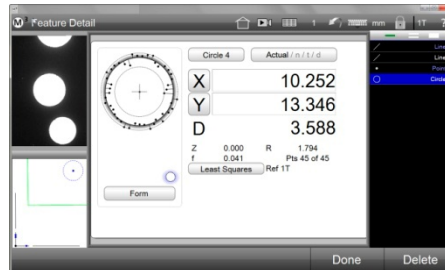

*Press the Actual button*

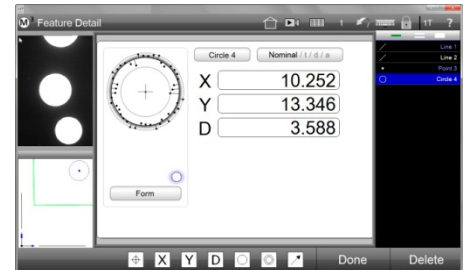


*The Nominal screen is displayed*


### ***Enter Nominal Values using the Keypad***

To enter nominal values:

- 1 Press in a nominal value field. The field will become blue and the keypad will appear. Enter the nominal values for each field.

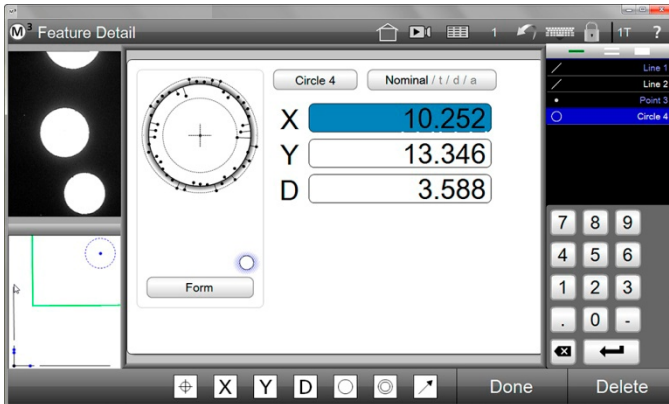

*Press in a nominal field*

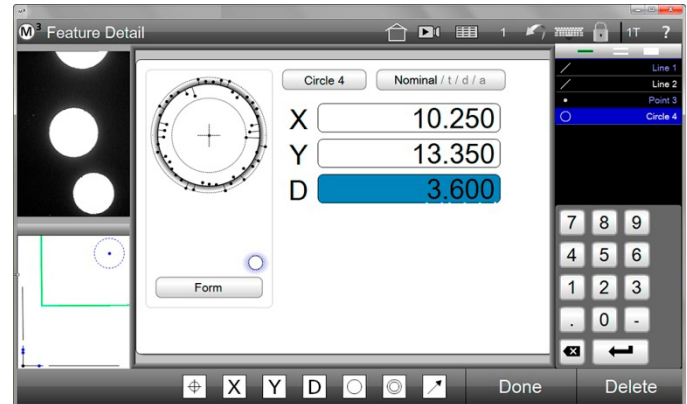

*Enter nominal values using the keypad*

### ***Go to the Tolerance Screen, Select and Enter Tolerance***


To select and enter tolerances:

- 1 Press the Nominal button of the Nominal Feature Detail screen to display the Tolerance screen.
- 2 Select the desired tolerance type.


**Measure toolbar > Desired tolerance button**

- 3 Press in a tolerance field. The field will become blue and the keypad will appear. Enter the desired tolerance values into the tolerance fields.

# Video Inspection Software User's Guide

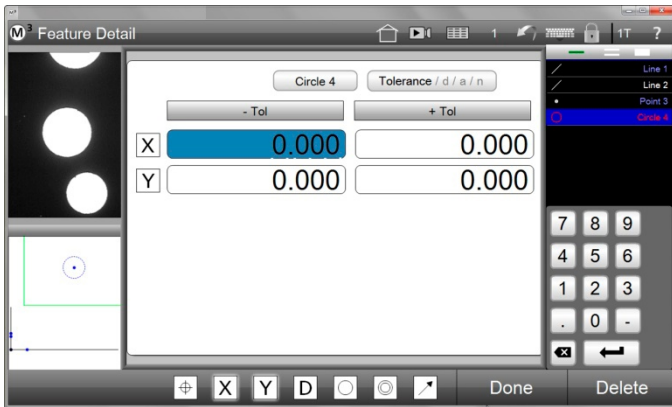

Select a tolerance type and press a data field

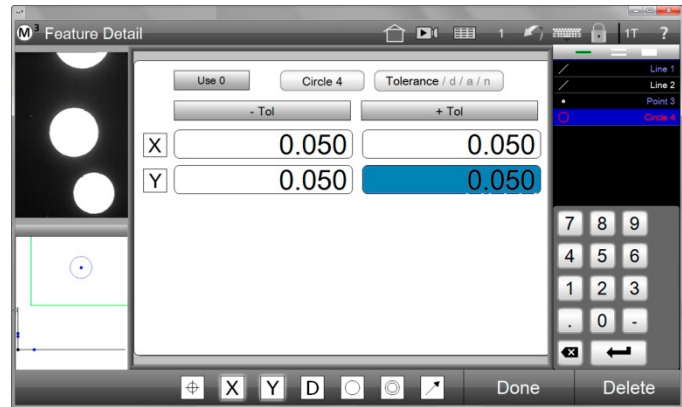


Enter tolerance values using the keypad

## Go to the Deviation Screen to Observe Results

To observe the results of tolerance tests:

- 1 Press the Tolerance button of the Tolerance Feature Detail screen to display the Deviation screen. Tolerance results and the applied tolerances will be displayed numerically and graphically.
- 2 Press the Done button to return to the Home view.

**Measure toolbar > Done button**

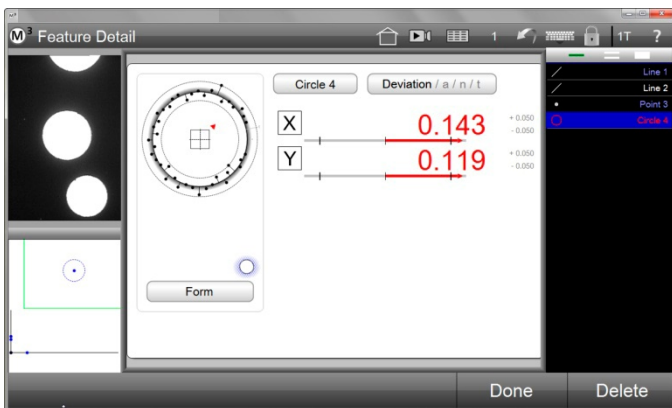

Tolerance results are shown on the Deviation screen



Failed tolerances are shown in red

Failed tolerances will be shown in red in the Feature List, Part View, Part Detail screen and on the Report screen.


## Entering Nominal Values using Auto-Round

Auto-rounding can often save time when repetitively entering nominal feature data. Often measured values are close to blueprint nominal values. Using Auto-rounding, the nominal values for each coefficient of a feature can quickly be rounded up or down to match the nominal values on engineering drawings. To enter nominal values using Auto-rounding:


- 1 Once a feature has been selected in the Feature List, navigate to the Nominal Feature Detail screen as described earlier.
- 2 Press in a nominal field. The field will become blue and the keypad will appear.
- 3 Press the digit that you would like to round. In this example, the second digit to the right of the decimal point was pressed which rounded the last two digits from 16 to 20. The digit selected will cause rounding either up or down based on the value of the digit to its immediate right.




# Video Inspection Software User's Guide

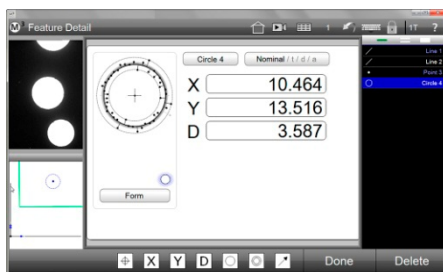

*Navigate to the Nominal screen*

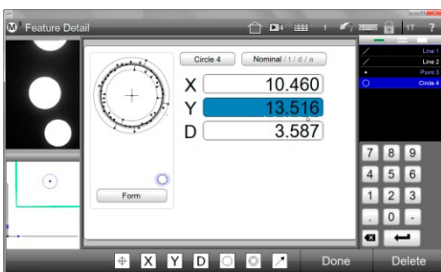

*Press in a nominal value field*

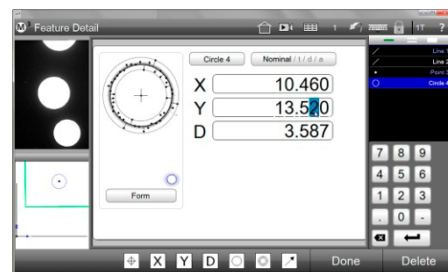

*Press and hold the digit to round*

- 4 To make adjustments up or down to any rounded digit, press and hold it down and then slide your finger or mouse pointer downward off the digit. Do not release your finger or the mouse cursor. This will select the digit place to be incremented or decremented.
- 5 Slide your finger or mouse pointer to the left to increase the value or to the right to decrease the value, and then release your finger or mouse cursor.

## ***Entering Nominal and Tolerance Values using Place Tolerancing***

The place tolerancing method uses tolerance information found in the detail block of an engineering drawing. The detail block specifies tolerance values to be used for drawing features based on the number of decimal places reported for the feature. This example shows how a detailed block might appear on a drawing.

.X	+/- 0.1"
.XX	+/- 0.01"
.XXX	+/- 0.001"

The example indicates that if a feature coefficient includes two decimal places, a tolerance of  $\pm 0.01$  should be applied.

The M3 system provides a place table for the user to include decimal place information from drawing detail blocks. This table is used in the place tolerancing method to apply detail block tolerances automatically to features measured by the M3 system.

To perform place tolerancing:

- 1 Confirm that the Enable Tolerance Places field in the Measure Settings screen is set to Yes.  
**System toolbar > System menu > Measure settings screen > Place Tolerancing > Yes**



### ***NOTE***


***If you wish to apply the same decimal place information to all new M3 measurement sessions, confirm that the Tolerance Places Data on New Part is set to Keep in the Measure settings screen.***

***System toolbar > System menu > Measure settings screen > Tolerance Places Data on New > Keep***


- 2 Navigate to the Nominal Feature Detail screen as described earlier.
- 3 Press the Place Table button to display the Place Table.

**Measure toolbar > Place Table button**

# Video Inspection Software User's Guide

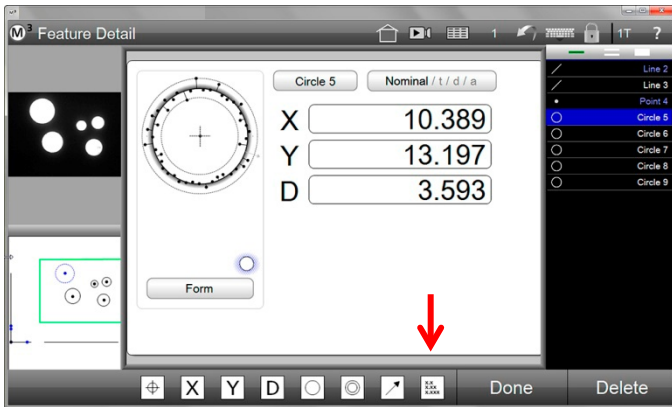

**Press the Place Table button**

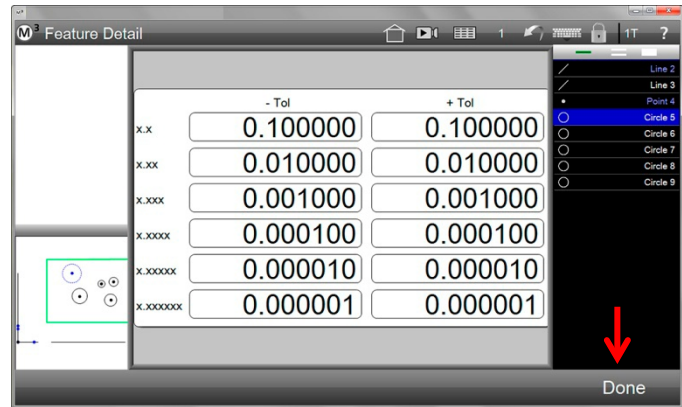


**Place table values**

- 4 Modify the values of the place table to represent the values found in the detail block of your engineering drawing if required, then press the Done button to return to the Feature Detail screen.


## **Measure toolbar > Done button**

- 5 Navigate back to the Nominal Feature Detail screen if necessary, and enter the nominal values using one of the methods described earlier. Click the non-significant digits in each field to apply the Place Table values. Non-significant digits will become gray to indicate that the values have been applied. Press the Done button to conclude this process.

## **Measure toolbar > Done button**

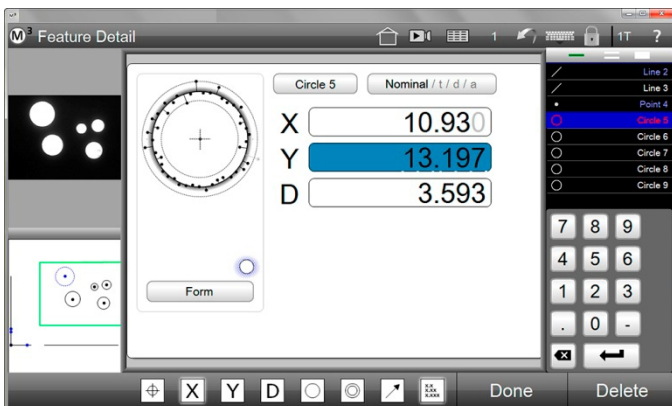


**Enter nominal values**

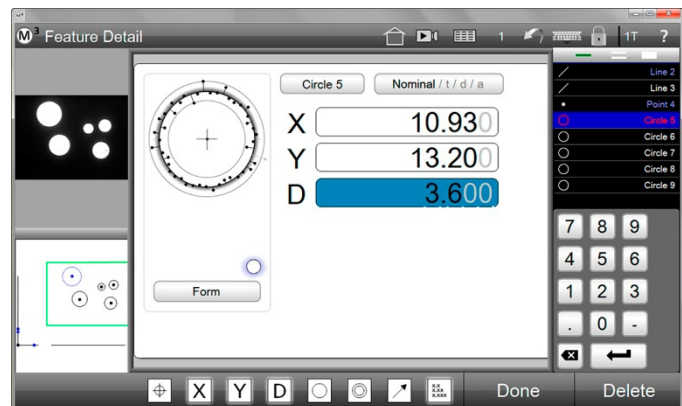


**Press non-significant digits**

- 6 Press the Nominal button to go to the Tolerance Feature Detail screen. Tolerances from the Place Tolerance table will have been applied.
- 7 Press the Tolerance button to go to the Deviation Feature Detail screen and observe the results of the tolerance tests.

# Video Inspection Software User's Guide

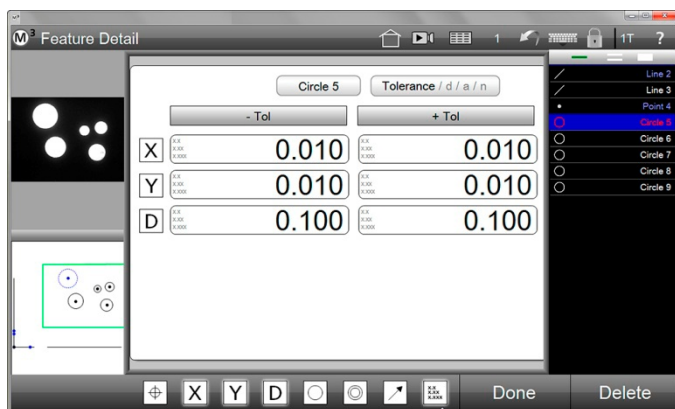

*Place Table tolerances applied*

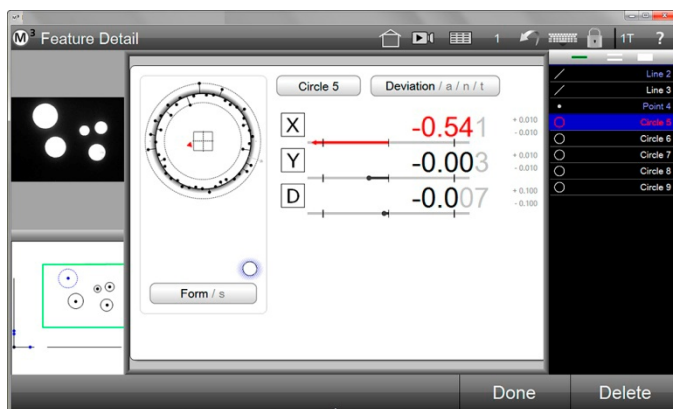


*Tolerance results*

## ***Importing Nominal Values from a DXF Drawing File***


Nominal values for part features can be imported directly into the nominal data fields from a DXF drawing file, eliminating the need to do manual nominal data entry. Nominal values can be imported for single feature or group feature tolerancing. To import nominal values from a DXF file:

- 1 Press the Report button to display the Report screen and Report toolbar.

**System toolbar > Report button**

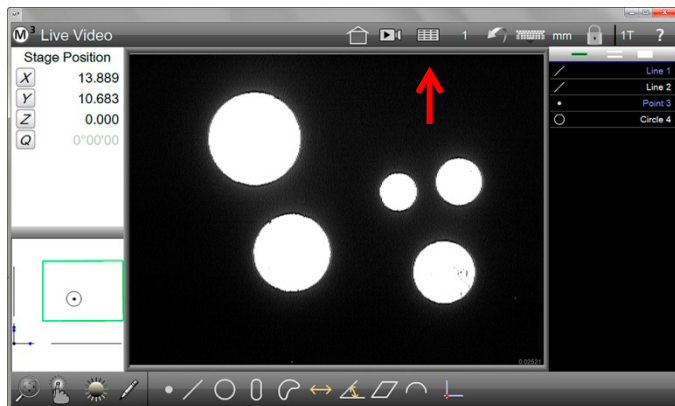

*Press the Report button*

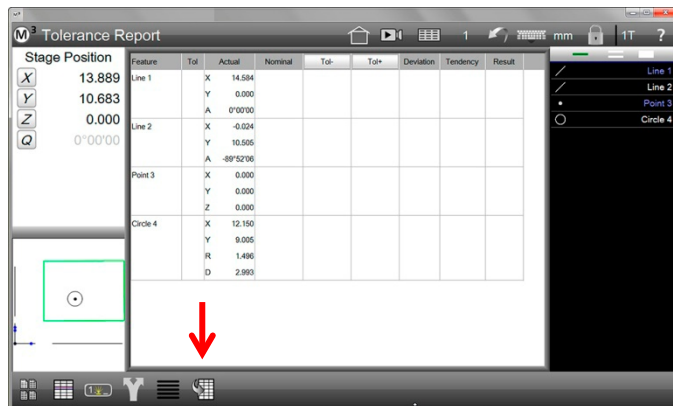


*Press the Import DXF button*

- 2 Press the Import DXF button to display the DXF Import dialog.


**Report toolbar > Import DXF button**

- 3 Select and open the desired DXF part drawing file. Nominal values will be shown for part features in the Report screen.

# Video Inspection Software User's Guide

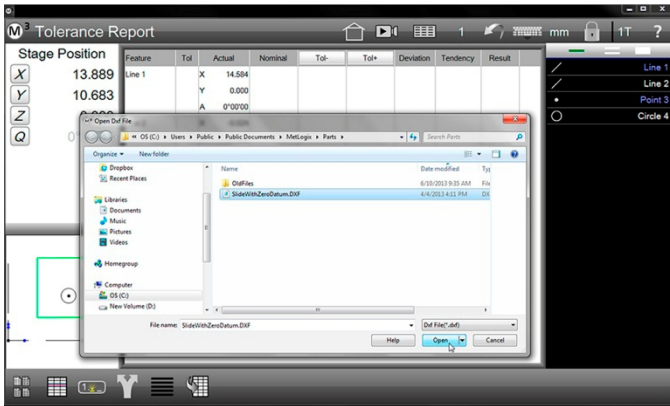


**Open the DXF drawing file**

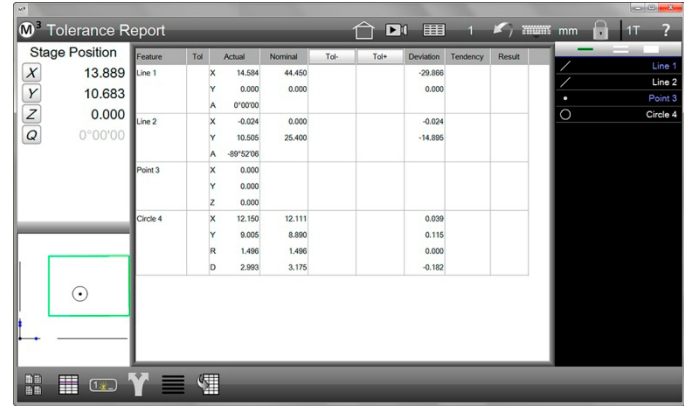

**Nominal values will be imported**

- 4 Select a feature from the Feature List and navigate to the Nominal Feature Detail screen to confirm the presence of nominal values.
- 5 Proceed to the Tolerance Feature Detail screen to enter tolerance values.

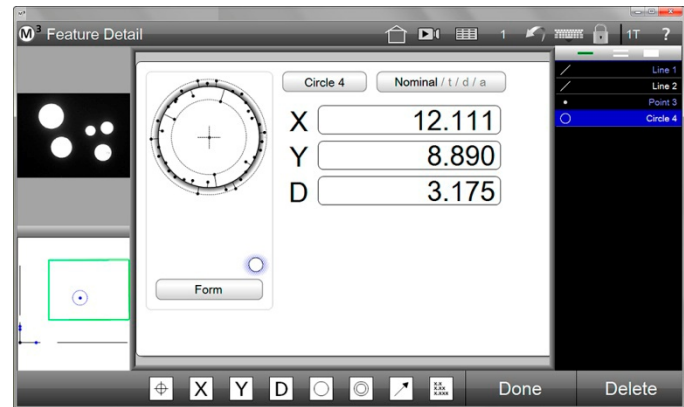


**Nominals are present**


## Applying Tolerances to a Group of Features

Only a group of like features can be toleranced as a group. The following example demonstrates applying a tolerance to a group of circles. To tolerance a group of like features:

- 1 Select the desired group of like features using any of the methods described earlier in this guide.
- 2 Press the small Feature Detail viewport to display the large Feature Detail screen in the center viewport.

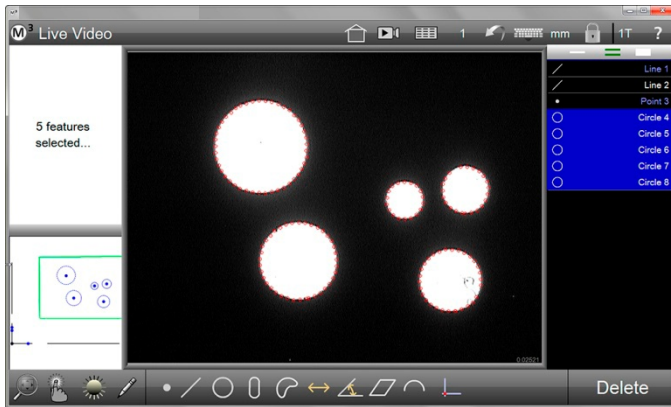


*Select a group of like features*

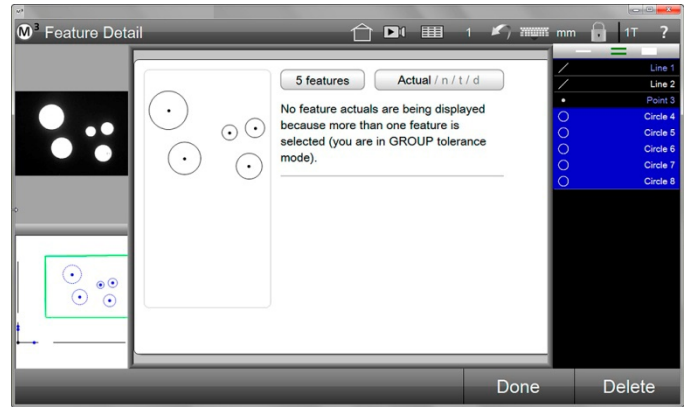


*The Feature Detail will indicate group tolerancing*

- 3 Navigate to the Tolerance screen and select the desired tolerance type. Circularity is selected in this example.
- 4 Enter the tolerance value and press the Done button. Group tolerance results will be shown in the Deviation screen.

**Measure toolbar > Done button**

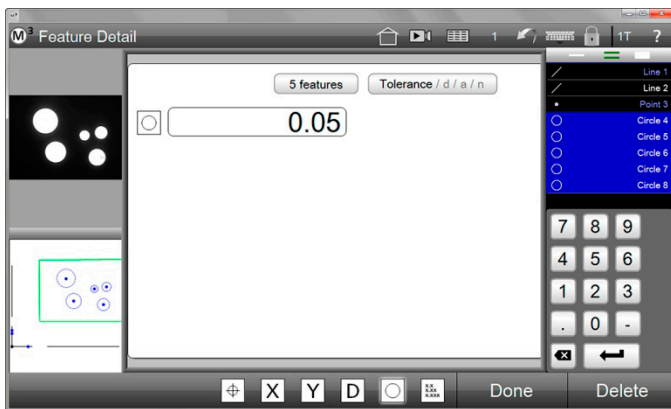

*Select a tolerance type and enter the value*

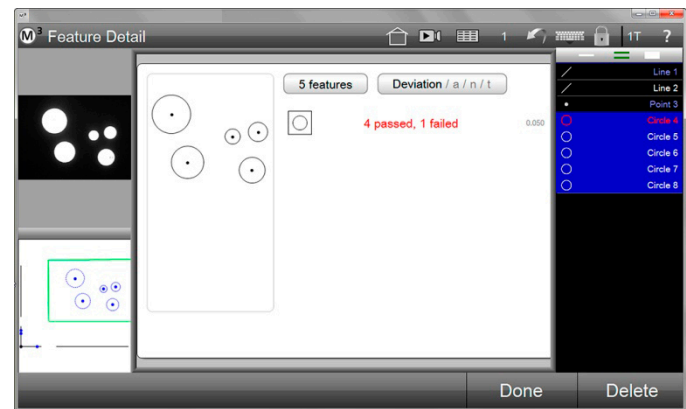

*Group results are shown in the Deviation screen*

## Quick Tolerance Functions

Quick tolerance functions are available in the interactive and program editing modes to reduce the time required to apply nominal and tolerance values to feature coefficients.

Preset quick tolerance values are provided in the Report toolbar when the Edit Cells function is enabled in the measuring or program editing modes. Up to 5 preset values can be configured by the user to best support tolerance activities for the current measurement session. Simple numeric and angular (degrees, minutes, seconds) values can be included.


- 1 Edit Cells
- 2 Preset tolerance values



## Configuring Preset Tolerance Values

To configure quick tolerance preset values:

- 1 Display the Measure Setting screen and scroll to the Quick Tolerance preset fields. Enter the desired values.  
**M3 Menu > Settings > Measure button**

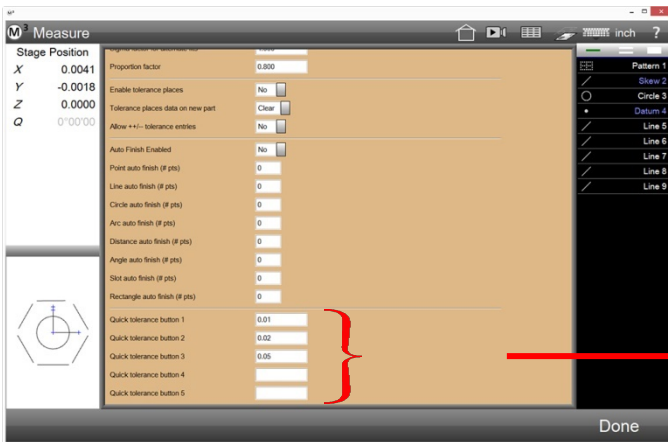

*Measure Settings screen*



*Quick Tolerance preset value fields*



### NOTE

Angles are entered in the format:  
**DD.MM.SS**



## Accessing the Quick Tolerance Functions

Quick tolerance functions are available in the Measure and Program Edit modes.


### Interactive Mode

To apply quick tolerances before completing a measurement session and part program:


- 1 Press the Report button to display the Report screen and then press the Edit Cells button to display the editable cells.

**System toolbar > Report button**

**Report toolbar > Edit Cells button**

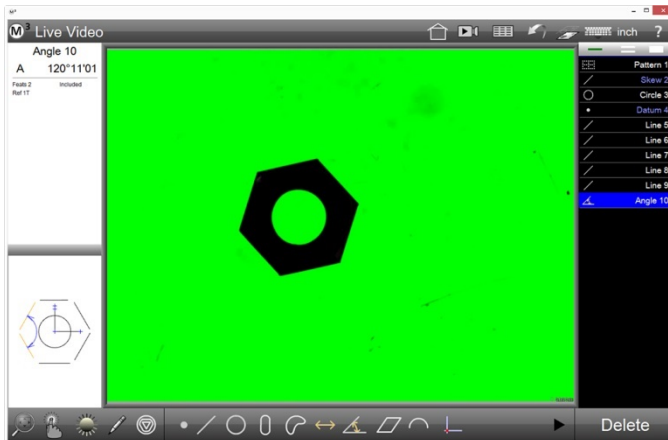

From measure mode, press the Report button

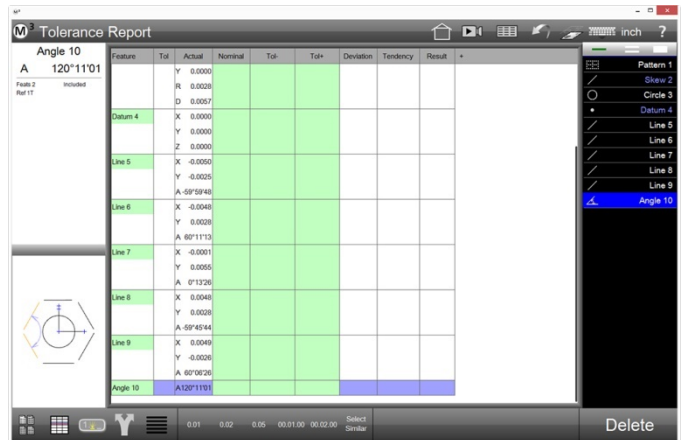

Press the Edit Cells button



### Program Edit Mode

To apply quick tolerances from the edit mode after completing a part program:

- 1 Press the Edit tab, select a feature in the Feature List and then press the Edit Cells button.

**Feature List > Edit tab > Select feature**

**Report toolbar > Edit Cells button**

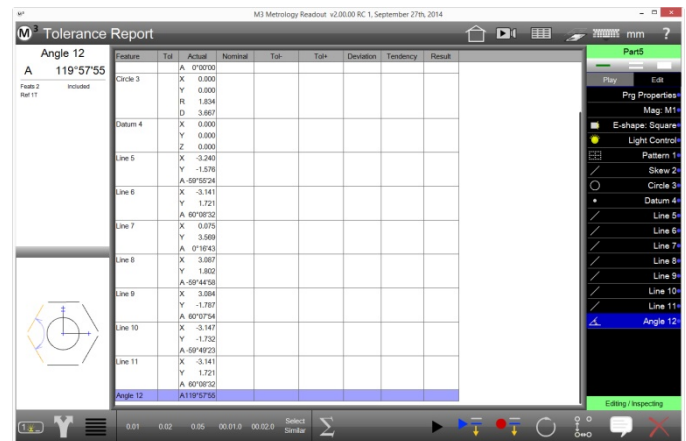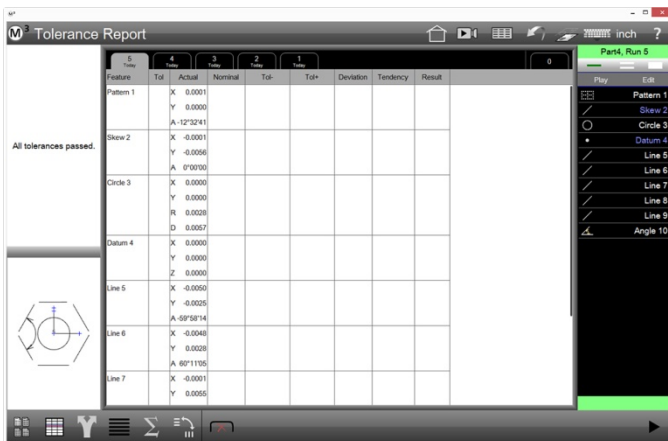

## Applying Quick Tolerances

Nominal values and tolerances can be applied to individual feature coefficients, or to multiple feature coefficients with identical nominal or tolerance value requirements.

## Applying Nominal Values and Tolerances to Individual Coefficients

To apply nominal and tolerance values to individual feature coefficients:

- 1 Press the single feature selection tool.  
**Feature List > Single Select bar**
- 2 Press a nominal cell and enter the required coefficient nominal value.
- 3 Press Enter to advance to the first tolerance cell for this feature coefficient and press a preset tolerance value to enter it into the cell.

**Report toolbar> Preset tolerance**



Feature	Tol	Actual	Nominal	Tol-	Tol+	Deviation	Tendency	Result
Circle 3	A	0°00'00						
	X	0.000						
	Y	0.000						
	R	1.837						
Datum 4	D	3.674						
	X	0.000						
	Y	0.000						
	Z	0.000						
Line 5	X	-3.103	-3.10					
	Y	-1.820						
	A	-60°09'17						
Line 6	X	-3.066						
	Y	1.871						
	A	59°48'04						
Line 7	X	-0.053						
	Y	3.577						
	A	-0°04'29						

Feature	Tol	Actual	Nominal	Tol-	Tol+	Deviation	Tendency	Result
Circle 3	A	0°00'00						
	X	0.000						
	Y	0.000						
	R	1.837						
Datum 4	D	3.674						
	X	0.000						
	Y	0.000						
	Z	0.000						
Line 5	X	-3.103	-3.100	0.020	0.000	-0.003		Fail
	Y	-1.820						
	A	-60°09'17						
Line 6	X	-3.066						
	Y	1.871						
	A	59°48'04						
Line 7	X	-0.053						
	Y	3.577						
	A	-0°04'29						

- 4 Press Enter again to advance to the next tolerance cell and press a preset tolerance value.

**Report toolbar > Preset value**

- 5 Press Enter to finish this feature coefficient.

Feature	Tol	Actual	Nominal	Tol-	Tol+	Deviation	Tendency	Result
Circle 3	A	0°00'00						
	X	0.000						
	Y	0.000						
	R	1.837						
Datum 4	D	3.674						
	X	0.000						
	Y	0.000						
	Z	0.000						
Line 5	X	-3.103	-3.100	0.020	0.020	-0.003		Pass
	Y	-1.820						
	A	-60°09'17						
Line 6	X	-3.066						
	Y	1.871						
	A	59°48'04						
Line 7	X	-0.053						
	Y	3.577						
	A	-0°04'29						

Feature	Tol	Actual	Nominal	Tol-	Tol+	Deviation	Tendency	Result
Circle 3	A	0°00'00						
	X	0.000						
	Y	0.000						
	R	1.837						
Datum 4	D	3.674						
	X	0.000						
	Y	0.000						
	Z	0.000						
Line 5	X	-3.103	-3.100	0.020	0.020	-0.003		Pass
	Y	-1.820						
	A	-60°09'17						
Line 6	X	-3.066						
	Y	1.871						
	A	59°48'04						
Line 7	X	-0.053						
	Y	3.577						
	A	-0°04'29						



## Applying Nominal Values and Tolerances to Multiple Feature Coefficients

Identical nominal values and tolerances can be applied to multiple feature coefficients.

### Applying One Nominal Value to Multiple Coefficients

 
To apply the same nominal value to multiple feature coefficients:

- 1 Press the multi-feature selection tool

**Feature List > Multi-Select bar**

- 2 Press the first of a collection of feature coefficient nominal cells that will contain the same nominal value and then enter the value. In this example 4 Identical Circle diameters have a nominal value of 2.460 mm.
- 3 Press the remaining feature coefficient nominal cells in the collection and then press Enter. The nominal value will be entered into all the cells and the first tolerance cell of the collection of coefficients will be highlighted. Press a preset tolerance value to enter a tolerance into the first tolerance cell of the collection.

**Report toolbar > Preset value**



Feature	Tol	Actual	Nominal	Tol-	Tol+	Deviation	Tendency	Result
		Y -5.652 A 90°00'00						
Circle 2		X -5.772 Y -5.728 R 1.229						
	D	D 2.458	2.460					
Circle 3		X -0.510 Y -4.306 R 1.229						
	D	D 2.457						
Circle 4		X 4.218 Y -5.729 R 1.229						
	D	D 2.458						
Circle 5		X 6.703 Y 1.000 R 1.230						
	D	D 2.461						

Feature	Tol	Actual	Nominal	Tol-	Tol+	Deviation	Tendency	Result
		Y -5.804 A 0°00'00						
Circle 2		X -5.770 Y -5.729 R 1.229						
	D	D 2.458	0.246	0.020	0.000	2.212	→	Fail
Circle 3		X -0.510 Y -4.307 R 1.229						
	D	D 2.458	0.246	0.000	0.000	2.212	→	Fail
Circle 4		X 4.219 Y -5.728 R 1.229						
	D	D 2.458	0.246	0.000	0.000	2.212	→	Fail
Circle 5		X 6.701 Y 0.999 R 1.230						
	D	D 2.460	0.246	0.000	0.000	2.214	→	Fail

- 4 Press all remaining cells that require this same tolerance value. In this example, all the diameter tolerance values were 0.02 mm. Press enter to complete the assignment of tolerances to the feature coefficients.

Feature	Tol	Actual	Nominal	Tol-	Tol+	Deviation	Tendency	Result
		Y -5.652 A 90°00'00						
Circle 2		X -5.772 Y -5.728 R 1.229						
	D	D 2.458	2.460	0.020	0.020	-0.002	←	Fail
Circle 3		X -0.510 Y -4.306 R 1.229						
	D	D 2.457	2.460	0.020	0.020	-0.003	←	Fail
Circle 4		X 4.218 Y -5.729 R 1.229						
	D	D 2.458	2.460	0.020	0.020	-0.002	←	Fail
Circle 5		X 6.703 Y 1.000 R 1.230						
	D	D 2.461	2.460	0.020	0.020	0.001	→	Fail

Feature	Tol	Actual	Nominal	Tol-	Tol+	Deviation	Tendency	Result
		Y -5.652 A 90°00'00						
Circle 2		X -5.772 Y -5.728 R 1.229						
	D	D 2.458	2.460	0.020	0.020	-0.002	←	Pass
Circle 3		X -0.510 Y -4.306 R 1.229						
	D	D 2.457	2.460	0.020	0.020	-0.003	←	Pass
Circle 4		X 4.218 Y -5.729 R 1.229						
	D	D 2.458	2.460	0.020	0.020	-0.002	←	Pass
Circle 5		X 6.703 Y 1.000 R 1.230						
	D	D 2.461	2.460	0.020	0.020	0.001	→	Pass



## Section 9: Reporting Data and the Results Screen

As part programs are run, the runs database is accumulated and stored in the associated part file. The runs database is shown in the tabbed Results screen. The Result screen is displayed automatically at the conclusion of each part program execution with a new tab showing measurement results for the last program run. The Results screen can be accessed from other screens by pressing the Reports button the System toolbar.

The display of data in the Results screen shows program run tabs across the top with the most recent run tab on the left. Data is organized with features on the Y-axis and feature coefficients on the X-axis. Any run can be selected by pressing the desired run tab. Press and swipe the screen horizontally to display runs that are off-screen.

### Report Template Formats

Feature measurement results are displayed in one of four standard report formats and can be reviewed within the Report screen. By default, all features contained in the Feature List will appear in each of the four report formats. Report styles range from simple, including only feature numbers and actual measured values, to complex, including graphic representations of the results and tolerance data. It is also possible to save templates to user defined template names.

Reports are made up of rows and columns of data. Individual data cells within a report view can be edited to make changes to feature names, feature numbers and tolerance values. The report editing mode can be enabled or disabled quickly using the Edit Cell button. Individual rows of feature data can be hidden from any report format to create fully customized reports for printing or exporting. The data format, report header information and header/footer graphics can be customized by the user. Part view graphics, time and date stamp and operator information can be included in any report format.

Reports can be viewed on screen, printed or exported at the conclusion of a single part measurement or included in a part program to support repetitive and automated measurement and reporting. Reports can be printed as hardcopies to standard Windows-compatible printers or exported as data files in popular file formats.

### *Selecting a Report Format*

Any one of four report formats can be selected:

- European
- CSV
- Tolerance Report
- European 2

# Video Inspection Software User's Guide

To select a report format:

- 1 Press the Report button to display the Report screen in the center viewport.

**System toolbar > Report button**

- 2 Select the desired report format from the Report Format menu.

**Report toolbar > Report Format button**

No.	Feature	Conf.	Nominal	Actual	Tol.	Tpn.	Deviation	Tendency
0	Skew 1	X	0.0000	0.0000				
0	Skew 1	Y	0.0000	0.0000				
0	Skew 1	A	0.0000	0.0000				
0	Line 1	X	0.0000	0.0000				
0	Line 2	Y	0.0000	0.0000				
0	Line 2	A	0.0000	0.0000				
0	Skew 3	X	0.0000	0.0000				
0	Skew 3	Y	0.0000	0.0000				
0	Circle 4	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Circle 4	Y	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Circle 4	A	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Circle 4	D	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 5	X	-0.0000	-0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 5	Y	-0.0000	-0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 5	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 5	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 6	X	-0.0000	-0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 6	Y	0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000
0	Skew 6	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 6	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 7	X	0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000
0	Skew 7	Y	0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000
0	Skew 7	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 7	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 8	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 8	Y	-0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000
0	Skew 8	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 8	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000

**European**

Name	Xr	Yr	Zr	Hr	Dr	Lr	W	Ar	I
Skew 1	0.0000	0.0000						0.0000	0.0000
Line 2	0.0000	0.0000						0.0000	0.0000
Skew 3	0.0000	0.0000						0.0000	0.0000
Circle 4	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
Skew 5	-0.0000	-0.0000						0.0000	0.0000
Skew 6	-0.0000	-0.0000						0.0000	0.0000
Skew 7	-0.0000	-0.0000						0.0000	0.0000
Skew 8	0.0000	-0.0000						0.0000	0.0000

**CSV**

The selected format will be displayed with the report name in the upper left corner of the Report screen.

Features	Tol.	Actual	Nominal	Tol.	Tpn.	Deviation	Tendency	Result
Skew 1	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	
Skew 1	Y	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	
Skew 1	A	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	
Line 2	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	
Line 2	Y	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	
Line 2	A	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	
Skew 3	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	
Skew 3	Y	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	
Circle 4	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Circle 4	Y	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Circle 4	D	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 5	X	-0.0000	-0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 5	Y	-0.0000	-0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 5	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 5	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 6	X	-0.0000	-0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 6	Y	0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000	Pass
Skew 6	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 6	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 7	X	0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000	Pass
Skew 7	Y	0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000	Pass
Skew 7	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 7	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 8	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 8	Y	-0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000	Pass
Skew 8	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass
Skew 8	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	Pass

**Tolerance Report**

No.	Feature	Conf.	Nominal	Actual	Tol.	Tpn.	Deviation	Tendency
0	Skew 1	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 1	Y	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 1	A	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Line 2	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Line 2	Y	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Line 2	A	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 3	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 3	Y	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Circle 4	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Circle 4	Y	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Circle 4	D	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 5	X	-0.0000	-0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 5	Y	-0.0000	-0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 5	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 5	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 6	X	-0.0000	-0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 6	Y	0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000
0	Skew 6	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 6	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 7	X	0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000
0	Skew 7	Y	0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000
0	Skew 7	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 7	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 8	X	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 8	Y	-0.0000	-0.0000	0.0000	0.0000	-0.0000	0.0000
0	Skew 8	L	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
0	Skew 8	W	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000

**European 2**


## Editing Report Templates

Any of the four report template types can be modified when the system is in the interactive mode. Templates cannot be modified in the playback or program editing modes. Template modifications include:


- Adding or deleting template categories
- Column order
- Column width
- Number of horizontal lines
- Number of vertical lines
- Number of feature names for European templates
- Row height

Template modifications can be:

- Reset to the factory default
- Discarding changes before saving
- Saved as the new default for the modified template

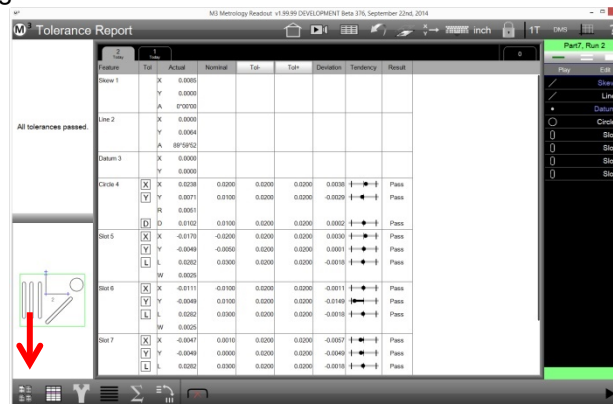

**Press the Report Format button**

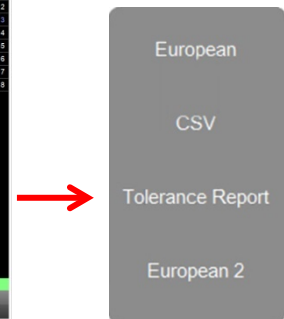


## Accessing Report Template Editing Functions

To access the report template editing functions:


- 1 Press the load New Part icon off the M3 menu to load a new part.

**System toolbar > M3 Menu > New Part**

# Video Inspection Software User's Guide

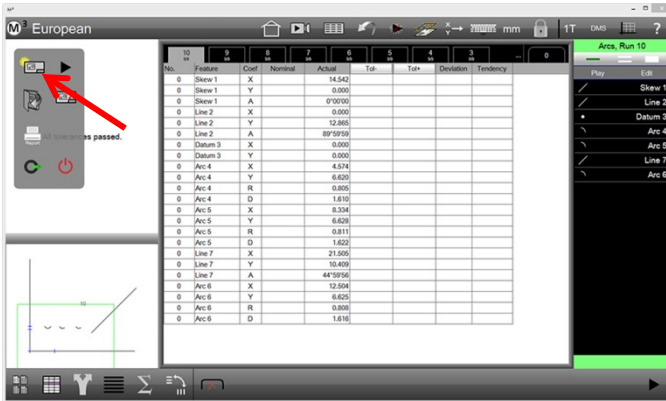


**Load a new part**

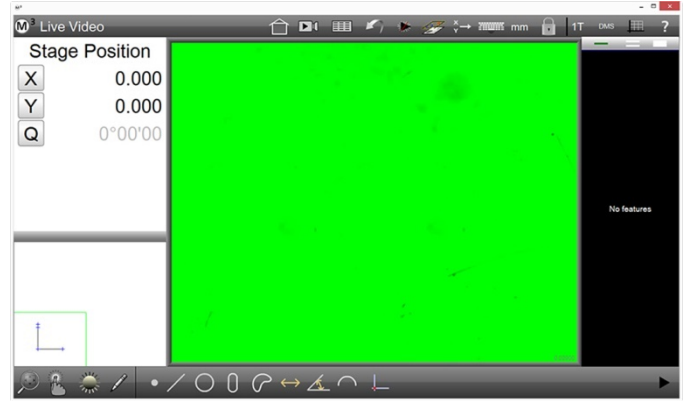


**New part in interactive mode**


- Place a piece in the field of view and measure a few features to populate the Feature List with data.

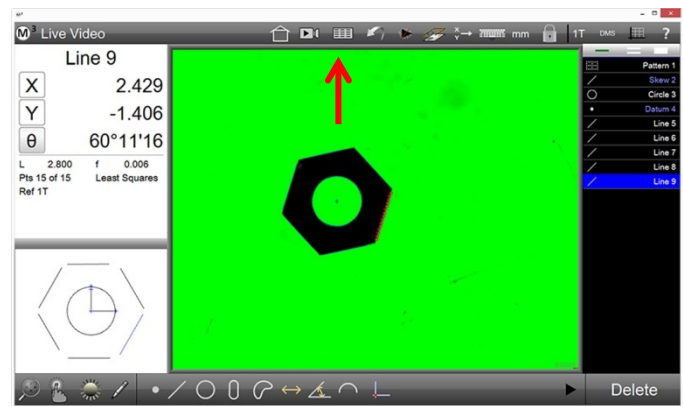

- Press the Report button in the System toolbar and then the Report Type button in the Report toolbar to select one of the four report template types. The European type is selected in this example.

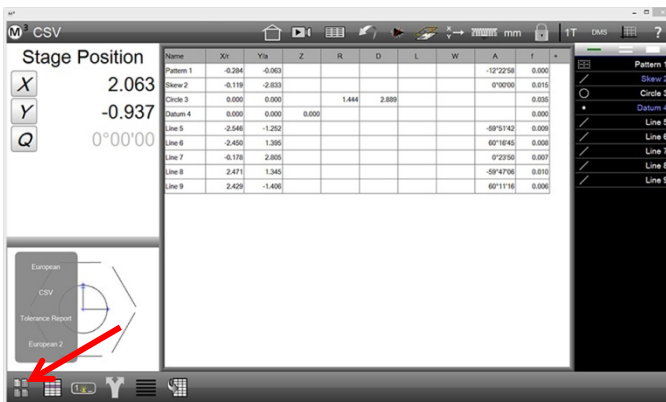

**Select a report type**

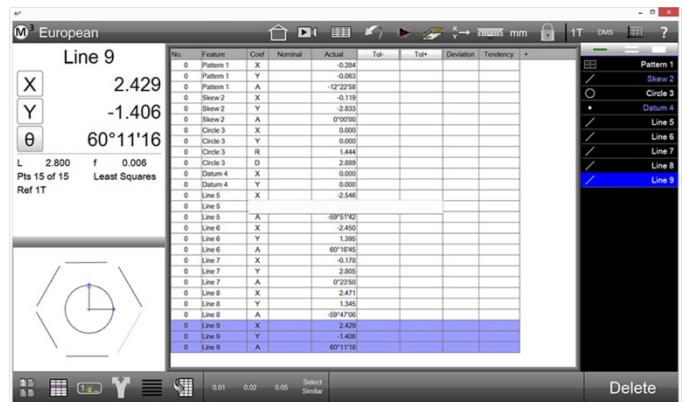


**The European Report Type is Selected**

## Displaying Report Edit Functions


To display the report edit functions:

- Press the small + in the top right corner of the report screen to display the list of report categories and the Report Edit toolbar at the bottom of the screen.

# Video Inspection Software User's Guide

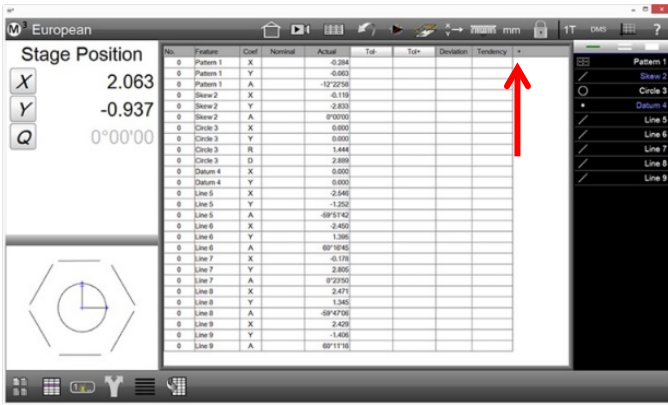

**Press the + sign to display the report categories list and the Report Edit toolbar**

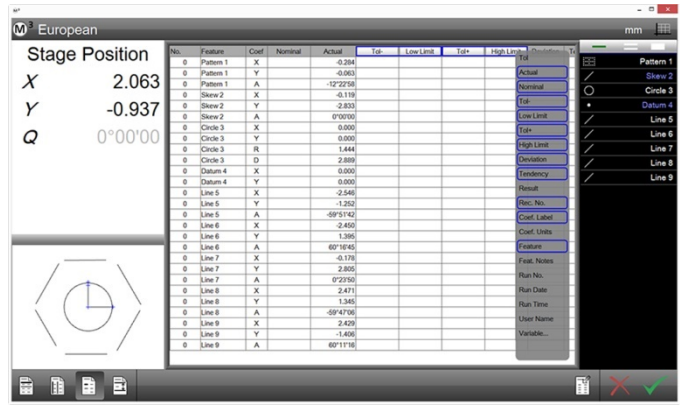

**Report category list and Report Edit toolbar displayed**

The Report Edit toolbar functions include:

- 1 Horizontal Lines
- 2 Vertical Lines
- 3 Fill Column (European template)
- 4 Row Height
- 5 Reset to Factory Default
- 6 Discard Changes
- 7 Save Changes




**Report Edit toolbar**


## Adding or Deleting Template Categories (Columns)

To add or delete report categories:

- 1 Press on report categories in the list to add or delete categories from the current report template.

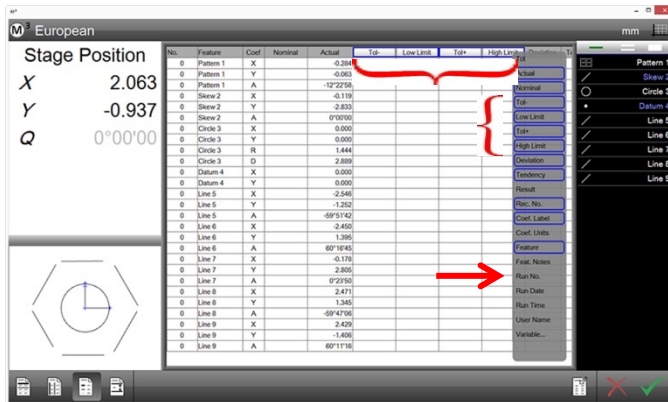

**Four report categories deleted, and one category added**

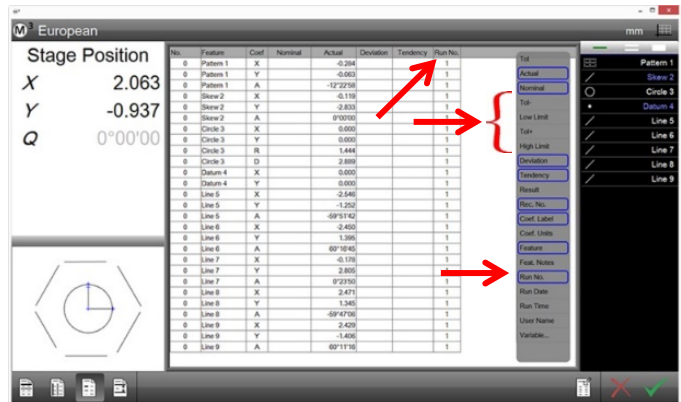


**The changes are shown in the modified template**




## Changing Column Order and Column Width

To change the column order, press and drag columns left or right.


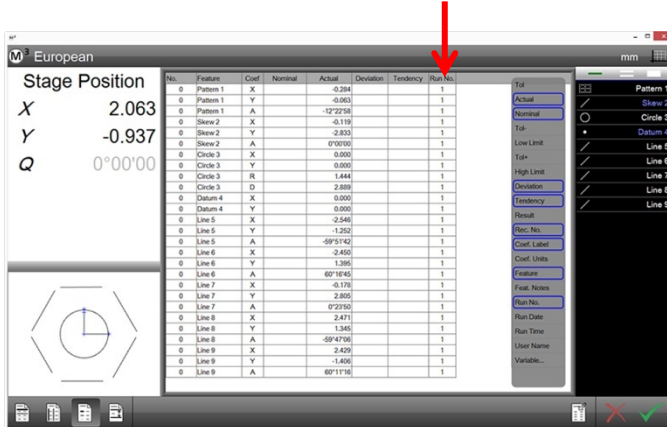


Press the column header...

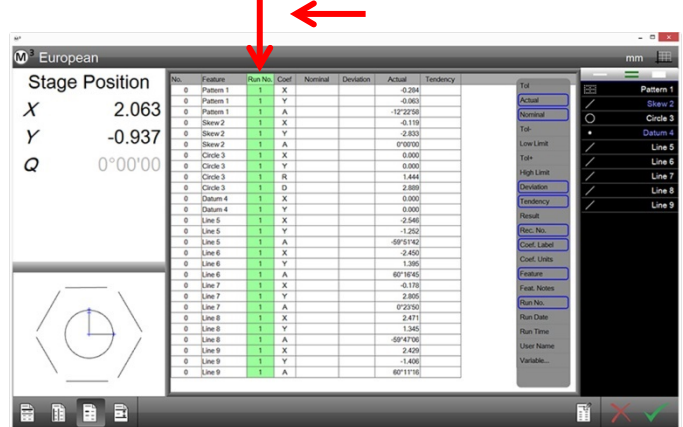

And drag the column to the desired location

To change the column width, press and drag the column dividing lines.

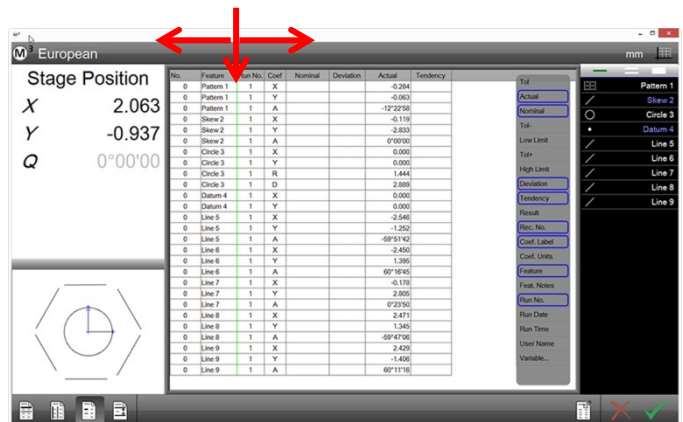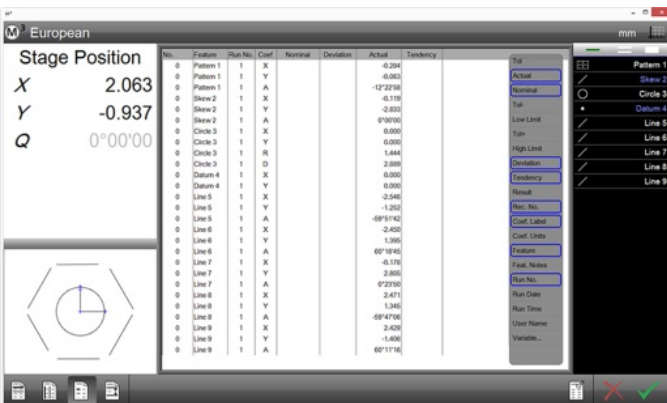


## Increasing or Decreasing Horizontal Lines

To increase or decrease horizontal lines:

- 1 Press the Horizontal Line button in the Report Edit toolbar to toggle through the horizontal report line options:
  - One line per feature coefficient
  - One line per feature
  - No lines

# Video Inspection Software User's Guide

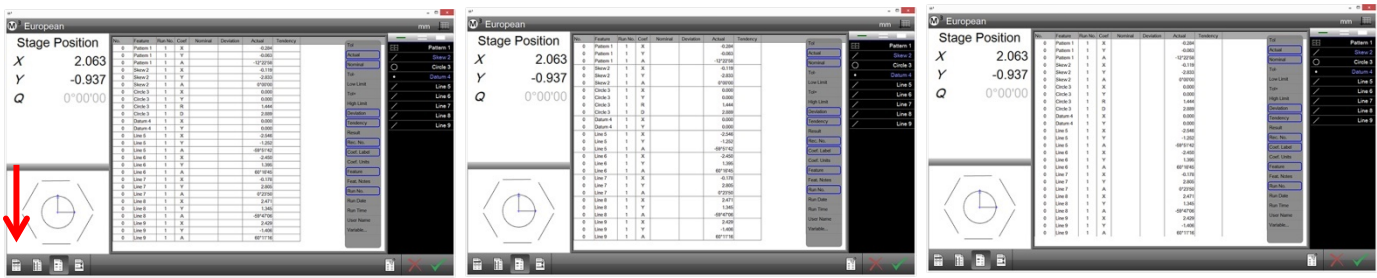

One line per feature coefficient


One line per feature

No lines


## Increasing or Decreasing Vertical Lines

To increase or decrease vertical lines:

- 1 Press the Vertical Line button to toggle the vertical report line options:
  - Vertical lines separating columns
  - No vertical lines

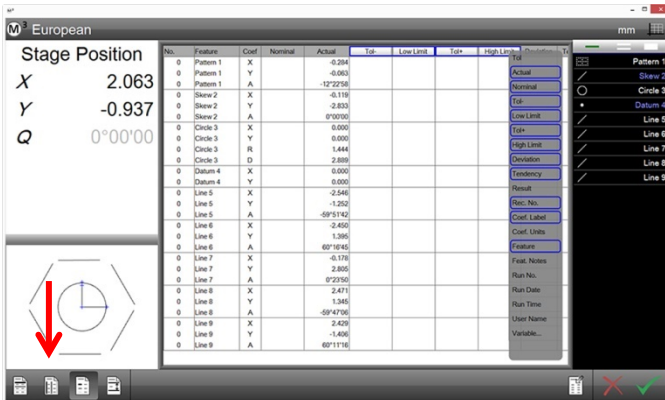

Vertical lines

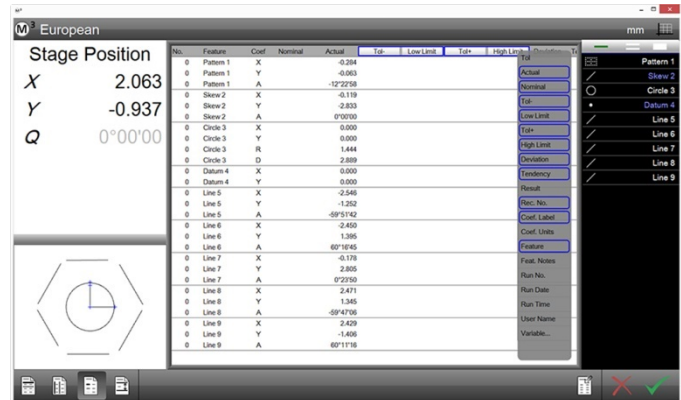


No vertical lines


## Changing the Number of Feature Names for European Templates

To change the number of feature names:

- 1 Press the Fill Column button to toggle the feature name options for the European template:
  - Feature name on every line
  - Feature name on only the first line of each feature

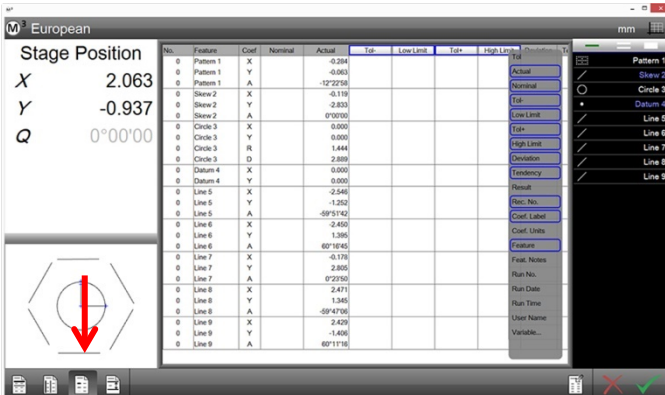

Feature name on every line

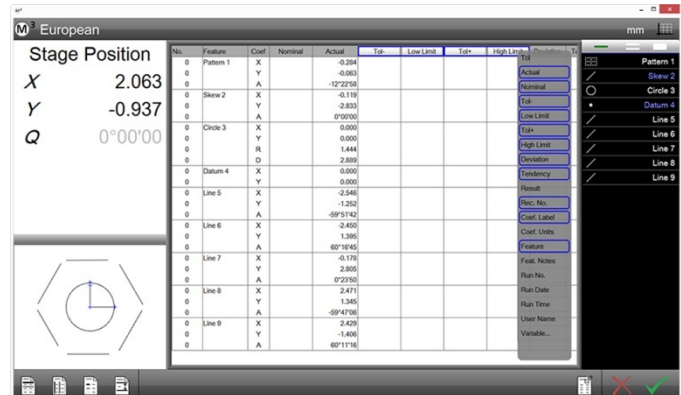

Feature name on first line



## Changing the Row Height

To change the row height:

- 1 Press the Row Height button to toggle through the four preset report Row height options.

No.	Feature	Coef	Nominal	Actual
0	Pattern 1	X		-0.284
0	Pattern 1	Y		-0.063
0	Pattern 1	A		-12°22'58
0	Skew 2	X		-0.119
0	Skew 2	Y		-2.833
0	Skew 2	A		0°00'00
0	Circle 3	X		0.000
0	Circle 3	Y		0.000
0	Circle 3	R		1.444
0	Circle 3	D		2.889
0	Datum 4	X		0.000
0	Datum 4	Y		0.000
0	Line 5	X		-2.546
0	Line 5	Y		-1.252
0	Line 5	A		-59°51'42
0	Line 6	X		-2.450
0	Line 6	Y		1.395
0	Line 6	A		60°16'45
0	Line 7	X		-0.178
0	Line 7	Y		2.805
0	Line 7	A		0°23'50

No.	Feature	Coef	Nominal	Actual
0	Pattern 1	X		-0.284
0	Pattern 1	Y		-0.063
0	Pattern 1	A		-12°22'58
0	Skew 2	X		-0.119
0	Skew 2	Y		-2.833
0	Skew 2	A		0°00'00
0	Circle 3	X		0.000
0	Circle 3	Y		0.000
0	Circle 3	R		1.444
0	Circle 3	D		2.889
0	Datum 4	X		0.000
0	Datum 4	Y		0.000
0	Line 5	X		-2.546
0	Line 5	Y		-1.252
0	Line 5	A		-59°51'42
0	Line 6	X		-2.450
0	Line 6	Y		1.395
0	Line 6	A		60°16'45
0	Line 7	X		-0.178
0	Line 7	Y		2.805
0	Line 7	A		0°23'50
0	Line 8	X		2.471
0	Line 8	Y		1.345
0	Line 8	A		-59°47'06

No.	Feature	Coef	Nominal	Actual
0	Pattern 1	X		-0.284
0	Pattern 1	Y		-0.063
0	Pattern 1	A		-12°22'58
0	Skew 2	X		-0.119
0	Skew 2	Y		-2.833
0	Skew 2	A		0°00'00
0	Circle 3	X		0.000
0	Circle 3	Y		0.000
0	Circle 3	R		1.444
0	Circle 3	D		2.889
0	Datum 4	X		0.000
0	Datum 4	Y		0.000
0	Line 5	X		-2.546
0	Line 5	Y		-1.252
0	Line 5	A		-59°51'42
0	Line 6	X		-2.450
0	Line 6	Y		1.395
0	Line 6	A		60°16'45
0	Line 7	X		-0.178
0	Line 7	Y		2.805
0	Line 7	A		0°23'50
0	Line 8	X		2.471
0	Line 8	Y		1.345
0	Line 8	A		-59°47'06
0	Line 9	X		2.429
0	Line 9	Y		-1.406
0	Line 9	A		60°11'16

No.	Feature	Coef	Nominal	Actual
0	Pattern 1	X		-0.284
0	Pattern 1	Y		-0.063
0	Pattern 1	A		-12°22'58
0	Skew 2	X		-0.119
0	Skew 2	Y		-2.833
0	Skew 2	A		0°00'00
0	Circle 3	X		0.000
0	Circle 3	Y		0.000
0	Circle 3	R		1.444
0	Circle 3	D		2.889
0	Datum 4	X		0.000
0	Datum 4	Y		0.000
0	Line 5	X		-2.546
0	Line 5	Y		-1.252
0	Line 5	A		-59°51'42
0	Line 6	X		-2.450
0	Line 6	Y		1.395
0	Line 6	A		60°16'45
0	Line 7	X		-0.178
0	Line 7	Y		2.805
0	Line 7	A		0°23'50
0	Line 8	X		2.471
0	Line 8	Y		1.345
0	Line 8	A		-59°47'06
0	Line 9	X		2.429
0	Line 9	Y		-1.406
0	Line 9	A		60°11'16

## Resetting Template Modifications to the Factory Default

- 1 Press the Reset Template button to revert to the factory default state of the modified template.

## Discarding Changes Before Saving

- 1 Press the Abandon Changes button to clear report template modifications made since the template was last saved.

## Saving Template Changes as the New Default

- 1 Press the Save Template button to save template modifications.



### NOTE

Saved template modifications will be reflected in all future uses of the template in the M3 system.

## User Defined Report Templates

A user can define a report template. All report template functions available in system report templates are also available applicable to user defined report templates. The user defined report templates are created by copying a system report template, editing it, and then saving it using a user defined file name.

To define a report template:


- 1 In interactive mode (no program loaded), access the M3 data view screen.
- 2 Select the default template that you would like to make a copy of.
- 3 Press the Plus Template button located to the right of the template headers to enter template edit mode.
- 4 Configure the template using the various template customization options.
- 5 Once the desired template is achieved, press the Save New Template button found in the bottom right toolbar.
- 6 Enter a name for the new template and press Save. The newly saved template will be set as the current template and will be added to the template selection menu.



## Editing Report Cells

Feature names, feature numbers and tolerance values can be edited in the Report screen. To edit report cells:

- 1 Press the Report button to display the Report screen in the center viewport.  
**System toolbar > Report button**
- 2 Press the Edit Tab to display the Edit Cell button in the report toolbar.  
**Feature List > Edit Tab**
- 3 Press the edit cell button to enable editing. Data fields that can be edited will be shaded light green.  
**Report toolbar > Edit Cell button**
- 4 Report data that extends beyond the field of view can be moved up or down by pressing and dragging on the screen.
- 5 Edit feature names, feature numbers or tolerance values. Tolerance nominal and limit values can be edited.
- 6 Press the Edit Cell button again to leave the edit mode.

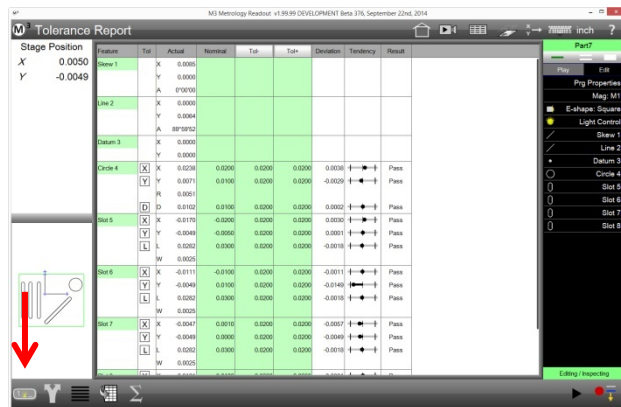

*Cells shaded green can be edited*

## Hiding Report Data

Specific data rows can be hidden from printed or exported reports. To hide one or more rows of data:

- 1 Press the Report button to display the Report screen in the center viewport.

**System toolbar > Report button**

- 2 Select individual rows by pressing on them. Selected rows will be shaded pink. Select multiple rows by pressing the double bar of the feature selection tool and then pressing on the desired rows.


- 3 Report data that extends beyond the field of view can be moved up or down by pressing and dragging on the screen.

- 4 Press the Hide Data button to hide the shaded rows from printed reports and exported files.

Long-press the Hide Data button to hide all rows except the shaded rows from printed reports and exported files.

**Report toolbar > Hide Data button**

- 5 To restore hidden data for a given feature, press the Hide Data button when the feature is selected.

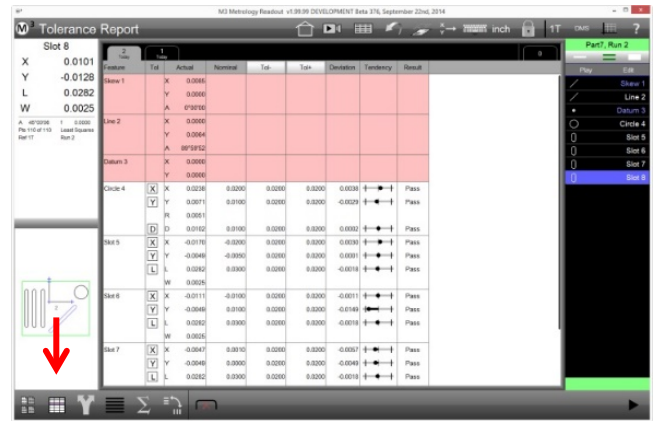


**Press the Hide Data button to hide shaded rows**  
**Long-press the button to hide all but the shaded rows**



## Customizing Printed Reports

Printed report parameters are shared with all report formats and are customized by specifying the printout settings. A graphic representation of report template printout categories is shown below.

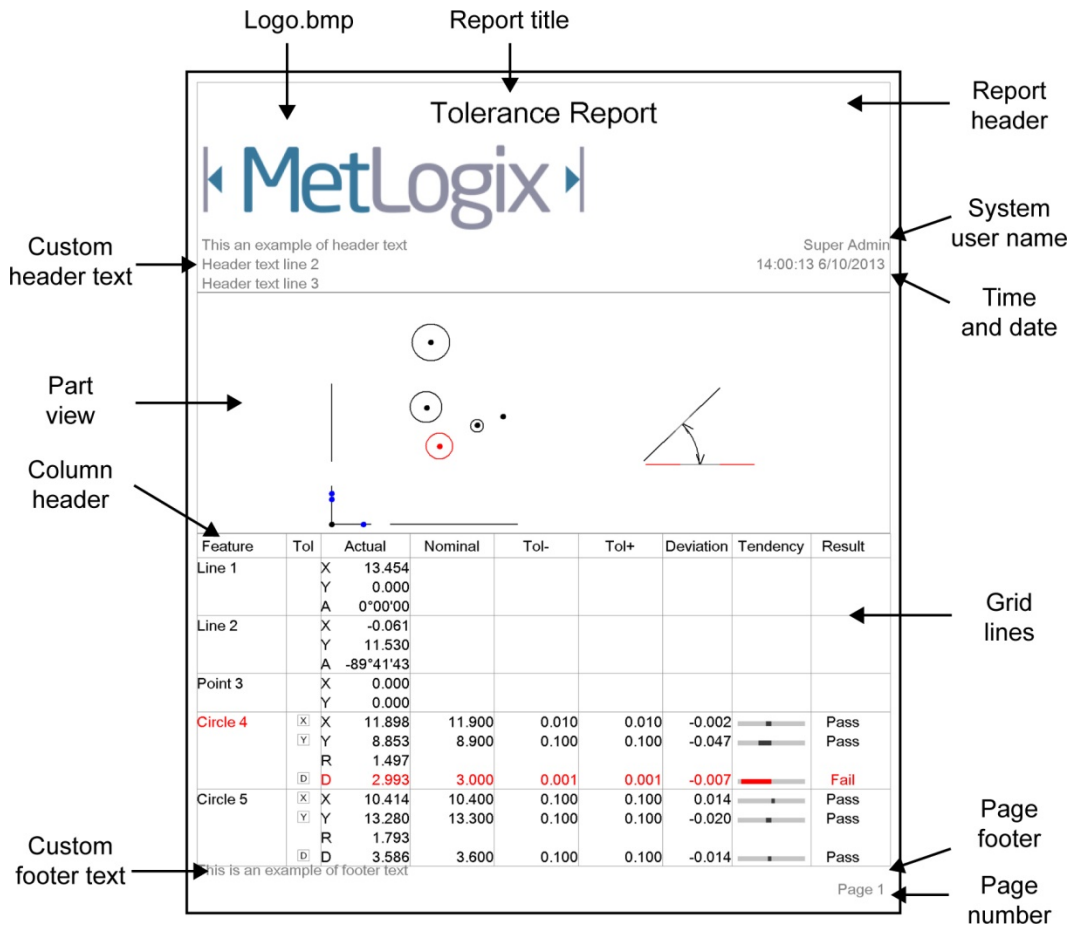

## Specifying Printout Settings

The printer settings are found in the Printouts Settings screen. To specify printer settings:

- 1 Display the Printout Settings screen.  
**System toolbar > System menu > Printouts button**
- 2 Set the desired parameters in the Printout Settings screen. Printout settings are show below.

### Print Report Header

Set this field to Yes to include the report header.

### Print Column Header

Set this field to Yes to include column headers. The column header labels the report columns by category.

### Print Grid to Lines

Set this field to Yes to include grid lines.

### Print Bitmap in Header

Set this field to Left, Center or Right to include a custom bitmap image in the specified location of the report header. Set this field to No to omit a custom bitmap. Place the custom bitmap image with the file name *HeaderLogo.bmp* into: *C:\users\public\public documents\MetLogix\logosandbitmaps*. The size of the custom bitmap should be 397 by 98 pixels.

# Video Inspection Software User's Guide

## **Print Bitmap in Footer**

Set this field to Left, Center or Right to include a custom bitmap image in the specified location of the report header. Set this field to No to omit a custom bitmap. Place the custom bitmap image with the file name *FooterLogo.bmp* into: *C:\users\public\public documents\MetLogix\logos and bitmaps*. The size of the custom bitmap should be 397 by 98 pixels.

## **Print Username in Header**

Set this field to Left, Center or Right to include the currently logged-in username in the desired location of the header. Set this field to No to omit the username from the header.

## **Print Date/Time in Header**

Set this field to Left, Center or Right to include the system date and time in the desired location of the header. Set this field to No to omit the date and time.

## **Print Part View with Data**

Set this field to Top, Bottom or Watermark to include the image of the current part view in the desired location. Setting the field to Watermark will print an alpha-blended part view image underneath the report data. Set this field to No to omit the part view image.

## **Print Page Number in Footer**

Set this item to Yes to include a page number in the footer.

## **Printed Part View Height**

Set this item to the desired size of the part view to be included with the report. This item can be set to 25%, 50%, 75% or 100% of the native size of the part view image.

## **Print Custom Text in Header**

Enter custom alphanumeric information into these fields to be displayed in the header. Custom text entered into these fields will always be aligned left and bottom in the header.

## **Print Custom Text in Footer**

Enter custom alphanumeric information into this field to be displayed in the footer. Custom text entered into this field will always be aligned left and bottom in the footer.

## **Prompt for Custom Text**

Set this field to Yes to prompt the user to enter the custom text that will be included in the header and footer when header or footer text was specified. When this field is set to Yes, a dialog box will be displayed each time the user requests a printed report. Custom text can be entered directly into this dialog box and will be included on the printed report.

## Results View Visual Review Tools

Tools are available that change and enhance the display of measurement data for visual review. These views cannot be printed as reports but can be exported as .tsv or .csv formatted data. These exports can be performed interactively but cannot be included in programs. Visual review tools include:

- Pivot view
- Pinned coefficients
- Statistics
- Run zero tab
- Delete button

### Pivot view

The Pivot view reorganizes the stored run data to display the run numbers on the Y-axis and the feature coefficient data on the X-axis for the selected features. To display the Pivot view:

- 1 Press the Pivot view button and then select the desired feature(s).

**Report toolbar > Pivot view**

**Feature List > Desired features**

**Tolerance Report**

Feature	Tol	Actual	Nominal	Deviation	Tendency	Result	Tol	Tol+
Skew 1	X	0.0002						
	Y	0.0000						
	A	0.0000						
Line 2	X	0.0000						
	Y	0.0004						
	A	0.0000						
Datum 3	X	0.0000						
	Y	0.0000						
Slot 4	X	-0.0130	-0.0000	0.0000	→	Pass	0.0000	0.0000
	Y	-0.0049	-0.0000	0.0000	→	Pass	0.0000	0.0000
	L	0.0000	0.0000	-0.0016	→	Pass	0.0000	0.0000
	W	0.0000						
Slot 5	X	-0.0111	-0.0100	-0.0011	→	Pass	0.0000	0.0000
	Y	-0.0049	-0.0000	0.0000	→	Pass	0.0000	0.0000
	L	0.0000	0.0000	-0.0016	→	Pass	0.0000	0.0000
	W	0.0000						
Slot 6	X	-0.0047	-0.0000	0.0000	→	Pass	0.0000	0.0000
	Y	-0.0049	-0.0000	0.0000	→	Pass	0.0000	0.0000
	L	0.0000	0.0000	-0.0016	→	Pass	0.0000	0.0000
	W	0.0000						
Slot 7	X	-0.0111	-0.0100	-0.0011	→	Pass	0.0000	0.0000
	Y	-0.0049	-0.0000	0.0000	→	Pass	0.0000	0.0000
	L	0.0000	0.0000	-0.0016	→	Pass	0.0000	0.0000
	W	0.0000						

Results view

**Tolerance Report**

Run No.	Slot 7 X	Slot 7 Y	Slot 7 L	Slot 7 W	Slot 9 X	Slot 9 Y	Slot 9 L	Slot 9 W	Circle 10 X	Circle 10 Y
1	0.0101	-0.0128	0.0282	0.0025	0.0004	0.0003	0.0197	0.0184	0.0208	0.0071
2	0.0101	-0.0128	0.0282	0.0025	0.0004	0.0003	0.0197	0.0184	0.0208	0.0071
3	0.0101	-0.0128	0.0282	0.0025	0.0004	0.0003	0.0197	0.0184	0.0208	0.0071
4	0.0101	-0.0128	0.0282	0.0025	0.0004	0.0003	0.0197	0.0184	0.0208	0.0071
5	0.0101	-0.0128	0.0282	0.0025	0.0004	0.0003	0.0197	0.0184	0.0208	0.0071
6	0.0101	-0.0128	0.0282	0.0025	0.0004	0.0003	0.0197	0.0184	0.0208	0.0071

Pivot view

### Pinning Coefficient

#### Data

The Pivot view can be changed to display only the desired feature coefficient values across all program runs by pinning the coefficient columns. Pinning coefficient columns are shown in this example. The pinned view shows that the length (L) of slot 7 and the width (W) of blob 9 changed very little over 5 program runs.

**Tolerance Report**

Run No.	Slot 7 L	Slot 9 W
1	0.0282	0.0183
2	0.0280	0.0184
3	0.0282	0.0182
4	0.0281	0.0184
5	0.0282	0.0184


# Video Inspection Software User's Guide

To pin feature coefficients:


- 1 Display the feature coefficients for a number of program runs as described in the previous pages.
- 2 Select a feature in the feature list and press a coefficient column header to highlight the column.
- 3 Press the Pin Columns button in the Report toolbar.

## Report toolbar > Pin Columns

A black dot will appear in the right corner of the highlighted header to indicate that the coefficient is pinned.

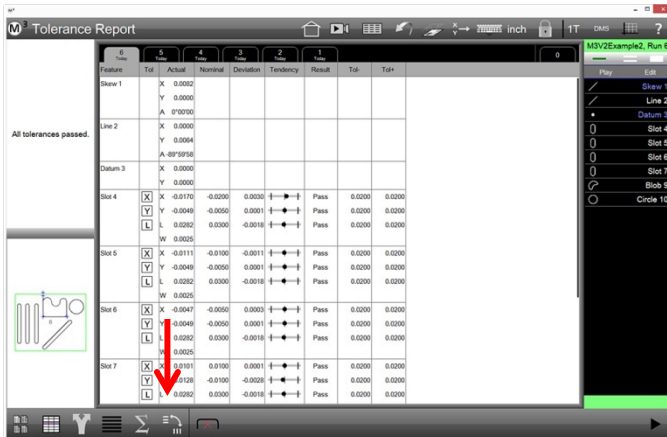

*Display Results view then press Pivot button*

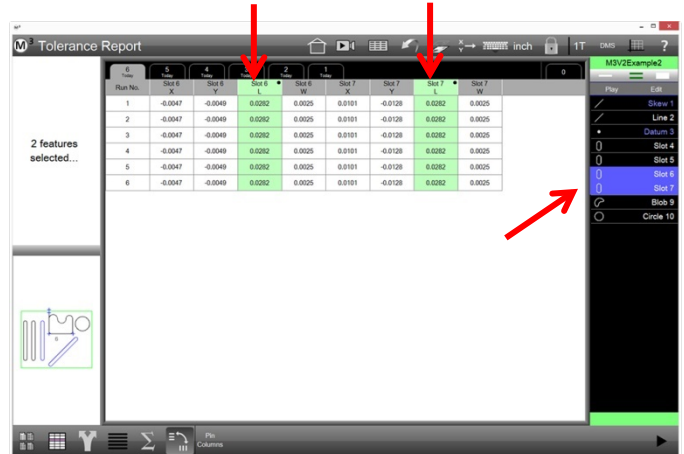


*Select features, press column headers then press Pin Columns button*

- 4 Deselect the feature in the feature list. The pinned column will be retained in the Pivot view.

Repeat steps 2 through 4 to pin additional feature coefficients if desired. Any coefficient from any feature may be pinned.

To unpin coefficients, Press the desired coefficient column header(s) and then press the Pin Columns button.

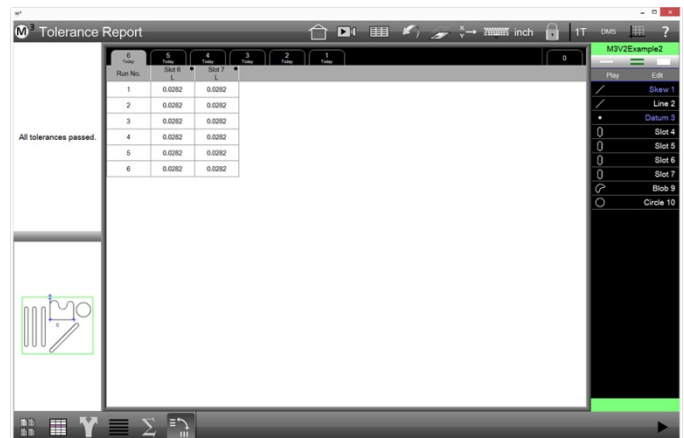

## Statistics

Standard statistics can be shown for the selected feature(s) including:

- Min
- Max
- Range
- Average
- Standard deviation
- Sigma

## Results View Statistics


To display statistics for features in the results view:

- 1 Press the Stats button in the Report toolbar. A menu of statistics functions will be displayed in the Report toolbar. All statistics are enabled and displayed for all features in the Results view by default.


## Report toolbar > Stats button



# Video Inspection Software User's Guide

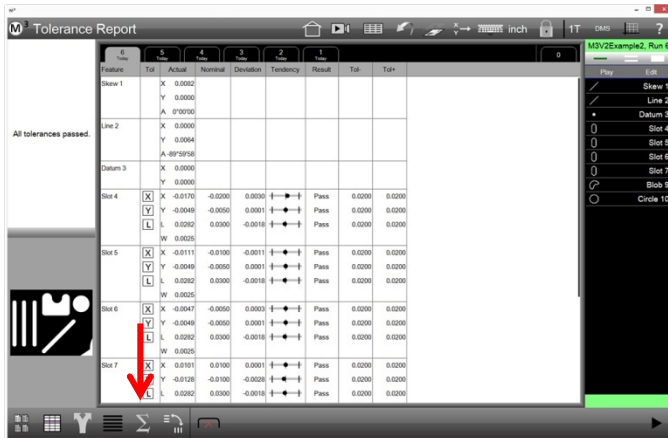


*Press the Stats button...*

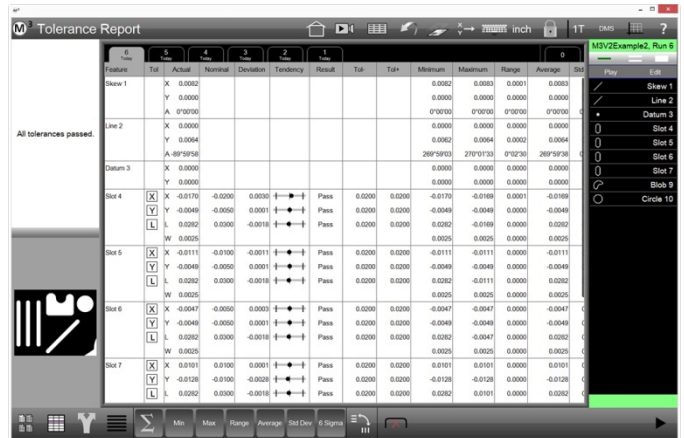

*To add statistics to the Results view*

- Press any statistics function button to disable the display of that statistic.  
**Report > Statistics menu function**
- Press the Statistics button again to remove all statistics from the Results view.  
**Report toolbar > Stats button**

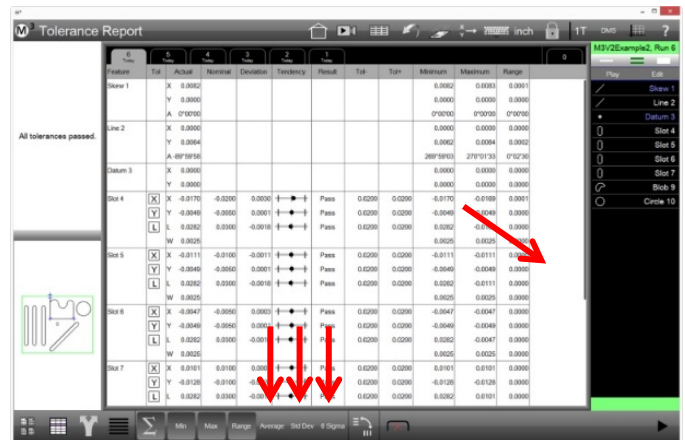


*Three statistics are removed from the Results view*


## Pivot View Statistics

To display statistics in the Pivot view:

- Press the Pivot view button and then select the desired feature(s).  
**Report toolbar > Pivot view**  
**Feature List > Desired feature**
- Press the Stats button. A menu of statistics functions will be displayed in the Report toolbar. All statistics are enabled by default and displayed under the feature data by default.  
**Report toolbar > Stats button**

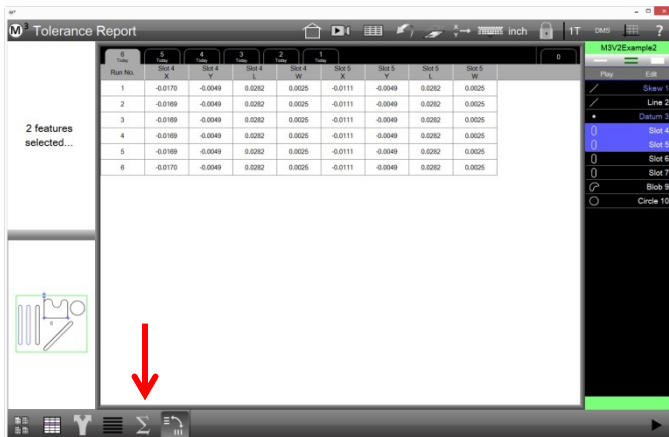

*Press the Stats button in the Pivot view...*

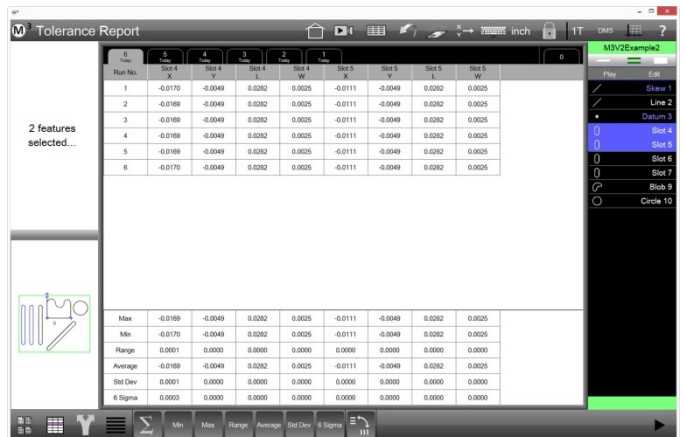

*To add statistics to the Pivot view*

- Press the Statistics button again to remove all statistics from the Pivot view.  
**Results toolbar > Stats**

## Run Zero Tab


Part programs are often edited over the course of many runs resulting in changes in the results data through its history of runs. The run data is retained throughout the history of runs, but some data might not reflect the current state of the part program. To see the current part program state:

- 1 Press the Run Zero Tab  
**Results View window > Run Zero tab**

## Delete Tab

Run tabs can be deleted from the Result view if desired. To delete run tab(s):

- 1 Select a single tab by pressing it, or multiple tabs using the multi-select tool above the Feature List.
- 2 Press the Delete tab in the Report toolbar to delete the selected run tab(s)  
**Report toolbar > Delete tab**

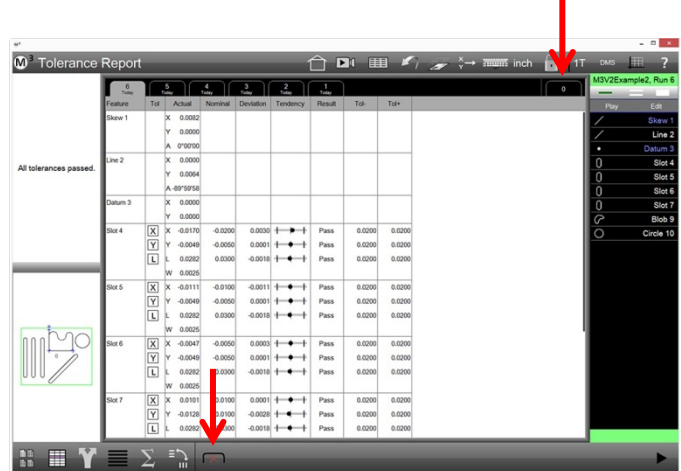

Run Zero and Delete tabs

## Results Statistical Analysis Feature

Results can be analyzed in a unified form using the Statistical Analysis Feature. This feature can report the Min, Max, Range, Average, Standard Deviation, or Six Sigma result for a given population of feature measurements.



The Statistical Analysis feature provides a simple way of comparing measurement results from several like features. As an example, if you measure six bore features in a bolt hole pattern, you can measure them and then construct a Stats feature from these parent circles and quickly determine the largest, smallest, and average of the six diameters. This applies to all feature types and can be used on all coefficients. The results of the Statistical Analysis feature can be tolerated and can be also included in a report or part program.




### NOTE


*The Statistical Analysis feature is disabled by default. It can be enabled by assigning it to the measure toolbar or Extra menu list. To enable it, set the Display stats measurement button in Desktop screen of system Settings to either Extra or Desktop.*

## **An example of using the Statistical Analysis feature:**

- 1 Measure 6 circles of approximately the same size

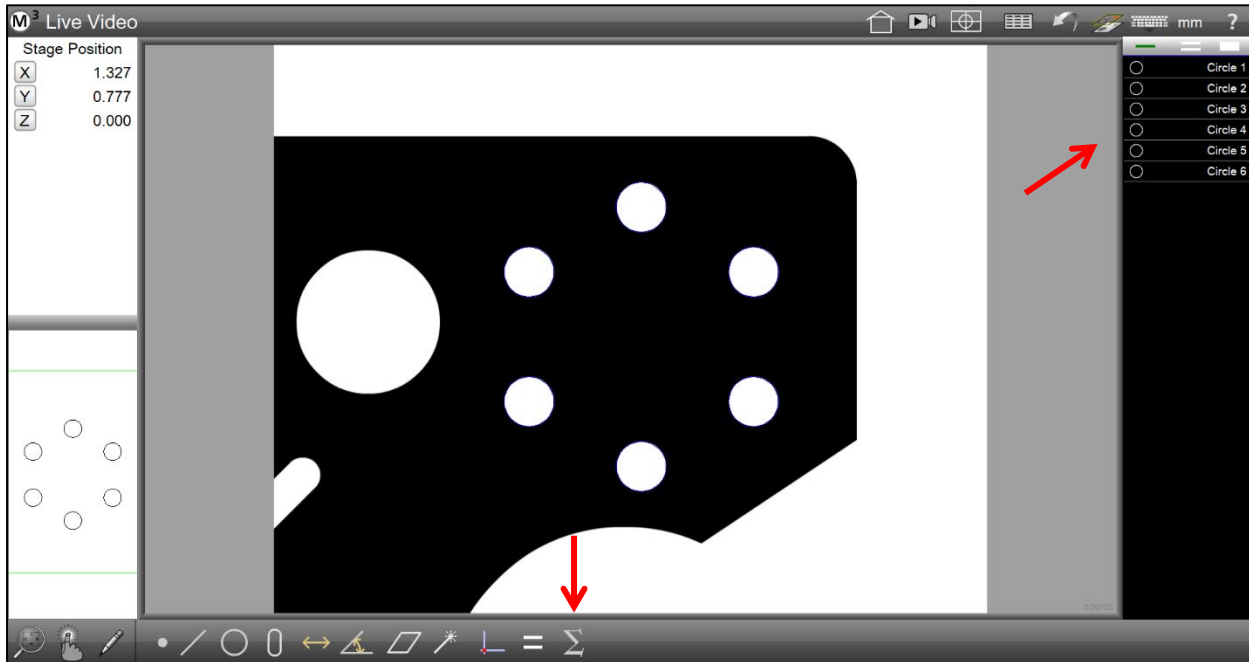


- 2 Select the Stats Feature button from the Toolbar or Extra menu.
- 3 Select the 6 circles from the feature list and press the Done button.

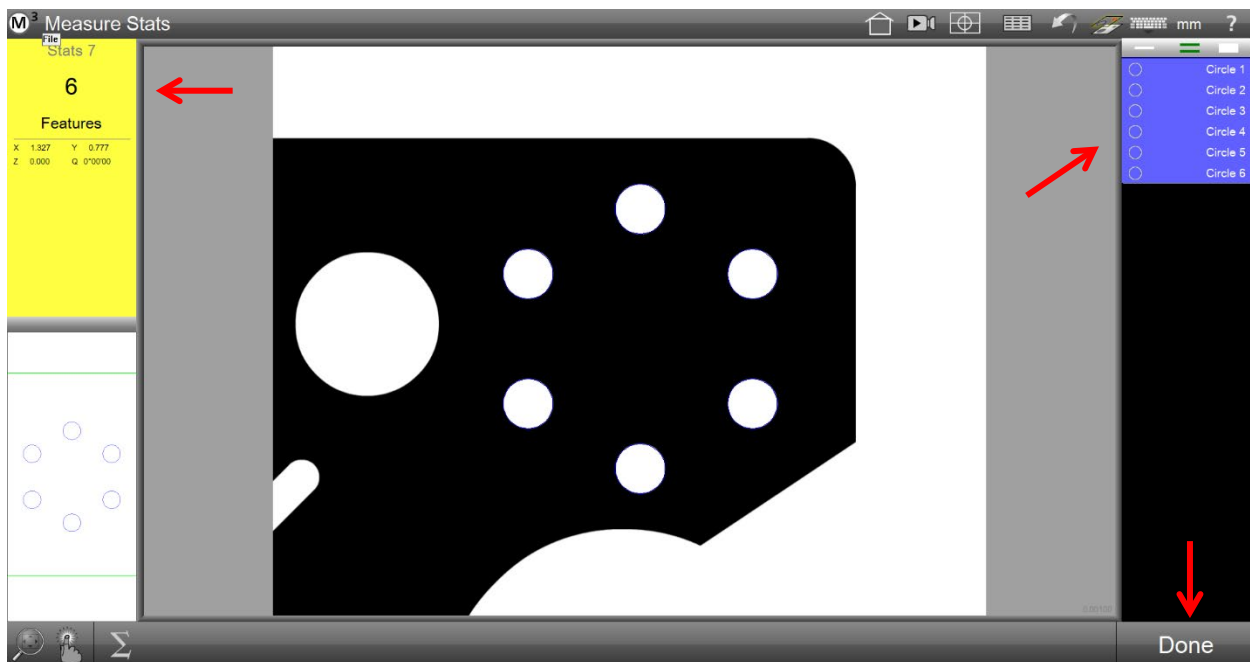

## Video Inspection Software User's Guide

- 4 The feature detail window (top left) will now display the results of the Statistical Analysis feature, with the default of the MIN values of the matching feature population coefficients. Other change-type values that can be displayed are:
- MIN = Minimum coefficient characteristic of the Stat population.
  - MAX = Maximum coefficient characteristic of the Stat population.
  - RANGE = Range of the coefficient characteristic of the Stat population.
  - AVE = the average of the coefficient characteristic of the Stat population.
  - STD DEV = Standard Deviation of the coefficient characteristic of the Stat population.
  - 6 Sigma = Six times the Standard Deviation of the coefficient characteristic of the Stat population.

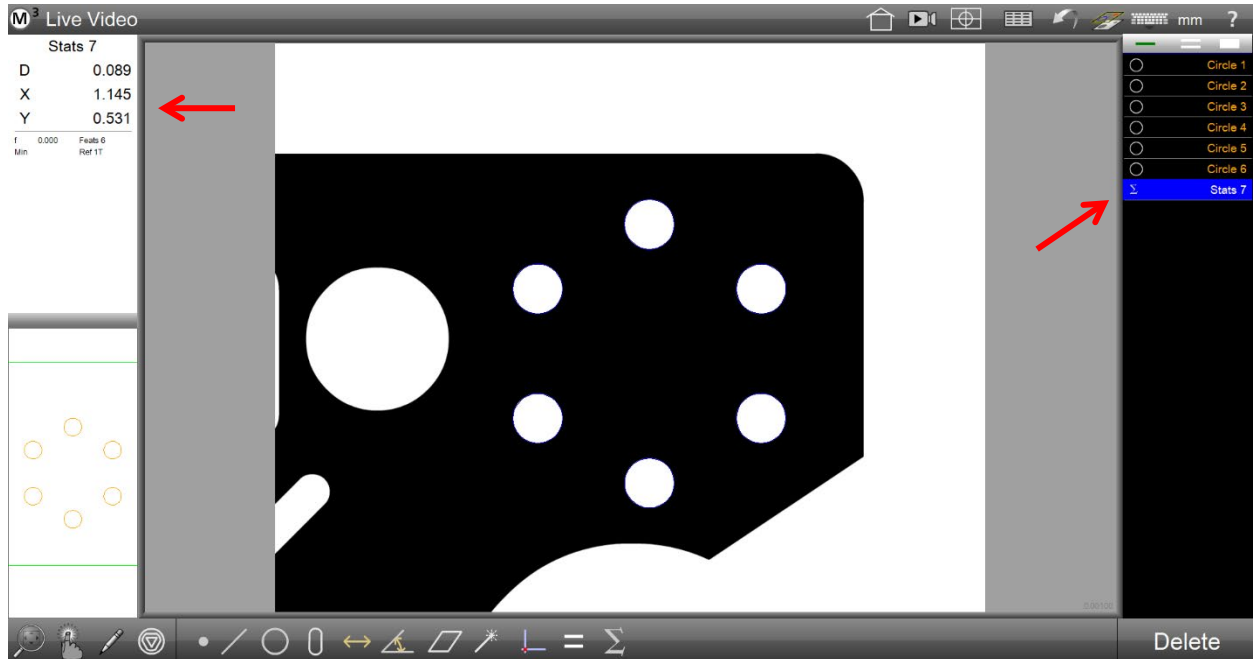

## Section 10: Exporting Data

Feature measurement data can be exported to a file on your computer from the Report screen. Data can be exported in the following formats:

- .CSV
- .TSV
- .TXT
- .DXF
- .PDF
- Cloud CSV
- Cloud DXF
- .XLSX

The format of the exported data file will conform to the current report template parameters described in [Section 9: Reporting and the Results Screen](#). The exported data file will contain any modifications made to the report, including hidden or modified data cells.

The basic parameters and destination of exported data file are configured in the File Locations settings screen. Data can be exported to a folder, a fixed drive location or a network location. Data file exports can have custom file names and can be configured to append to an existing file, overwrite an existing file or be added as a new file with an auto-number applied.

Data export steps that are part of a saved part program can be edited to change the report format type

## Specifying Export Settings

To specify the basic export settings for feature measurement data files:

- 1 Confirm that the report template settings are appropriate for your data export file. Report template settings are described in detail in [Section 9: Reporting Data and the Results Screen](#).
- 2 Display the Export Settings screen.  
**System toolbar > System menu > Settings > Export button**
- 3 Set the desired export parameters in the Export Settings screen. Settings are show below.

### File Name

Configure the desired filename for the file exports.

### Include Column Headers

Set this field to Yes to include column headers in the file export. The column header labels the columns by category.

### Target File Type

Set this field to Append to append the exported file to an existing target file, set the field to Overwrite to overwrite the target file with the exported file and set the field to Auto Number to create a new file on each export that increments starting with the Auto Number name specified in the Auto Number File Name field.

### Auto Number File Name

Set this field to the desired export Auto Number. The file number will automatically increment when the target file type is set to Auto Number.

### Prompt for Settings on Each Export

The export options can be configured as global settings from within the Export Settings screen or can be configured on an export-by-export basis by enabling the Prompt for Settings on each Export from within the

# Video Inspection Software User's Guide

Export settings screen. To configure the software to prompt for Export settings at each file export command, configure the Prompt for Settings on each Export to Yes.

## **Append to Each Export**

Enter text into this field to append a message to each export file.

## **Use Pallet locations in file Name**

Set this field to Yes to include pallet locations in the export file data.

## Exporting a Data File

To export a data file:

- 1 Press the Report button to display the Report screen in the center viewport.  
**System toolbar > Report button**
- 2 Select the desired report format from the Report Format menu.  
**Report toolbar > Report Format button**
- 3 Press the Export Data button to display the Export Data menu  
**Report toolbar > Export Data button**
- 4 The exported data file will be written to the location designated in the File Locations Settings screen and a message will appear indicating a successful export of data.

## Direct Data Transfer to Excel

Measurement data can be exported directly to new or existing Excel spreadsheets. Export M3 specific report formats or populate existing quality reports using the custom export options.



### **NOTE**

*The Custom Excel Transfer option is OFF by default. This option can be enabled by navigating to the Desktop Settings screen and setting the Display New Excel Button to "Desktop".*




### **NOTE**

*Direct data export to Excel requires that a licensed copy of the Microsoft Excel application is already installed and activated. It also assumes that the target sheet is NOT open (if exporting to an existing sheet).*


### **Direct to New Sheet Export**

When viewing measuring results in the M3 Data View the Export to Excel button (found in the bottom toolbar) can be used to export the current data view directly to an Excel spreadsheet. When executed the system will open a new instance of the Excel Application, open a new Workbook, and then populate a blank sheet with the M3 data.

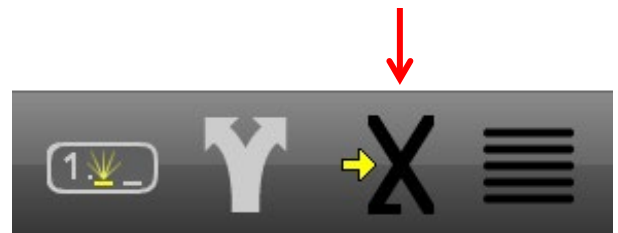

## **Export to Existing/Custom Excel Sheet**

When viewing measuring results in the M3 Data View the Export Custom Excel button can be used (from the Export Menu) to send data to an existing Workbook and Worksheet. Custom export parameters can also be set using the flags in the Export Dialog (dialog described below).

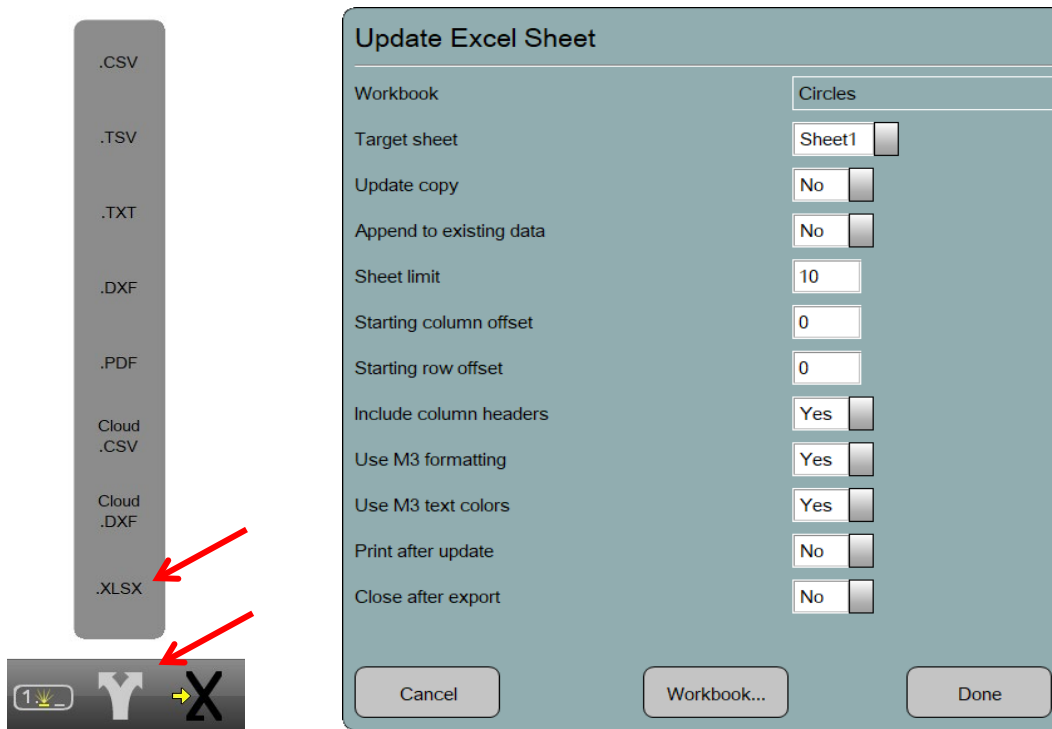

**Cancel Button** – Cancels the current Export and return the operator to the Data view.

**Done Button** – Accepts the current Export Settings and executes the data export.

**Workbook Button** – Press to select an existing Excel Workbook file. Data will be sent to this file.

**Target Sheet** – Once a Workbook has been selected from the Workbook button, select the target worksheet from the worksheet dropdown. This list will be populated with sheets detected within the selected workbook.

**Update Copy** – When set to Yes the target worksheet will be duplicated in the workbook and the new data will be sent to it.

**Append to Existing Data** – Set to Yes to append current data view contents to the end of the data within the current worksheet. Set to No to overwrite existing sheet contents.

**Sheet Limit** – Sets the maximum number of new worksheets that can be created within a workbook.

**Starting Column Offset** – Sets a cell column offset for the data entry starting point within the worksheet. The offset is specified from cell 1,1 within the target sheet, or from cell 1,1 relative to existing data, in the event the data is being appended.

**Starting Row Offset** – Sets a cell row offset for the data entry starting point within the worksheet. The offset is specified from cell 1,1 within the target sheet, or from cell 1,1 relative to existing data, in the event the data is being appended.

**Include Column Headers** – Set to Yes to include the data column header labels from the M3 template in the output excel sheet. Set to No to omit the header labels.

**Use M3 Formatting** – Set to Yes to enable M3 template emulation for the target worksheet. When set to Yes the M3 will attempt to duplicate the template characteristics from the M3, in the target worksheet.

**Use M3 text colors** – Set to Yes to set text colors in the target sheet the same as M3. This option is typically used do that failed tolerance results, in Red Text color, will be transmitted to the target worksheet.

**Print after update** – Set to Yes to execute a Printout immediately following the export. The printer settings will be used from the M3 main system setup.

**Close after export** – Set to Yes to close the target workbook and Excel application, following the export step.



## **An example of exporting to new Excel sheet**

- 1 Prepare measurement results either by measurement or by opening an existing program containing run results data.
- 2 Press the Data View button to access the M3 report data view.
- 3 If desired, use exiting template editing techniques and data filters to prepare the data for export to excel.
- 4 Press the Direct to New Sheet export button from the bottom toolbar.
- 5 An instance of Excel will open and the data will be transferred to a new spreadsheet within the workbook.



## **An example of exporting to a custom Excel sheet**

- 1 Prepare measurement results either by measurement or by opening an existing program containing run results data.
- 2 Press the Data View button to access the M3 report data view.
- 3 If desired, use exiting template editing techniques and data filters to prepare the data for export to excel.
- 4 Press the Export Menu button from the bottom toolbar.
- 5 Select the item “.XLXS” from the export menu. The custom Excel Export dialog will be displayed.
- 6 Press the Workbook button from the bottom of the dialog and browse for an existing Excel Workbook file.
- 7 Select the desired target worksheet from the Target worksheets dropdown menu.
- 8 Set the desired formatting parameters in the Custom Export dialog.
- 9 Press Done to complete the Excel Data transfer operation.





# Section 11: Programming

The M3 system records all the measurement activities that occur during a part inspection session. These activities can be saved at the end of the session as a part program to be played back later. All measurement activities are recorded and include:

- Adjusting part lighting and camera magnification
- Probe path data configurations (CNC systems with touch probe option)
- Measuring, constructing and creating features
- Stitching all or a portion of large images to fit within the field of view
- Applying tolerances
- Preparing and printing reports
- Exporting data



## NOTE

*The system supports direct recording of programs. This advanced recording mode can be enabled in Settings and activated by pressing the Advanced recording button.*



Part program files are saved in the location:

C:\Users\Public\Public Documents\MetLogix\Parts

Part program file names are in the form:

*filename.mlxpart2*

When part program files are loaded, all existing features are cleared from the Feature List making room for new features from the part program file and preparing the M3 software to repeat the sequence of recorded measurement steps. The database of previous measurement results is also loaded and is shown in the center window as a tabbed results database in one of four report formats. When a part program file is loaded that was never played back to collect feature data, the measurement results are shown as an un-tabbed report view of the original data collected as the program file was being created.

Feature	Tol	Actual	Nominal	Tol	Tsn	Deviation	Tendency	Result
Skew 1	X 0.210	Y 0.000	A 0.0000					
Line 2	X 0.000	Y 0.163	A 0.0000					
Datum 3	X 0.000	Y 0.000	Z 0.000					
Circle 4	X 0.000	Y 0.181	R 0.129					
Circle 5	X 0.000	Y 0.129	R 0.129					
Circle 6	X 0.000	Y 0.129	R 0.129					

**Program previously played to measure features**  
**Tabbed database of many run results shown**

Feature	Tol	Actual	Nominal	Tol	Tsn	Deviation	Tendency	Result
Skew 1	X 0.209	Y 0.000	A 0.0000					
Line 2	X 0.000	Y 0.163	A 0.0000					
Datum 3	X 0.000	Y 0.000	Z 0.000					
Circle 4	X 0.000	Y 0.181	R 0.129					
Circle 5	X 0.000	Y 0.129	R 0.129					
Circle 6	X 0.000	Y 0.129	R 0.129					

**Program never played to measure features**  
**Report shows only original programming measurements**

## Part Fixturing Modes

The M3 system supports three part fixturing modes:

- No part fixturing: Manual and CNC systems
- Temporary part fixturing: Manual and CNC systems
- Permanent part fixturing: CNC systems

Part fixturing is designated by editing the program properties for permanent fixturing or by responding to a user prompt when program playback is initiated for no fixturing or for temporary part fixturing. Part fixturing is discussed in detail later in this section.

### ***No Part Fixturing***

When no part fixturing is used, the user will be prompted to re-measure the features that define the part registration each time the part is measured. This mode is used primarily for quick inspections of one to a few parts in manual and CNC systems.

### ***Temporary Part Fixturing***

When temporary part fixturing is used, the user will be prompted to re-measure the features that define the part registration once, and then subsequent runs will be performed without new registration measurements. This mode is typically used to measure many parts using a manual system, or to measure many parts using the CNC system and a part fixture that will not be permanently attached to the machine.



#### **NOTE**

*In manual systems, the user is guided to perform the programmed measurements by an arrow that appears in the live video window. In CNC systems, the reference frame measurements are performed automatically.*

### ***Permanent Part Fixturing***

Permanent part fixturing is used only on CNC systems and must be specified by editing the program properties prior to saving a program. When permanent part fixturing is used, the part fixture is permanently attached to the system stage and the part registration is retained as part of the part program. Part registration measurements are performed automatically by the system each time the part program is loaded and requires no intervention by the user. This mode is typically used to measure a high volume of parts.



#### **NOTE**

*The use of permanent fixturing relies on a repeatable machine zero based on encoder reference marks. The part program can only be run after the system has performed a home operation that sets the machine zero. Encoder and other changes that might affect the position of the system's machine zero will invalidate the part registration of previously recorded programs.*



#### **NOTE**

*A program with a loaded reference frame will have fixturing mode of "File" and the part will be registered.*

## Creating a Part Program

Program steps are recorded automatically as measurements, tolerancing, reporting and other tasks are performed. When the program is complete, it can be saved, or it can be run to gather feature data and then saved. Often programs simply consist of typical measurement session steps without any special adjustments. However, it sometimes becomes necessary to adjust default system behavior to accommodate the requirements of a specific application. This is more common in multi-sensor systems that include touch probes. Two programming adjustments are:

- Adjusting Probe Path Data
- Inserting Goto steps

## Adjusting Probe Path Data

Probe path data settings define the default touch probe behavior for CNC systems and are described in *Configuring Probe Path Data* in [Section 3: Probes](#).

The default probe path data configuration can be changed prior to probing a feature as part of a measuring/programming process. Some reasons for changing the default settings include:

- Changing the non-probing speed to test a new CNC program
- Removing a clearance distance because a Goto step will be used instead
- Changing the search distance for parts with highly variable features



### NOTES

*The probe path data configuration can also be changed in the edit mode discussed later in this section.*

*When probe path data are changed, the new probe path data will be used in subsequent touch probe moves until the probe path data are changed again.*

To adjust probe path data settings:

- 1 Long-press the Goto button. The Probe Path Data dialog will be displayed.  
**Measure toolbar > Long-press Goto button**
- 2 Change the desired probe path data settings.



### NOTE

*Probe path data settings are discussed in detail in Probe Path Data in Section 3: Probes.*

- 3 Press done to return to the measuring/recording process.

## Inserting Goto Steps

Goto steps are included to avoid probe collisions by moving the probe around or over obstacles between the last point probed and the next point to be probed. Goto moves include X, Y and Z components. Goto moves can be included in addition to clearance moves.



### NOTE



*Programs that include multiple Goto moves to avoid collisions should be tested at lower non-probing speeds. Adjust non-probing speeds in the Probe Path Data dialog discussed earlier.*

To include a Goto step:

- 1 Move the touch probe to the next desired location.
- 2 Press the Goto button to display the Goto dialog.

**Measure toolbar > Long-press Goto button**

- 3 Press Done to store the new Goto location and return to the measuring process.

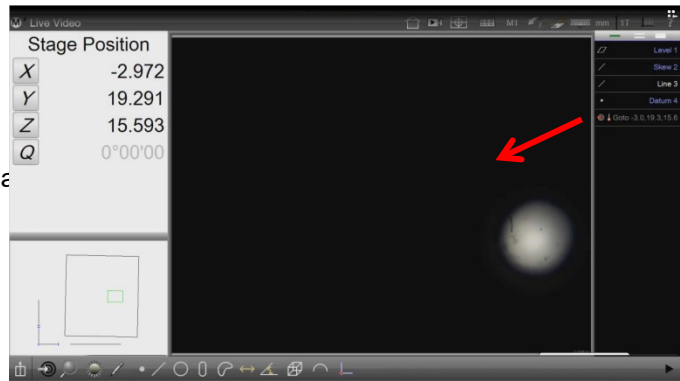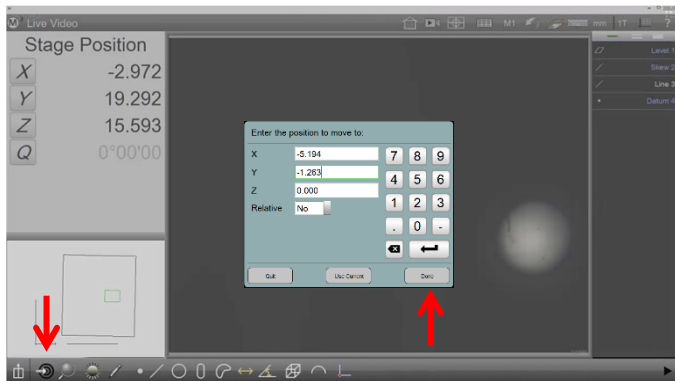

## Saving a Part Program


Part programs are created automatically as measurements and other operations are performed. However, part programs must be saved at the conclusion of a measurement session in order to be recalled and used later.

To save a part program **before running it** to collect feature data under program control:


- 1 Press the Save button. The Save Part dialog will be displayed.

**System toolbar > M3 System menu > Save**

- 2 Enter the desired part file name and press Save.

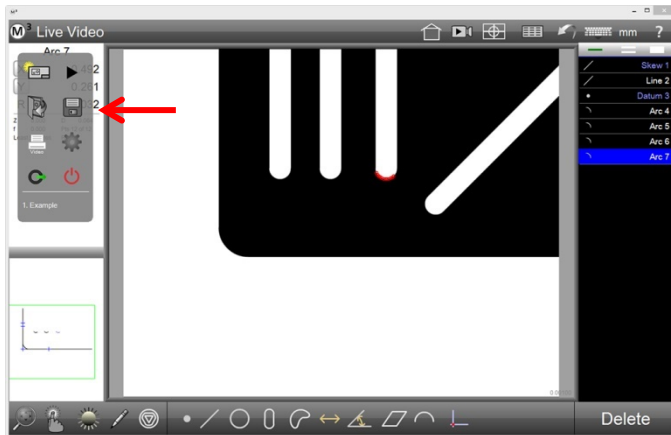

Press the Save button

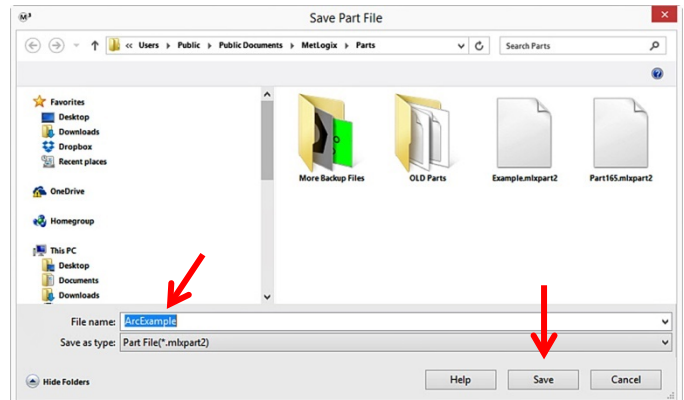

Enter the new part file Name and press Save

To save a part program **after running** to collect feature data under program control or editing it to change its behavior:

- 1 Press Yes when prompted to save the program.




OR

- 1 Press the Edit tab and then press the Save button. The Save Part dialog will be displayed.

**Feature list > Edit tab**

**System toolbar > M3 System menu > Save**

- 2 Enter the desired part file name and press Save.

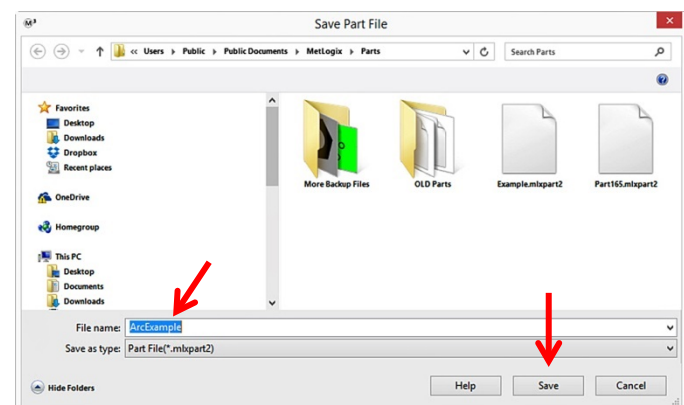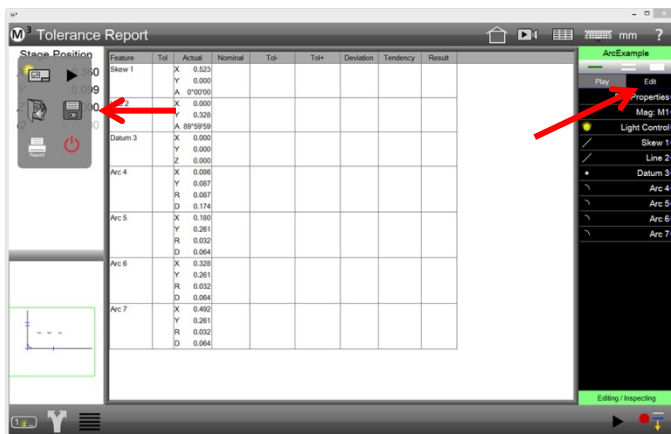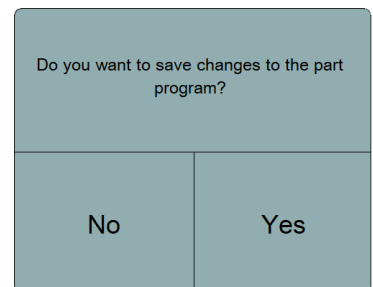



## Loading a Program for Playback


To load a program for playback:

- 1 Press the Open File button to display the Open Part File dialog.
- 2 Select the desired part file and press Open to load the file.


**System toolbar > System menu > Open File button**

OR

- 1 Press the program name in the list of recent programs  
**System toolbar > System menu > Recent program name**

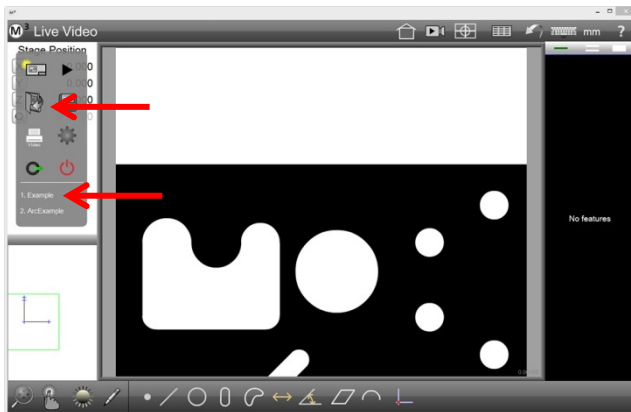

*Press the Open File button or select a recent part file*

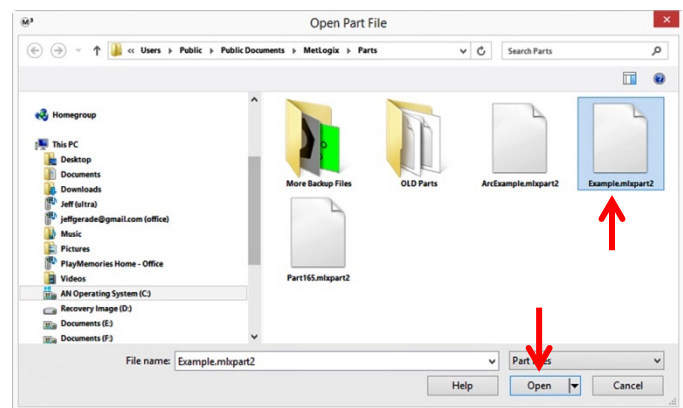

*Select the desired file and press Open*

In CNC systems, if the part program file contains permanent fixturing, the program will be loaded and executed immediately as described on the next page. In manual or CNC systems, if the part program file contains no fixturing or temporary fixturing, the program will be loaded, the program name will be shown at the top of the Feature List, the program data will be displayed for the original program steps or the previous program runs and the system will wait for the user to press the Play button or the Edit tab.

**Tolerance Report**

Example, Run 17

Feature	Tol	Actual	Nominal	Tol	Tol+	Deviation	Tendency	Result
Skew 1	X 0.210							
	Y 0.000							
	A 0°00'00"							
Line 2	X 0.000							
	Y 0.163							
	A -89°59'20"							
Datum 3	X 0.000							
	Y 0.000							
	Z 0.000							
Circle 4	X 0.605	0.600						
	Y 0.181	0.200						
	R 0.129							
	D 0.258							
	S 0.040				0.050	0.040		Pass
	f 0.001				0.050	0.001		Pass
Circle 5	X 0.894	0.900		0.050	0.050	-0.006		Pass
	Y 0.271	0.300		0.050	0.050	-0.029		Pass
	R 0.045							
	D 0.089	0.100		0.050	0.050	-0.011		Pass
Circle 6	X 1.096	1.100		0.050	0.050	-0.004		Pass
	Y 0.387	0.400		0.050	0.050	-0.013		Pass
	R 0.045							
	D 0.089	0.100		0.050	0.050	-0.011		Pass

All tolerances passed.

## Playing a Program

Programs, in the form of measurement, tolerance and other software operations are played as a sequence of program steps. When a saved part is opened, the Feature List will become populated with features that were stored in the part file the last time the file was used and either:

- A tabbed database of measurement results will be shown for a program that has been run to measure features

OR

- The original program feature data will be displayed for a program that was never run to measure features

**Tolerance Report**

Example, Run 17

All tolerances passed.

Feature	Tol	Actual	Normal	Tol	Tol	Deviation	Tendency	Result
Skew 1	X 0.210	Y 0.000	A 0.0000					
Line 2	X 0.000	Y 0.163	A 0.0000					
Datum 3	X 0.000	Y 0.000	Z 0.000					
Circle 4	X 0.000	Y 0.000	Z 0.000					
Circle 5	X 0.000	Y 0.000	Z 0.000					
Circle 6	X 0.000	Y 0.000	Z 0.000					

*Program previously played to measure features  
Tabbed database of many run results shown*

**Tolerance Report**

Example, Run 0

All tolerances passed.

Feature	Tol	Actual	Normal	Tol	Tol	Deviation	Tendency	Result
Skew 1	X 0.200	Y 0.000	A 0.0000					
Line 2	X 0.000	Y 0.160	A 0.0000					
Datum 3	X 0.000	Y 0.000	Z 0.000					
Circle 4	X 0.000	Y 0.000	Z 0.000					
Circle 5	X 0.000	Y 0.000	Z 0.000					
Circle 6	X 0.000	Y 0.000	Z 0.000					

*Program never played to measure features  
Report shows only original programming measurements*

## Playing Programs with Permanent Fixtures (CNC only)

When programs with permanent fixturing are loaded to a CNC system, the program will execute immediately after the user confirms that stage movements are safe by responding to the CNC prompt message. The program run will fill the Feature List with fresh measurement data.



### NOTE

*Permanent fixturing is designated for a part program in the edit mode and is discussed later in this section.*

CNC playback is about to begin.	
Pause Playback	Proceed

## Playing Programs with a Temporary or no Fixture

The choice between temporary fixturing and no fixturing is made by responding to a user prompt that appears when the user plays the loaded program. The prompt asks if the part is in the same location as the last run. To play a part with temporary or no fixture:

- 1 Press Yes if the fixture is temporary.

OR

- 2 Press No if there is no fixture

- No fixture: The user must register each part before measuring
- Temporary fixture: When the user runs the program, the system prompts the user to determine if the same part registration can be used again. If the part will be in the same location, the system will run the program without requiring a new part registration. If the part location is different, the system will require a new registration.

- 3 Follow the red arrow into green circle and part view guidance to perform measurements.

Is the Part in the same approximate location?	
No	Yes

**NOTE**

*When stage positions present more than one target feature in the field of view, all the features in the field of view will be measured in the correct playback sequence.*

## Editing programs

All part programs can be edited unless the program author locked editing in the Allow Program Editing settings of the Program Properties step.

**NOTE**

*Program Properties can be edited again to restore editing capabilities if required.*

Changes made to an existing program will be reflected in subsequent program runs for the current program file session. If the file is reloaded, changes will only be reflected if the program file was saved. The user will be prompted upon exit to save if desired.


Program editing is performed using tools in the Feature (program steps) list and in the Edit toolbar: Editing functions include:

- Change program properties
- Change CNC probe path data
- Edit CNC Goto moves
- Change lighting
- Change Magnifications
- Change feature tolerances
- Play program
- Play from here
- Add program steps
- Enable or disable probe CNC approach and clearance moves
- Re-measure features
- Add CNC step and repeat measurements
- Add user messages or request data
- Delete program steps

## Initiate Edit Mode

To edit a part program:

- 1 Load the program file as explained earlier if necessary.
- 2 Press the Edit tab at the top of the Feature List to display the detailed view of program steps and the Program Edit toolbar.

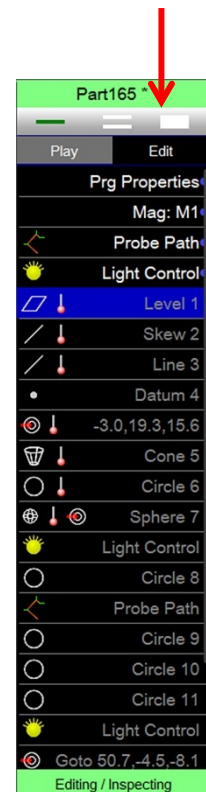

## Change Program Properties

To edit Program Properties:

- 1 Press the Program Properties program step to display the Program Properties dialog. Press drop-down boxes and make selections to satisfy the needs of your application:
  - **Allow program editing:** No to lock out program edits
  - **Linear units:** Default linear units
  - **Angular units:** Default angular units
  - **Search zone:** Sets the default VED edge finding zone, in pixels, for measurements in program playback. Applies to all VED measurements.
  - **Times to run:** Set the number of times to run the program.
  - **Disable playback guidance:** Yes to disable graphic guidance for manual users
  - **FOV playback mode:** Yes for field of view systems (video only, no encoders)
  - **Multiple parts in FOV playback:** Yes to measure multiple identical parts in the FOV
  - **Max runs:** Limit of runs in the runs database (push-down stack)
  - **Permanent fixtured:** Yes to designate permanent fixturing for CNC system
  - **View at end of playback:** Replace default (Home) view of tabbed runs results database with different view upon program completion
  - **Next part to run:** Shows a part program filename of a saved part to be run after the current part program completes executing. The assignment is done by pressing the **Link Part** button.
  - **Stop playback on tolerance failure:** Yes to stop executing the program if a feature fails tolerance.
  - **Palletize button and check box:** Press the Palletize button to create a pallet. Check/uncheck the check box next to the button to enable/disable the pallet program execution.
  - **Link Part:** Assign a saved part to be run after the current part program completes executing. The part program filename appears in the **Next part to run** field.

Program Properties

Allow program editing

Yes ☐

Linear units

mm ☐

Angular units

DMS ☐

Search zone

40

Times to run

1

Disable playback guidance

No ☐

FOV playback mode

No ☐

Multiple parts in the field-of-view playback

No ☐

Max runs

25

Permanent fixtured

No ☐

View at end of playback

Results View ☐

Next part to run

Stop playback on tolerance failure

No ☐

Palletize

☐

Link Part

Done

- 2 Press Done to return to the Feature (program steps) list.

## Change CNC Probe Path Data

To edit probe path data for touch probe enabled systems:

- 1 Long-press the Probe Path Data step to display the Probe Path Data dialog.
- 2 Refer to *Probe Path Data* in Section 3: Probes for configuration information.



### NOTE

*The Probe Path step can be recorded into the program at any position.*

**Probe Path**

Approach Distance	3.000
Search Distance	3.000
Clearance Distance	12.000
Retract Distance	3.000
Retract Speed	100.000
Probing Speed	20.000
Non Probing Speed	100.000

Buttons: Quit, Done

## Edit Goto Moves

To edit a Goto move:

- 1 Long-press the Goto Move step to display the Goto dialog.
  - **X,Y,Z:** Change position
  - **Relative:** No for absolute position
  - **Use Current:** Press to zero at current position
  - **Quit:** Press to cancel edit
- 2 Press done to return to the Feature (program steps) list.

**Enter the position to move to:**


X	-203.2675
Y	-0.081
Z	71.5456
Relative	No

Buttons: Quit, Use Current, Done

## Change Lighting

To change light settings:

- 1 Long-press the lighting step to display the lighting adjustments.
- 2 Press and drag the lighting sliders to adjust the lighting.
- 3 Press in the screen to close the light adjustment function.

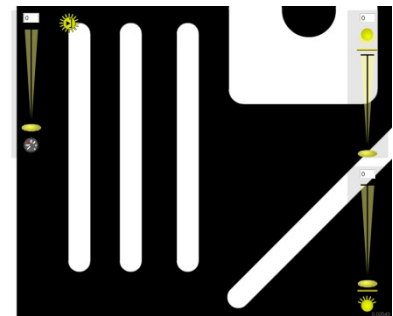

## Edit VED probes

To edit a feature step VED probe:

- 1 Select the target feature or features whose VED probes you want to edit.
- 2 Press the VED probes edit button. The Edit VED Probes dialog is displayed.
- 3 Make the desired changes in the Edit VED Probes dialog then press Done to save the changes and exit the dialog.

**Prg Properties**

Mag: M1
Light Control
Skew 1
Line 2
Datum 3
Circle 4
Line 5



**Edit VED Probes**

Edge Type	Direction
<input type="radio"/> Light to Dark <input type="radio"/> Dark to Light <input checked="" type="radio"/> Auto	Circles/Arcs/Slots <input type="radio"/> To Inside <input type="radio"/> To Outside
Stitch Length	
40 pixels	
<input type="checkbox"/> Auto Focus	

Buttons: Quit, Video Edit, Done




## NOTE

*The Direction is dependent on the type of feature selected.*

## Change Magnification

To change the magnification:

- 1 Long-press the Mag step to display the magnification menu.
- 2 Select the desired magnification.
- 3 Press the magnification menu to close it.

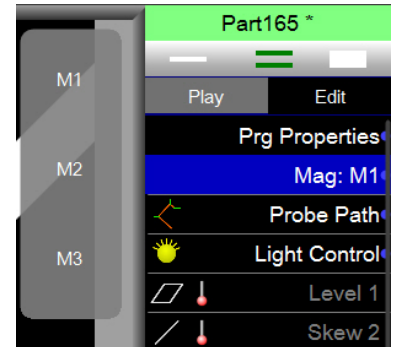

## Change Feature Tolerances

To change a feature tolerance:

- 1 Select the feature step.
- 2 Press in the small Feature Detail in the top-left viewport to display the Feature Detail screen.
- 3 Apply or change tolerance parameters as described in [Section 8: Tolerancing](#).
- 4 Press Done twice to return to the Feature (program steps) list.

## Examining feature step details

A feature step in a program may include sub steps. Sub steps are unique to each to the containing feature super step. To examine the contents of a super step:

- 1 Long-press on the target super step. The super step expands, revealing its contained sub steps.
- 2 Select and edit individual sub steps if editing is enabled on the target sub step.
- 3 Long-press on the super step to contract it.



## Play Program

To play the program:

- 1 Press the Play button.  
**Edit toolbar > Play button or tab**  
 OR  
**System toolbar > M3 System menu > Play button**  
 OR  
**Feature list > Play tab**



## Play from Here

Program playback can begin at a specified program step. When playing from a selected step, the software will determine the requirements for generating feature context. If context dependent features have already been measured, the system will advance immediately to the selected step. If it is determined that additional context information is required, the operator will be prompted to measure the feature or features required to do so.

To play from a selected step:

- 1 Press the Play from Here button  
**Edit toolbar > Play from Here button**



# Video Inspection Software User's Guide

As mentioned earlier, context dependent steps will be executed automatically or prompted for manually and then playback will begin from the selected step.

## Add Program Steps

New program steps can be added to existing programs. To add a program step:

- 1 Select the program step where you would like your new program operations to be added. These new program operations will be inserted after the selected program step. If no program step is selected after entering the Edit mode, program steps are added to the end of the program.
- 2 Press the Record Into button. A blue Edit Pin will be positioned at the point of new step insertion.

**Edit toolbar > Record Into button**



## Add Program Steps

New program steps can be added to existing programs. To add a program step:

- 1 Select the program step where you would like your new program operations to be added. These new program operations will be inserted after the selected program step. If no program step is selected after entering the Edit mode, program steps are added to the end of the program.
- 2 Press the Record Into button. A blue Edit Pin will be positioned at the point of new step insertion.

**Edit toolbar > Record Into button**



### NOTE

*When editing a program that has already been played back, the context generation will occur automatically, filling in context dependent program steps automatically from the previously acquired program data. For programs that have not yet been played back, the software will prompt the operator to manually measure all context dependent features prior to completing the context generation.*

- 3 Once the Record Into edit command has been initiated, the user can measure or construct new features or insert export or print command steps according to the standard software procedures discussed earlier.
- 4 When the step or steps have been added, press the Edit tab to leave the Record Into mode. The added program steps will be shown in the current program edit list.
- 5 Press the save button to save the program with the new steps included.

**System toolbar > M3 System menu > Save button**

## Enable or Disable CNC Clearance Moves

Clearance moves are made before and after probe contact with the target surface and are described in Probe Path Data in [Section 3: Probes](#). Clearance moves are enabled by default but can be disabled together or independently when they are not adequate to prevent probe collisions during CNC moves in and around complex feature geometry and must be replaced with Goto moves.

To enable or disable clearance moves:

Press the (retreat ↑) Clearance or (approach ↓) Clearance button to toggle between enabled and disabled.



**Enabled**



**Disabled**



## Re-measure Feature Steps

Program feature steps can be re-measured in the Edit mode. To re-measure a step:

- 1 Select the program step of the feature that you would like to re-measure.
- 2 Press the Re-measure Feature edit button.

**Edit toolbar > Re-measure Feature button**



- 3 You will be prompted to re-measure the selected feature. Re-measure the feature and then press Done when finished. The fresh feature data will replace the existing data within the program.



### NOTE

*The Re-measure edit command is commonly used to record new environment variables along with the feature measurement for a given step within the program. The new feature program step will contain all program variable information that exists at the time that the Re-measure command was executed. Information such as point spacing and light levels will be changed to reflect the context of the new measurement.*

- 4 Press Save to save the revised program steps to the currently loaded program.

**System toolbar > System menu > Save button**

## Add CNC Step and Repeat steps



The addition of CNC step and repeat steps greatly simplifies the measurement of features that appear in an organized matrix on the surface of a part, such as a matrix of drilled holes in rows and columns. The step and repeat function duplicates one or more feature program steps (excluding datum steps) in a matrix that is defined by the user.

To create a matrix of duplicate program steps:

- 1 Select the desired program feature steps in the Feature (program steps) list. Use a multi-select tool at the top of the feature list if necessary.
- 2 Press the Step and Repeat button to display the Step and Repeat dialogue.

**Edit toolbar > Step and Repeat button**

- 3 Enter the desired:
  - Number of columns
  - Number of rows
  - Column spacing in the current unit of measure
  - Row spacing in the current unit of measure

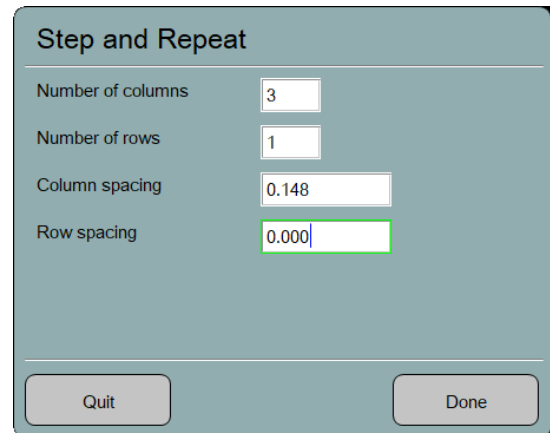
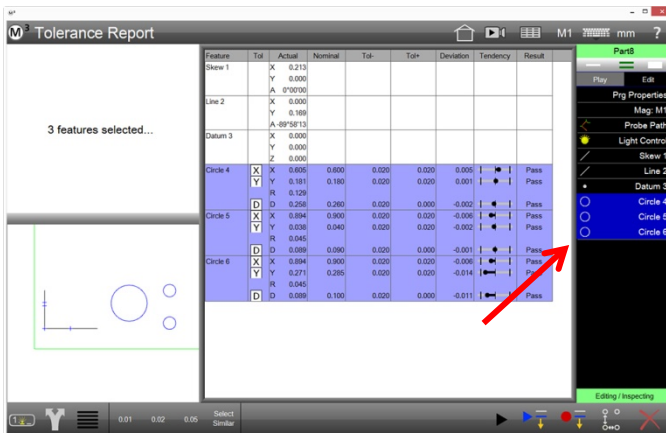


- 4 Press Done. The new program steps will be added to the feature list and shown in the Part View viewport.

# Video Inspection Software User's Guide

5 Save the part.

**System toolbar > M3 System menu > Save**

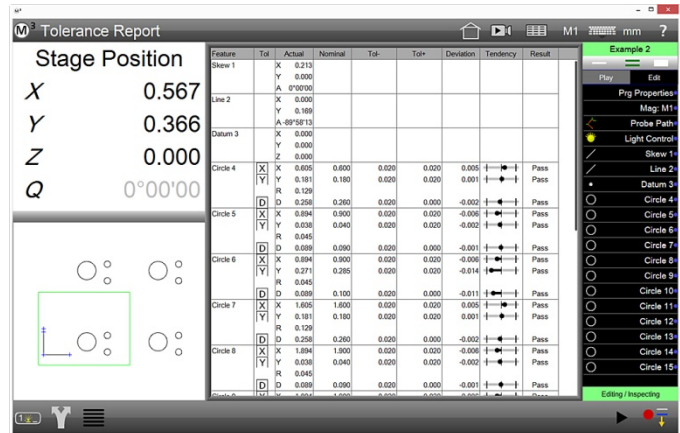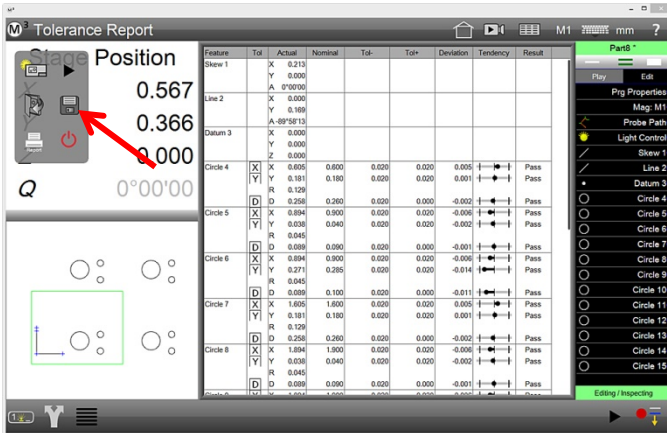

## Step and Repeat function

The Step and Repeat function is used to duplicate measurements and constructions in a part program, increasing programming speed for inspection tasks with large numbers of features.



### NOTE

*The Step and Repeat function is disabled by default. It can be enabled by setting the Always allow step and repeat field in Programs of system Settings to Extra.*



There are two options of the Step and Repeat function: cartesian and polar.



### Cartesian Step and Repeat

To create a program that utilizes the cartesian step and repeat:

- 1 Measure a reference frame (or load one from file).
- 2 Perform the seed measurements that you want to step and repeat.
- 3 Select the seed features, click on the Cartesian step and repeat button.
- 4 Enter the required information according to the desired step and repeat operations.
- 5 Press the Done button when complete.

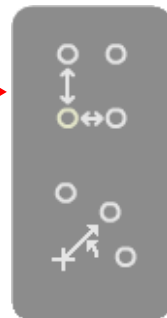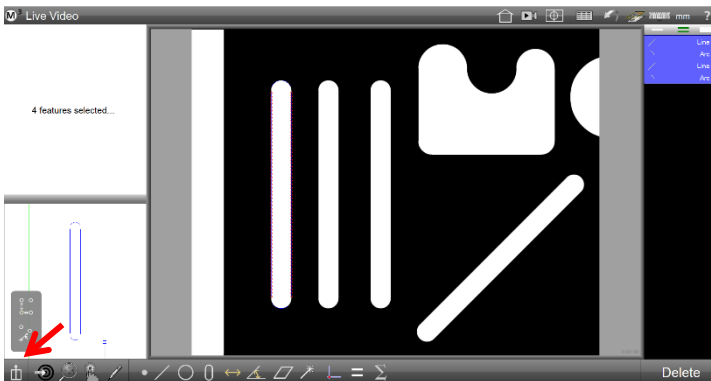

Step and Repeat

Number of columns

Number of rows

Column spacing

Row spacing

Quit

Done

# Video Inspection Software User's Guide

**Number of columns** – Designates the number of columns to be created in the step and repeat grid.

**Number of rows** - Designates the number of rows to be created in the step and repeat grid.


**Column spacing** – Designates the distance to be used between columns in the step and repeat grid.

**Row spacing** – Designates the distance to be used between rows in the step and repeat grid.

## **Polar Step and Repeat**

To create a program that utilizes the polar step and repeat:

- 1 Measure a reference frame (or load one from file).
- 2 Perform the seed measurements that you want to step and repeat.
- 3 Select the seed features, click on the Polar step and repeat button.
- 4 Enter the required information according to the desired step and repeat operations.
- 5 Press the Done button when complete.

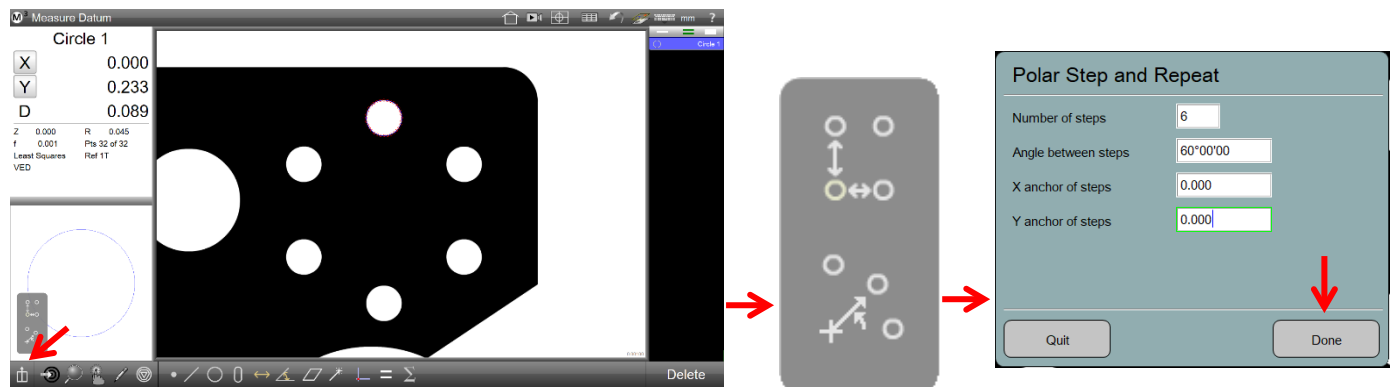

**Number of steps** – Designates the number of instances of the selected features to be created in the polar array.


**Angle between steps** – Designates the angle to be created between instances of the selected features in the polar array.

**X anchor of steps** – Designates the X position to be used for the origin of the polar array.


**Y anchor of steps** – Designates the Y position to be used for the origin of the polar array.

## **Adding a User Message or Request Data**

User messages and images can provide useful information or instructions during program playback. Data provided by the user can enhance information provided on reports. The user message function can be included in programs during program creation or program editing for:

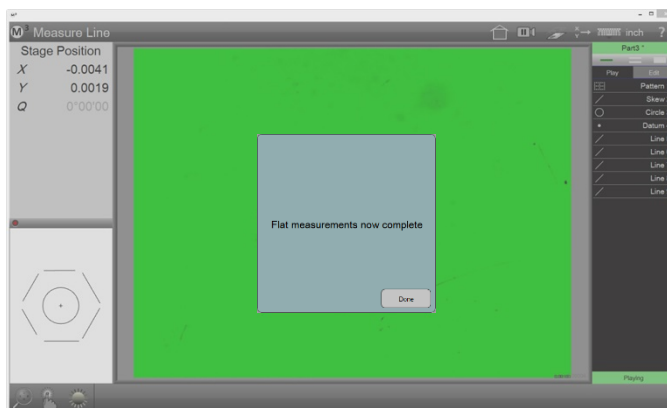

***Text message during program playback***

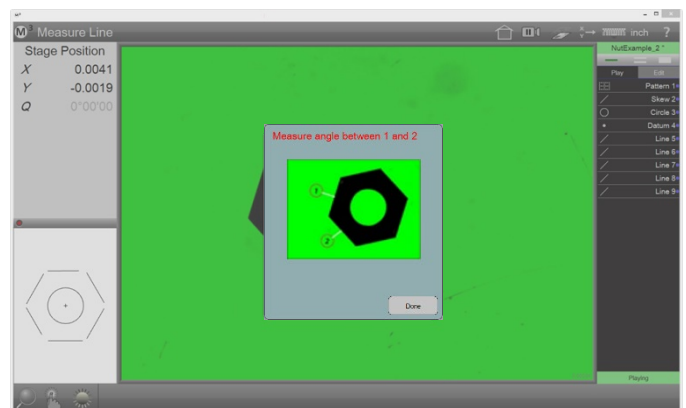

***Text message with image during program playback***

# Video Inspection Software User's Guide

- Displaying user messages and images
- Requesting user data (variables)

## Adding User Messages and Images

To include user messages and images in a part program:




- 1 During program creation: If your system is configured to include the Ask button in the Extra menu, press the Extra menu button and then press the Ask button to display the User Message dialog.

**Measure toolbar > Extra Menu  
button > Ask button**


OR

- 1 During program editing: Select the program step before the desired insertion point and then press the Ask button to display the User Message dialog.


**Program Edit toolbar > Ask button**

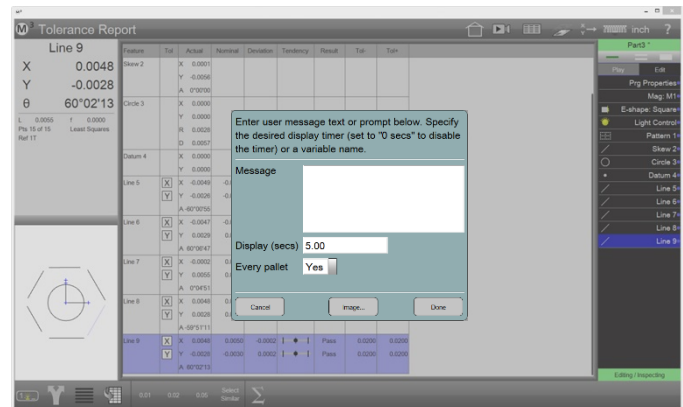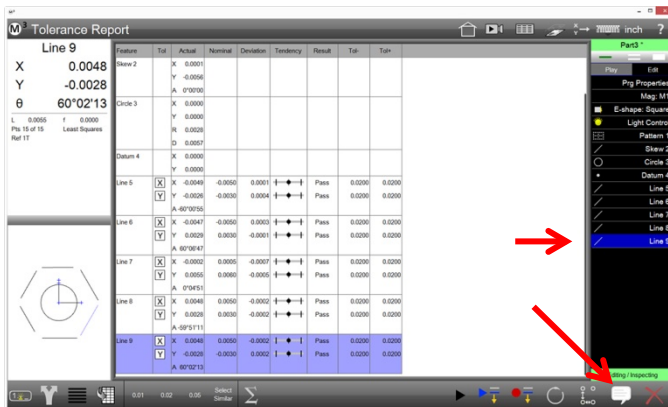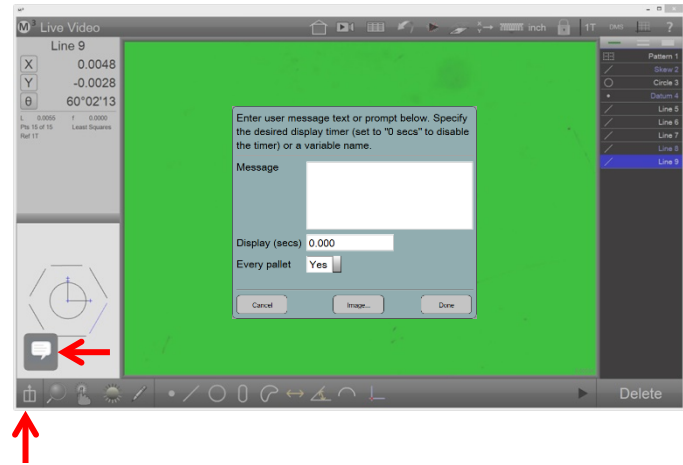

- 2 Enter a message into the Message field and then enter a message display period into the Display field.

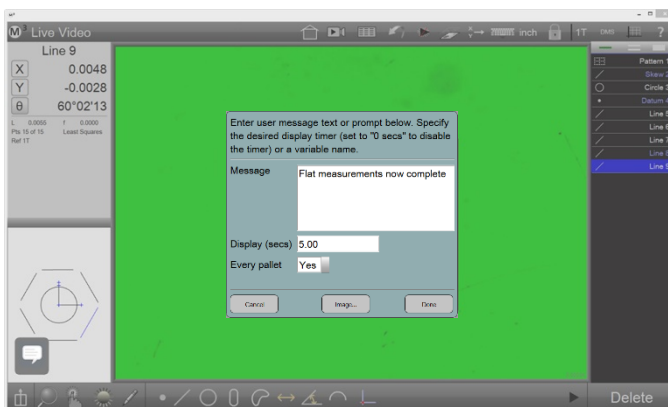

**Message entered while programming**


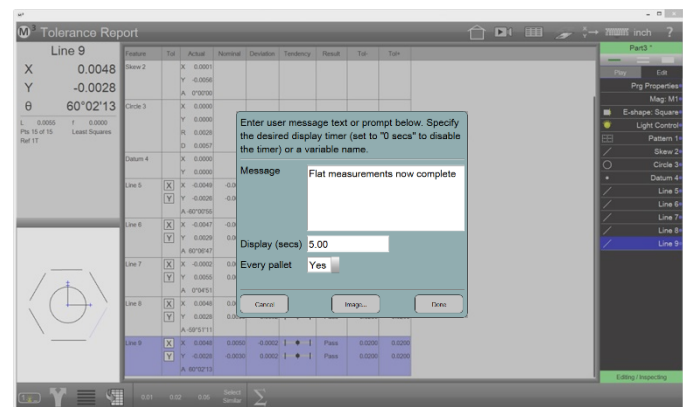


**Message entered while editing**

- 3 Press the Image button to include an image with the message. A browse dialog will be displayed. **If no message is desired proceed to step 5.**

# Video Inspection Software User's Guide

- 4 Navigate to and select the desired bitmap (.bmp) image and press Save. The image should be no more than approximately 320 by 240 pixels.

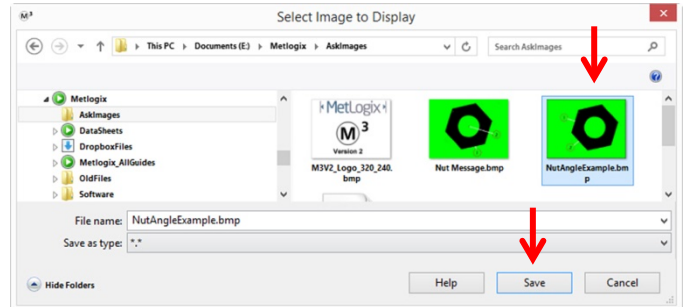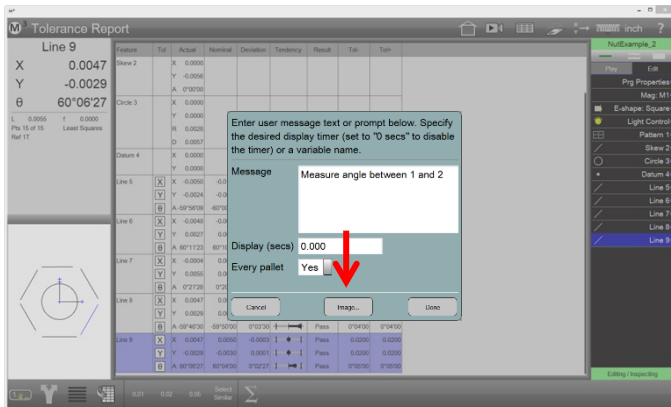

- 5 Press the Done button to insert the message. The message will be displayed at the appropriate point when the program runs.

## Requesting User Data (Variables)

Variable data provided by the user at run time is shown in report template headers and reports. To include requests for user data in a part program:



- 1 During program creation: If your system is configured to include the Ask button in the Extra menu, press the Extra menu button and then press the Ask button to add a request for data at the desired point in the program execution.

**Measure toolbar > Extra Menu button > Ask button**

OR


- 1 During program editing: Select the program step before the desired insertion point and then press the Ask button.

**Program Edit toolbar > Ask button**

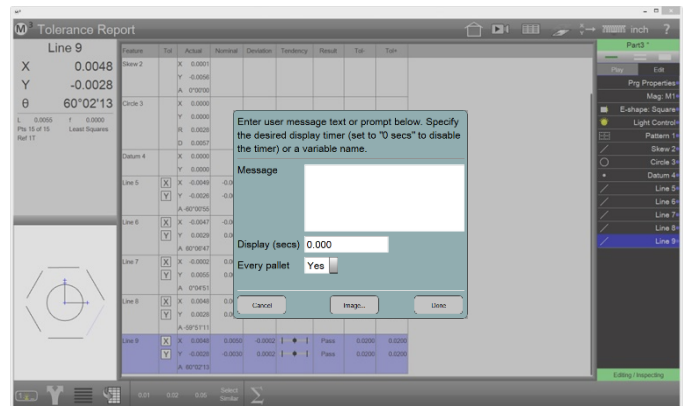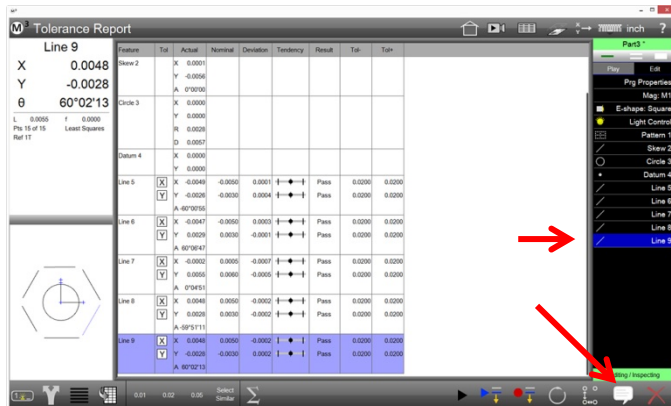


- 2 Enter the data request message into the Message field.
- 3 Enter the variable name that will be assigned to the data on template headers and reports into the Display field. The field title will change from Display to Variable Name. The variable name should reflect the reason for the data. For example, if the data request message asks the user to "Enter the lot number", then the variable name should be "Lot number".

# Video Inspection Software User's Guide

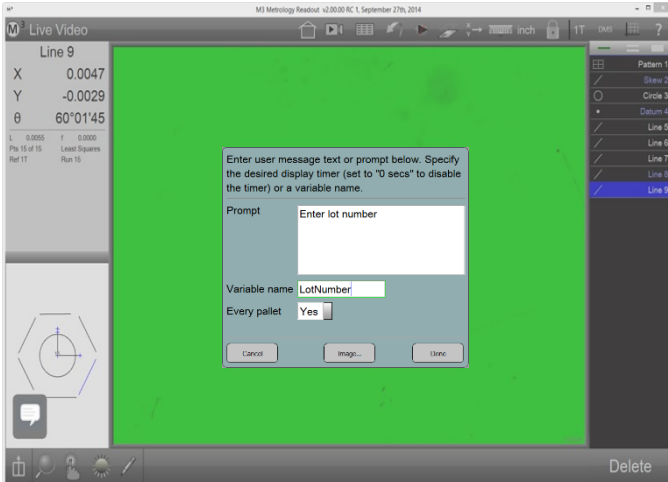

*Data request entered while programming*

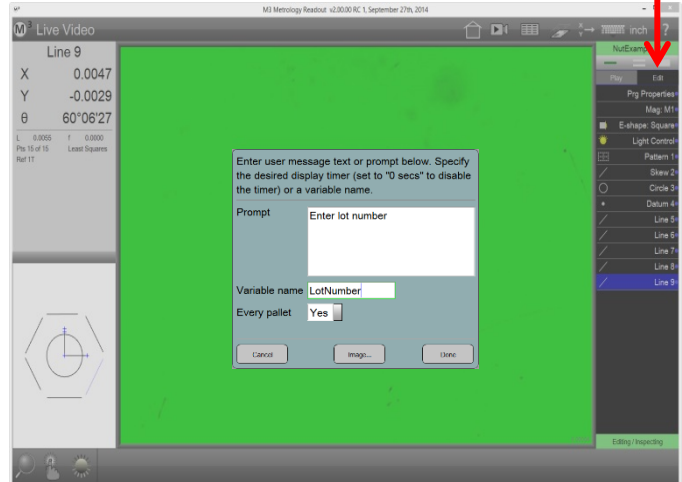

*Data request entered while editing*




## NOTES

*The leading character of the variable name must be an alpha character.*

*Do not include an image when creating a request for data.*

The system will request user data at the appropriate point when the program runs. The data variable name and user-provided data will be displayed on template headers and on reports.

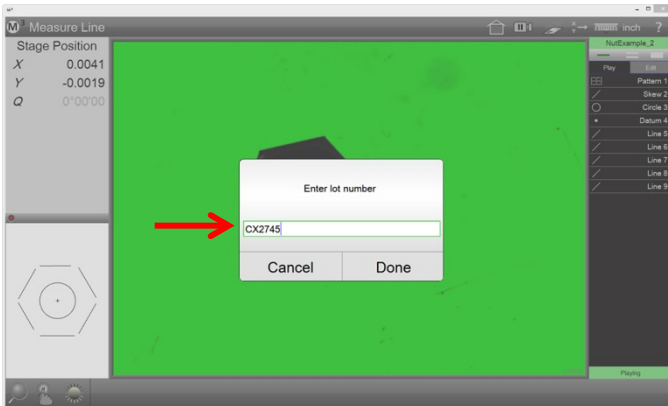

*Data provided during run time*

17 Today 16 Today 15 Today 14 Today 13 Today 12 Today 11 Today 10 Today									
[Lot number] CX2745									
Feature	Tol	Actual	Nominal	Deviation	Tendency	Result	Tol-	Tol+	
Circle 3	A	0°00'00							
	X	0.0000							
	Y	0.0000							
	R	0.0028							
Datum 4	D	0.0057							
	X	0.0000							
Line 5	Y	0.0000							
	X	-0.0050	-0.0100	0.0050		Pass	0.0200	0.0200	
	Y	-0.0024	-0.0020	-0.0004		Pass	0.0200	0.0200	
	θ	A-60°00'24	-60°00'00	-0°00'24		Pass	0°04'00	0°04'00	

*Variable name and Data shown on template header*

## Deleting Program Steps

To delete a program step:

- 1 Select the program step that you would like to delete.
- 2 Press the Delete Program Step button. The selected program step will be deleted.

**Edit toolbar > Delete Program Step button**



- 3 The step is deleted from the current program playback session. Press the Save button to permanently apply the deletion to the part program.


**System toolbar > System menu > Save button**




## DXF Import and Auto Programming

The M3 system will convert DXF part drawing files into part programs using the DXF import and Auto Program module. To convert a DXF drawing file into a part program:


- 1 While the M3 program is in the interactive mode, press the Open Part button to display the Open Part dialog.  
**System toolbar > System menu > Open Part button**
- 2 Select DXF from the File Type menu, select the desired file and press Open. The import DXF Dialog will be displayed.

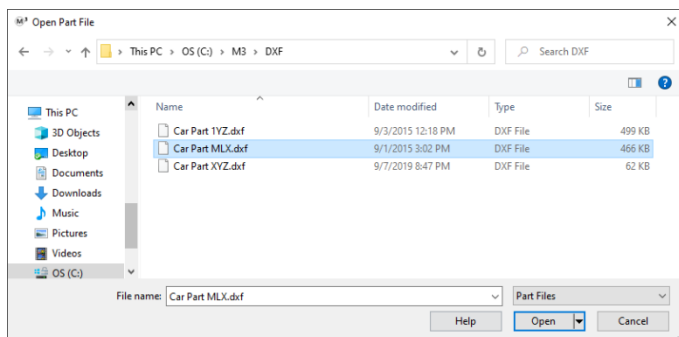

**Import DXF part file**

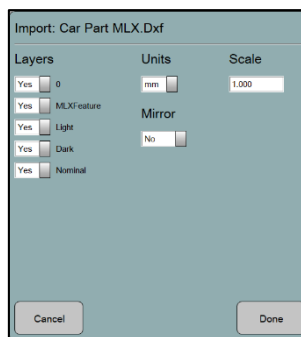

**Choose DXF parameters**

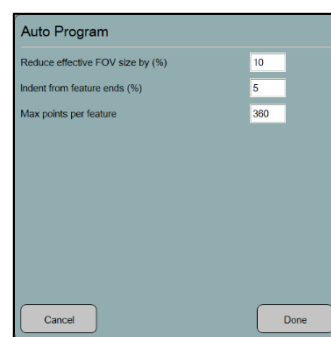


**Specify auto program parameters**

- 3 Choose the desired layers for import, the unit type for import, and specify the desired scale factor to be used for import and then press “Done” to continue. The DXF features will be added to the Feature List with DXF tags,
- 4 Trim (delete) features from the imported DXF file that you do not want to be part of the resulting auto-program.
- 5 Specify registration (datum) features to be used for the auto program registration by performing datum operations directly on the DXF features using reference frame operations described earlier in [Section 7: Reference Frames](#). The specified registration features will be moved to the top of the Feature List.
- 6 Press the Play Button to display the Auto Program dialog and initiate the auto program process.  
**System toolbar > System menu > Play button**
- 7 Specify the desired number of points per feature to be programmed, the desired FOV size to be used at each stage location, and the indent margin to be used for positioning point clouds from the DXF element feature ends, and then press Done to continue.
- 8 The auto program path will be generated by the system and program playback will be initiated. Probe the registration features specified on the DXF part image. Program playback will proceed once registration is complete.
- 9 Press the Single Step button to initiate single step playback.

### **Edit toolbar > Single Step button**

- 10 In the single step mode, use the left and right step buttons, or keyboard arrow buttons to advance or rewind the program, one step at a time.
- 11 Perform program edit commands as needed to complete the playback of the auto programmed part.
- 12 Press the Save button to save changes when the program is complete to store changes made to the program.

### **System toolbar > System menu > Save button**

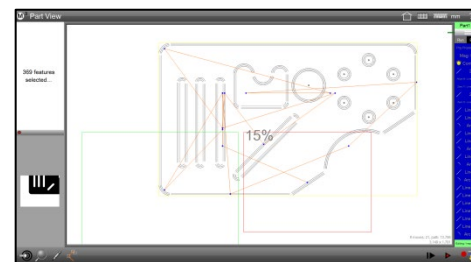


**Auto program path generated**

## Cut/Copy/Paste Program Steps

Program steps (non-datum steps) can be cut/copied and paste into the program. To do this:

- 1 Author a program and switch to edit mode.
- 2 Select the program steps to be cut or copied (copied in the example below).



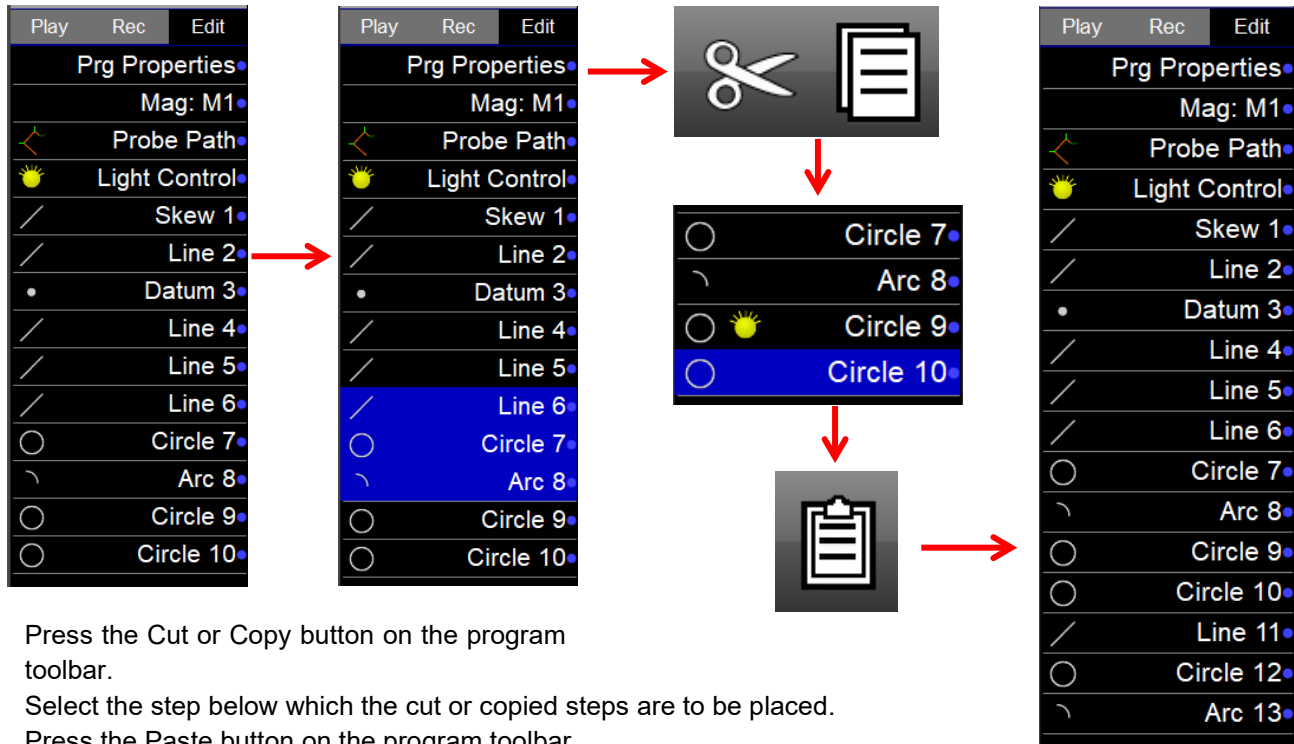


- 3 Press the Cut or Copy button on the program toolbar.
- 4 Select the step below which the cut or copied steps are to be placed.
- 5 Press the Paste button on the program toolbar.

## Pallet Program Creation

Quickly duplicate part programs for CNC playback within a palletized fixture. Specify the desired number of pallet rows and columns and their spacing, then create your pallet program in one click.

To create a pallet program:

- 1 Generate the part program to be used for pallet program duplication.
- 2 From the program edit mode, select the Program Properties step and press the Palletize button to access the Regular Palletize screen.
- 3 Specify the number of pallet columns and rows, and their spacing (in the currently selected units) to be used for the pallet.
- 4 Press the Skew Fixture button to assign a skew adjustment for the pallet fixture being used. The Fixture Skew will be associated with this pallet program until it is updated by a new Skew Fixture operation.

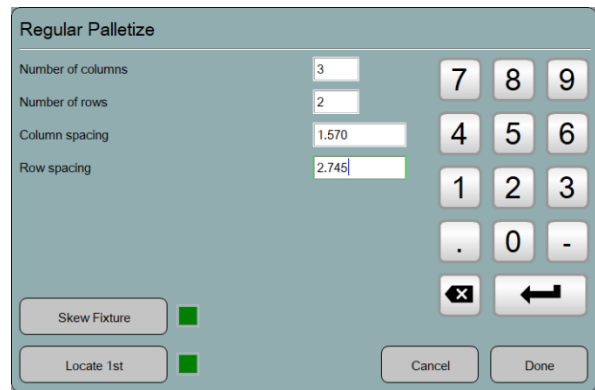

### NOTE

*The Skew Fixture operation initiates an interactive feature measurement session. Probe all the features necessary to generate the skew alignment for the fixture, or explicitly probe a skew feature.*

- 5 Press the Pallet Done button from the bottom toolbar once the skew has been generated.
- 6 After generating a Skew for your pallet program, press the Locate 1st button. The system will prompt the operator to probe the registration features of the first part to be used for the pallet program. This sets the origin part program for the pallet program.



## IMPORTANT NOTE

*Skew and Locate First for pallet programs must always be performed as a pair, and in that order. The skew and origin part for a pallet program can be updated by re-executing the above two steps, skew first, then locate first.*

- After establishing skew and origin part for the pallet, press play to begin pallet playback. The pallet pocket selection dialog will be displayed. Toggle the pocket locations to specify them as active or inactive for the subsequent program playback. Enabled pockets will be measured, disabled pockets will be skipped. Press Done to accept the selections.


The system will playback the part program at each enabled pallet location. At the end of playback, the pocket selection dialog will be displayed again indicating pockets that contain features with failed tolerances.

## Pallet Program Creation with a loaded reference frame from file

A pallet program can be created using a saved reference frame. When the saved reference frame is loaded from file, it is used for skew fixture and locate 1st as shown in the steps in a regular palletize program.

To create a pallet program with a loaded reference frame from file:

- At the beginning of generating a program, load a saved reference frame from a file, then author the remaining parts of the program to be used for pallet program duplication.
- From the program edit mode, select the Program Properties step and press the Palletize button to access the Regular Palletize screen.
- Specify the number of pallet columns and rows, and their spacing (in the currently selected units) to be used for the pallet.
- Press Done to save the pallet details and exit the regular palletize dialog.
- Click on the checkbox next to the Palletize button to turn it green (indicating the program is a pallet program).

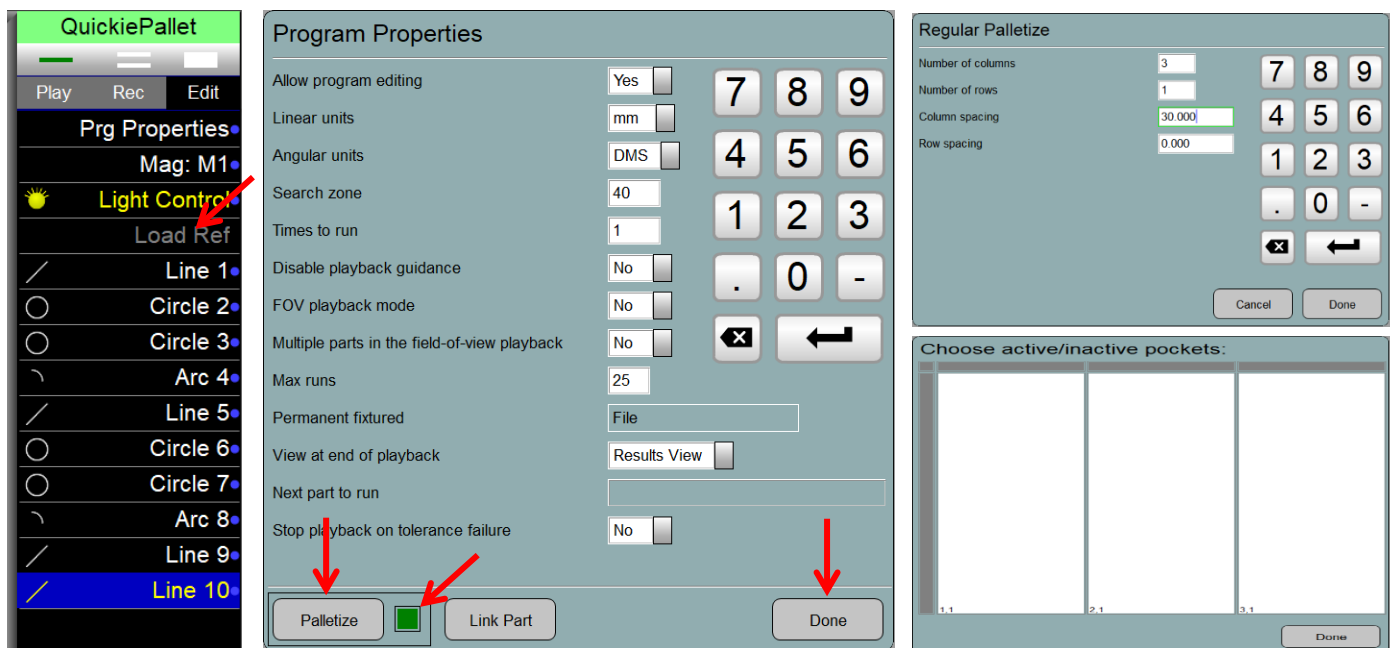

- Press the Done button to save the changes and exit the program properties dialog. The system will playback the part program at each enabled pallet location.

## Editing a pallet program



A pallet program can be edited but user must take care in case of recording in new probed features. The features must be probed in the pocket that is to be executed first. To edit a palletized program:

- 1 Click on the Edit tab to begin editing the program.
- 2 Generate context in the pocket of the pallet to be measured first.
- 3 Make the desired changes to the program.
- 4 Press the Play tab to play back the edited pallet program.



### IMPORTANT NOTE

*Once the program playback has progressed past the first pocket of measure, ONLY the PLAY tab is available. Program cannot be edited at this point. Operator must either reload the program or restart playback from first pocket and pause it while executing first pocket to edit it.*

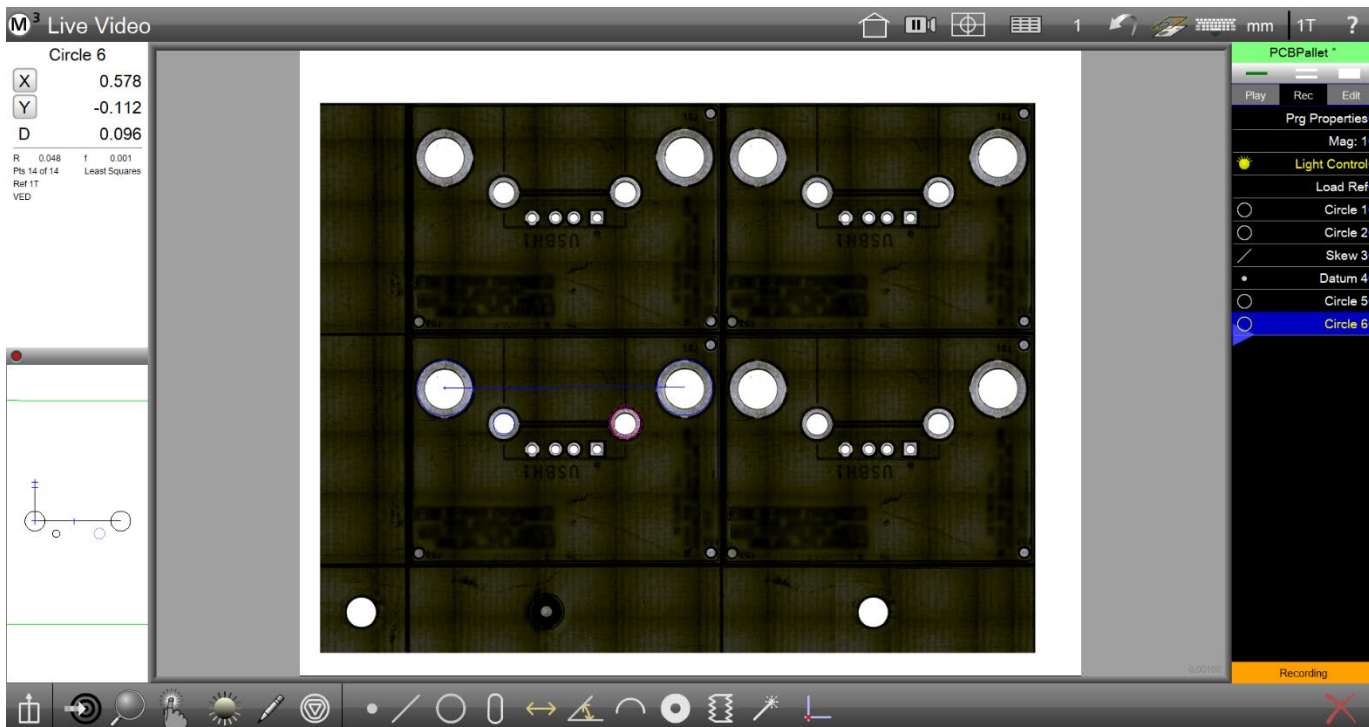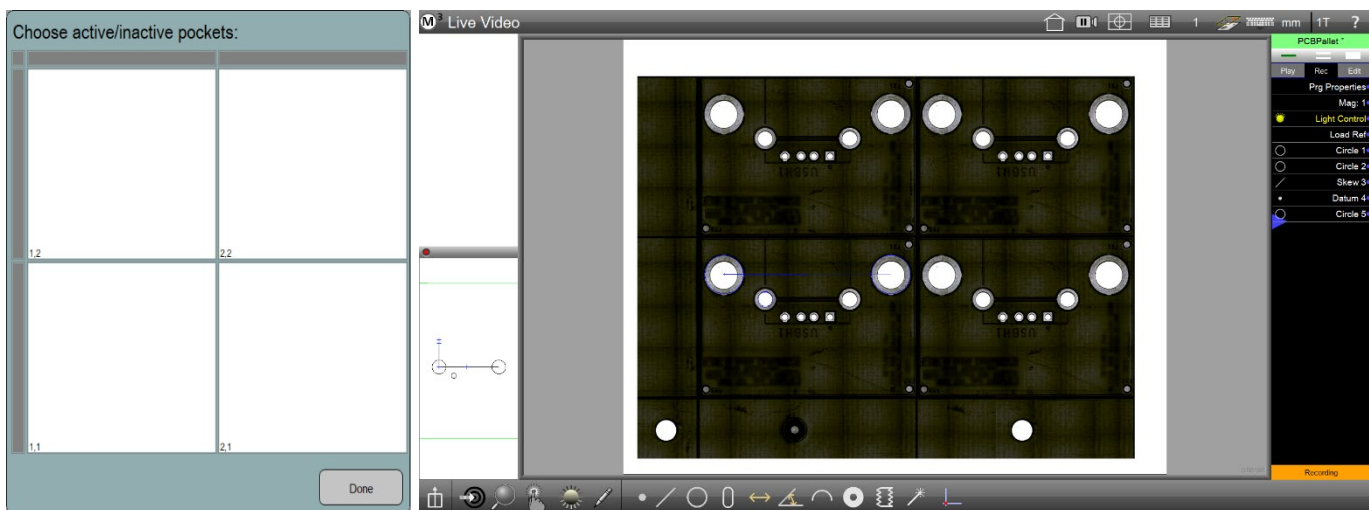

## Section 12: Field of View (FOV)

Field of view systems perform measurements on parts located entirely within a fixed video field of view. Feature dimensions and locations are determined by the pixel resolution of the video system. Measurement activities are automatically recorded as part programs in all M3 systems. Part programs can be played back manually or automatically without the need for part registration measurements performed by the user. Programs can measure single or multiple identical parts placed within the field of view.

### M3 Measurement and Other Functions

Part measurement sessions can include measuring features, constructing features, applying tolerances, reporting results and other activities. The probes, user interface screens and other M3 functions described earlier in this guide serve as a reference for field of view system operation. Please familiarize yourself with M3 functions before proceeding. Discussions in the remainder of this section assume a basic working knowledge of the M3 system.

### Functions unique to field of view systems

A few important functions are unique to field of view systems:

- Auto Play
- Program Finder
- Motion Monitoring



#### **NOTE**

*Program finder can also be used in non-FOV systems, but not in conjunction with the Auto Play feature.*

### ***Auto Play***

Field of view measurement sessions can be as simple as a quick diameter check, or can include a coordinate system, tolerances, markups, reports and other M3 functions. More complex measurement sessions usually begin with a datum pattern measurement of a part. The datum pattern registers the part and when the completed program is played back using Auto Play, the pattern is recognized and part registration operations by the user are unnecessary.

Automatic program playback is only provided by the Auto Play function when Auto Play recognizes the part pattern and the program is contained in the Program Finder list.

### ***Program Finder***

When Auto Play is not enabled, the user performs a pattern measurement on a part and when the part is contained in the Program Finder list, the program is loaded. The user can then simply run the program. When Auto Play is enabled, the program is played automatically. Only programs contained in the Program Finder list can be loaded or played automatically. Program Finder lists can contain many programs for widely varying parts. Programs can be added to or deleted from the Program Finder list at the user's discretion.

### ***Auto Play Use of the Program Finder***


When a part is placed in the field of view, if its part program was registered with the pattern, Auto Play recognizes the pattern and looks for the corresponding part file in the Program Finder list. If the program is in the list, the part file and the associated runs database are loaded. The program is then played automatically.

## Verifying Auto Play Use of Program Finder

Auto Play must use the Program Finder list if Auto Play will be used to load or play programs. To confirm the use of Program Finder:

- 1 Open a new part and then open the Programs Settings screen.

**System toolbar > M3 menu > Settings > Programs**

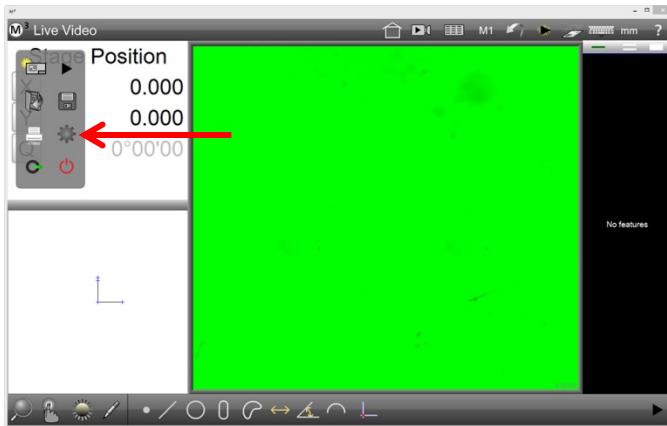


- 2 Verify that the Auto Play Using Program Finder is set to Yes.
- 3 Press Done twice to exit the Settings screens.

## **Motion Monitor**

The Motion Monitor launches the Auto Play function when any motion is detected in the field of view:

- One or more parts are placed in the field of view
- Part positions are changed

The Auto Play function then performs pattern recognition to identify a familiar part.

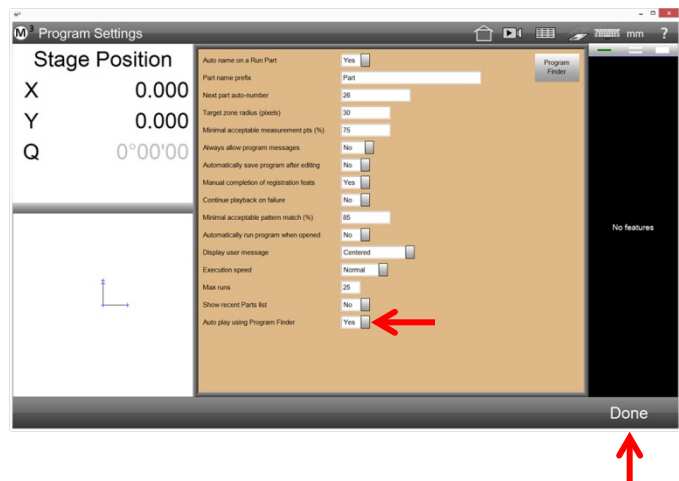

## **Operation Example**

The following example includes:

- Measuring and saving a part program
- Playing a part program without Program Finder
- Adding a part to the Program Finder list
- Playing programs using Program Finder and Auto Play
- Playing Programs to Measure Multiple Identical Parts

## **Measuring and Saving A Part Program**



To measure and save a part:

- 1 Place a part in the field of view and measure (teach) a datum pattern. This pattern will be used in program playback to register the part.

**Measure toolbar > Datum > Datum pattern**





# Video Inspection Software User's Guide

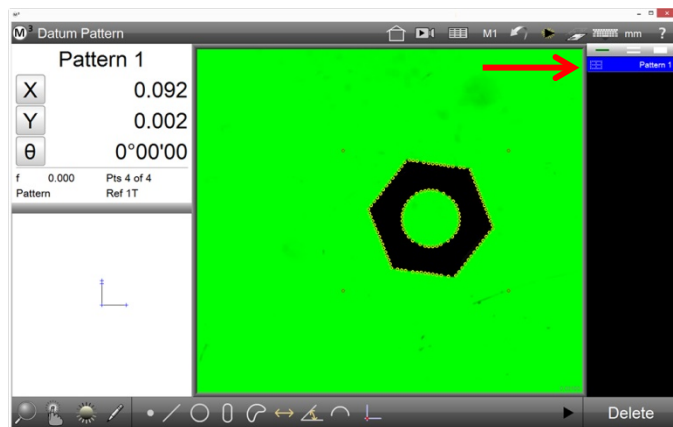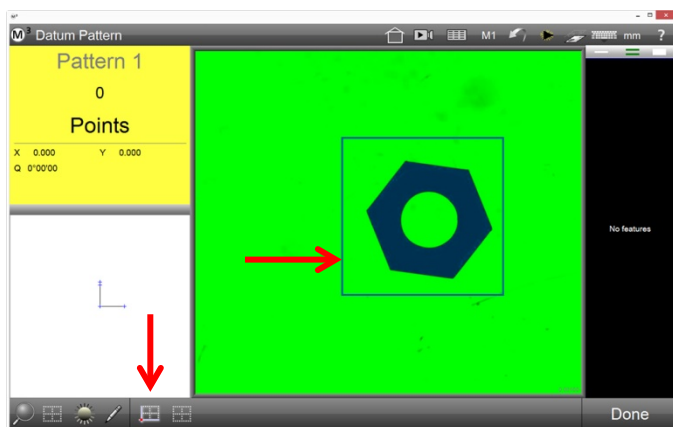

2 Measure part features and perform functions as desired. In this example:

- The flat closest to the horizontal was used to skew the part
- The whole center was used as a zero datum
- An angle was constructed
- A tolerance was applied to the circle
- The part view was marked up

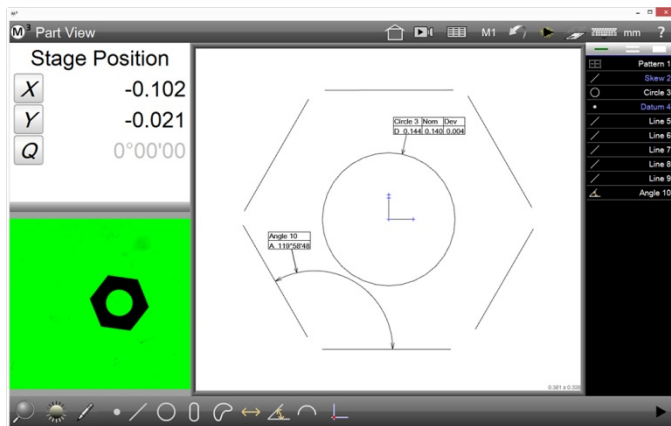
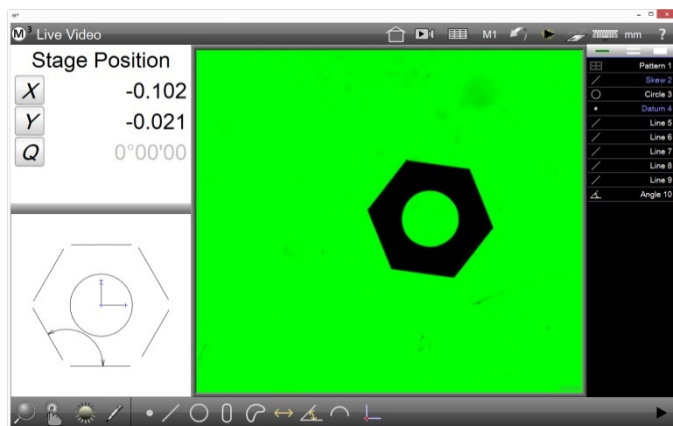


3 Play the program to verify its correct operation and save it.

**Measure toolbar > Play button**


**Feature list > Edit tab**

**System toolbar > M3 menu > Save button**

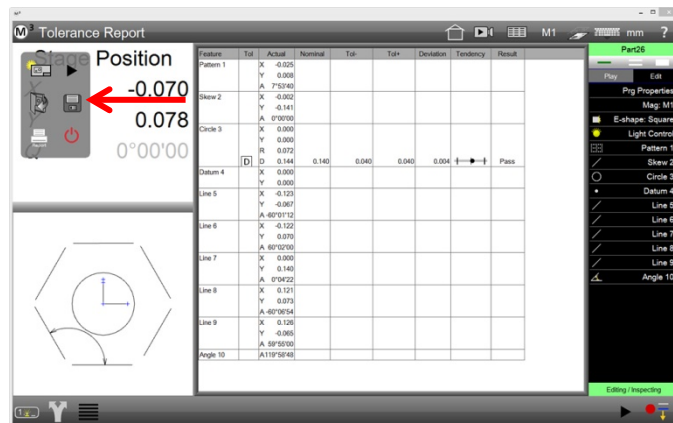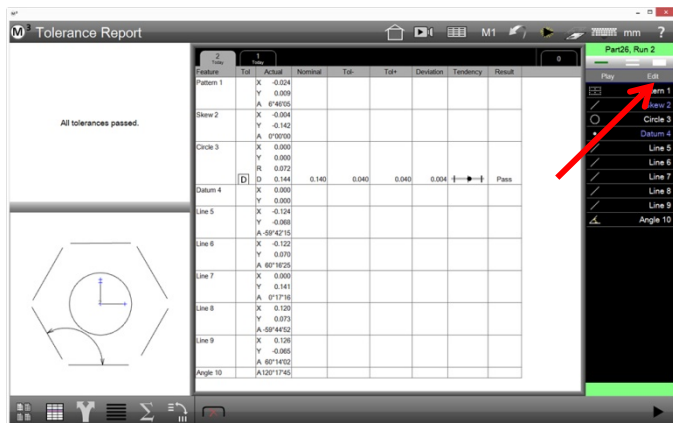

# Video Inspection Software User's Guide

- The Save Part File dialog will be displayed. Name the part file and press Save.

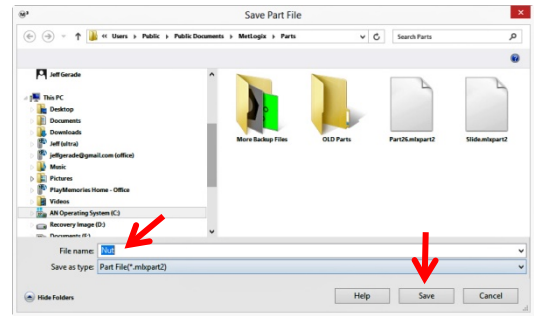

## Playing a Part Program without Program Finder

Programs, in the form of measurement, tolerance and other software operations are played as a sequence of program steps. When a saved part is opened, the Feature List will become populated with features that were stored in the part file the last time the file was used and either:

- A tabbed database of measurement results will be shown for a program that has been run to measure features



OR

- The original program feature data will be displayed for a program that was never run to measure features


To load and play a part program:

- Press Open Part File to display the Open Part File dialog.
- Select the desired part file and press Open.

**System menu > M3 menu > Open Part File**

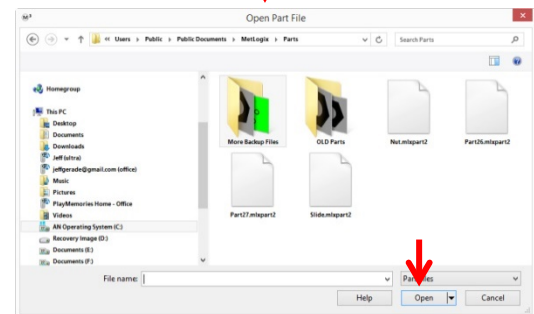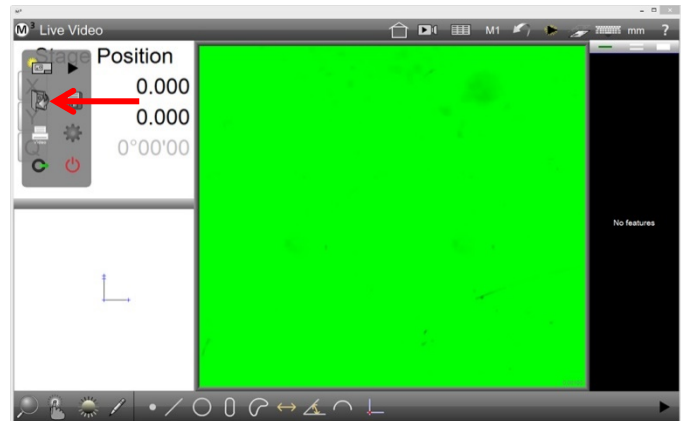

- Press Play to play the part program file.

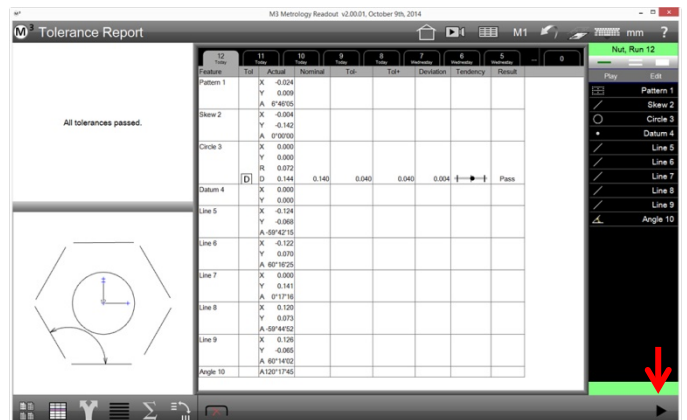



## ***Adding a Part to the Program Finder***

The part program must be added to the Program Finder list before the system can load the program automatically when the part pattern is recognized in the field of view. The part can be added:

- With Auto Play button displayed

OR

- Without Auto Play button displayed

## ***Adding a Part Program with Auto Play***

Auto Play runs a part program automatically when the part pattern is recognized in the field of view. When Auto Play is displayed in the System toolbar, the Auto Play function is shown either enabled or disabled.

If the Auto Play button is not displayed, use the *Adding a Part Without Auto Play* procedure discussed in the next paragraphs. If the Auto Play button is displayed, in either enabled or disabled mode, use this procedure to add a part to the Program Finder. To add the part:




**Enabled**





**Disabled**

- 1 Long-press either Auto Play button to display the Program Finder Settings screen.


**System toolbar > Long-press  
Auto Play**

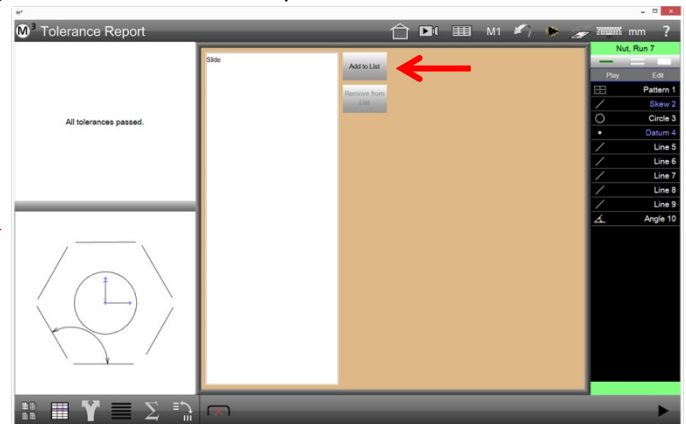

- 2 Press the Add button to display the Open Part File dialog, select the program and press Open. The program will be added to the Program Finder list.

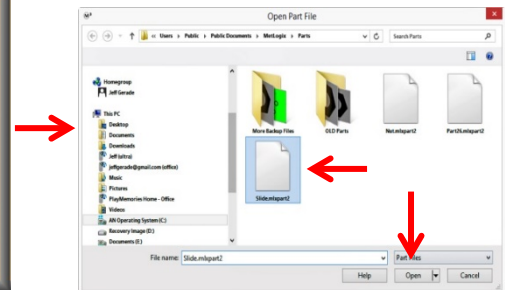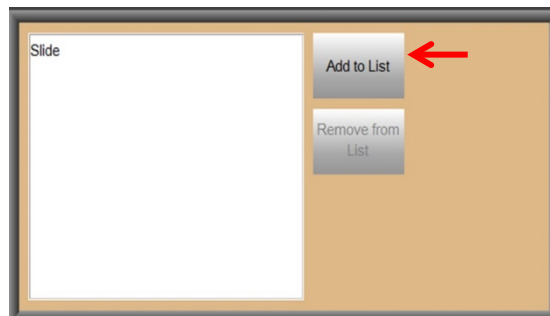

- 3 Press Done to exit from the Settings screens  
**Measure toolbar > Done**

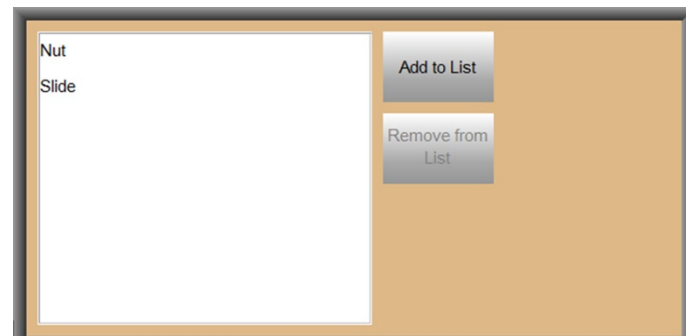

# Video Inspection Software User's Guide

## Adding a Part Program without Auto Play

Auto Play runs a part program automatically when the part pattern is recognized in the field of view. When Auto Play is displayed in the System toolbar, the Auto Play function is shown either enabled or disabled.



Enabled



Disabled




To add a part to the Part Finder when the Auto Play button is not displayed in either enabled or disabled modes:

- 1 Press the Settings button to display the Settings screen.



**System toolbar > M3 menu > Close Part button**

**System toolbar > M3 menu > Settings button**

- 2 Press the Programs button to display the Programs Settings screen.
- 3 Press the Program Finder button to display the Program Finder list.

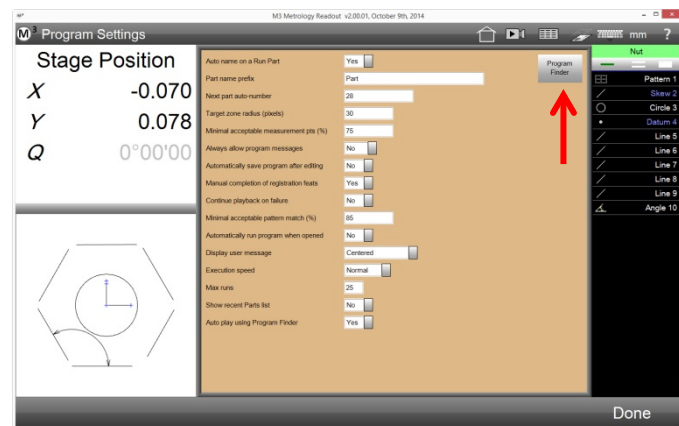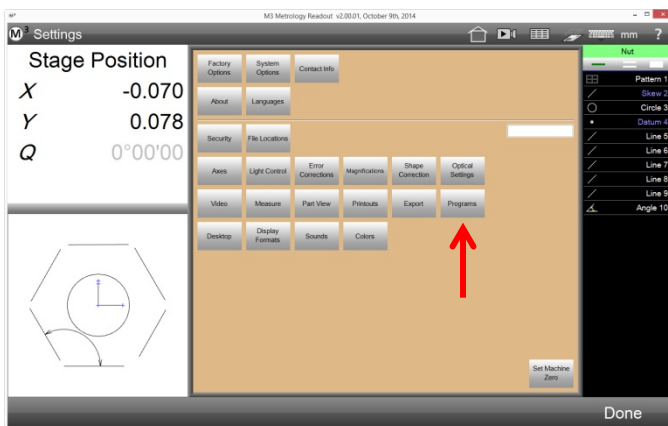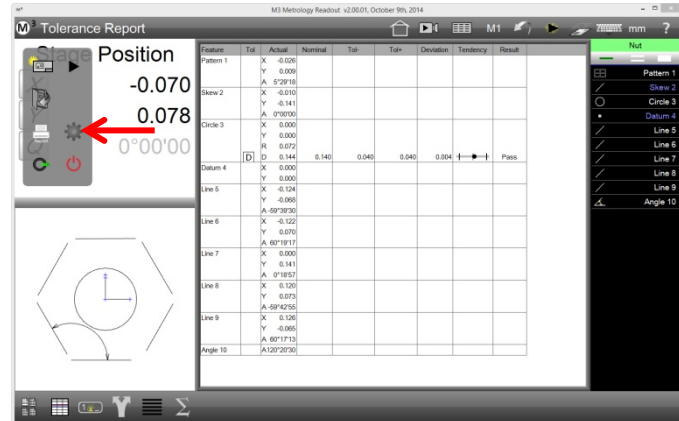


- 4 Press the Add button to display the Open Part File dialog, select the program and press Open. The program will be added to the Program Finder list.

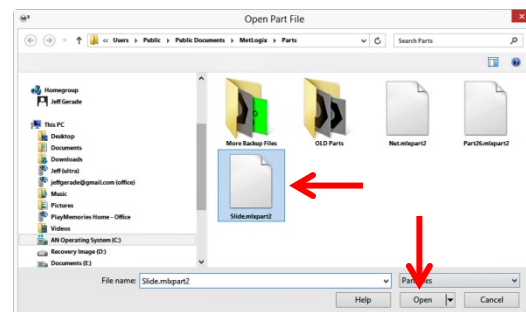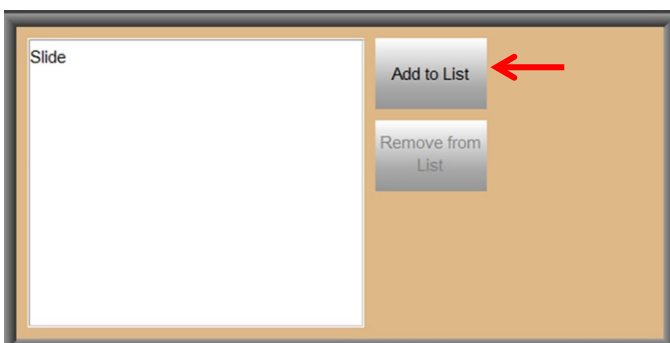

# Video Inspection Software User's Guide

- 5 Press Done to exit from the Settings screens  
**Measure toolbar > Done**

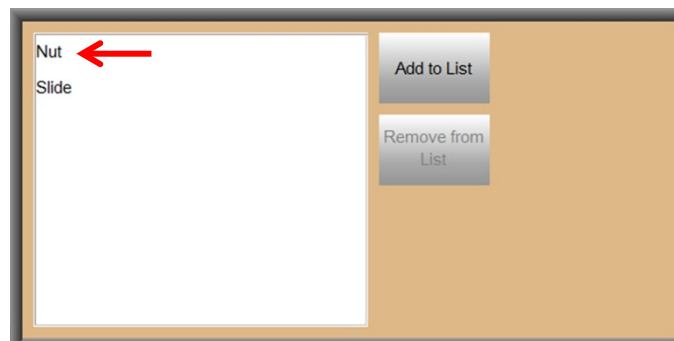

## ***Playing Programs using Program Finder and Auto Play***

Programs played with Program Finder can be played without or with the use of the Auto Play function.



### ***Playing a Program Without Auto Play***

When programs are played using Program Finder but not using Auto Play:

- User places part in the field of view
- User probes the part with the Pattern Datum Probe
- System recognizes pattern and loads the program with the runs database
- User runs the program

To play a program without Auto Play:

- 1 Place the part into the field of view and probe the part with the Pattern Datum probe.

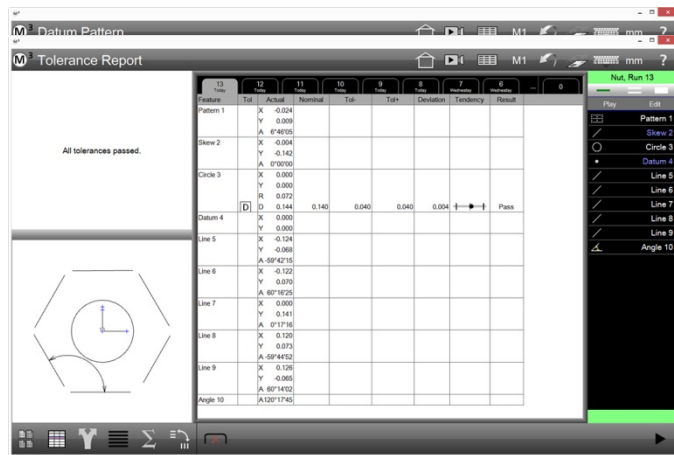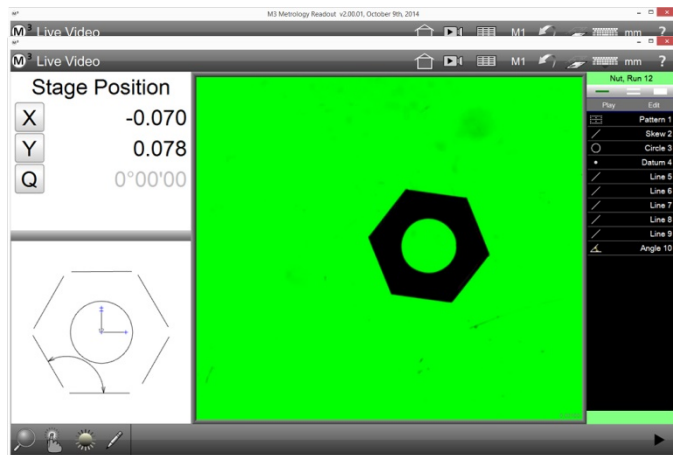

- 2 The pattern will be recognized, and the appropriate program will be loaded. Press Play to play the program.

### ***Playing a Program with Auto Play***



When programs are played using Program Finder and Auto Play:

- User places part in the field of view
- System recognizes pattern after Motion Monitor detects movement in the field of view, loads program with runs database and runs the program.

# Video Inspection Software User's Guide

To play a program using Auto Play:

- 1 Place the part into the field of view. The pattern will be recognized, and the program will be played.

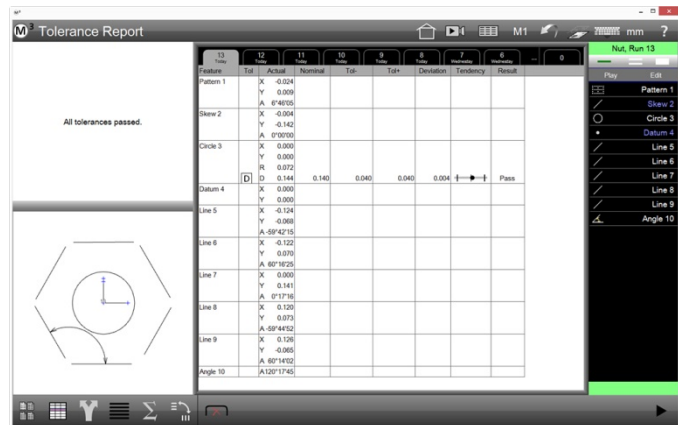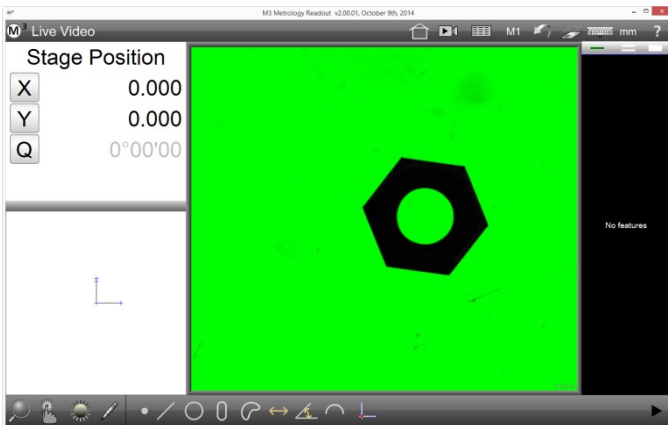



## ***Playing Programs to Measure Multiple Identical Parts***

The concepts and procedures described for playing programs to measure single parts using the Program Finder and Auto Play also apply to the measurement of multiple identical parts. However, before playing a program to measure multiple parts, the program properties configuration settings must be edited.

## ***Editing Program Properties to Measure Multiple Parts***





To edit program properties:

- 1 Load the desired program and then press the Edit tab to display the program steps.

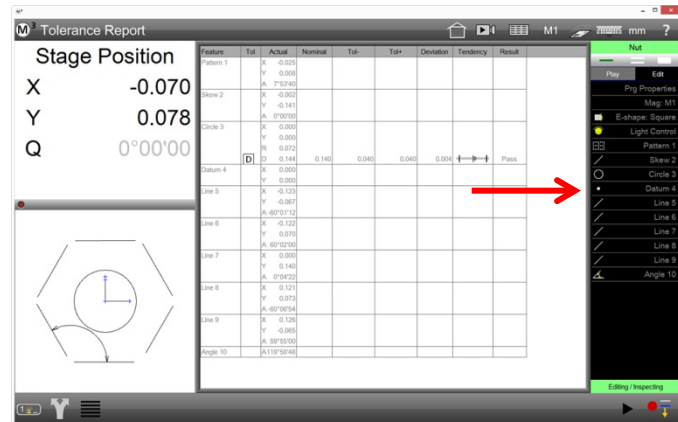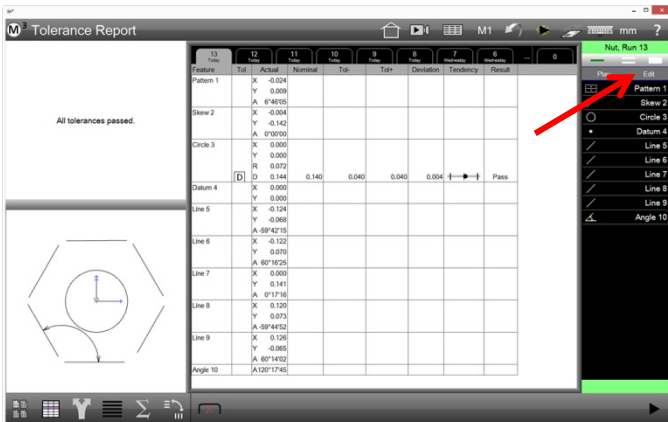

- 2 Press Program Properties to display the program configuration settings and then set the Multiple Parts in Field of View to Yes.
- 3 Press done to exit Program Properties and then press Save to save the configuration change.
- 4 Press the Edit tab again to Exit the edit mode and then verify that Auto Play is toggled to enabled.



# Video Inspection Software User's Guide

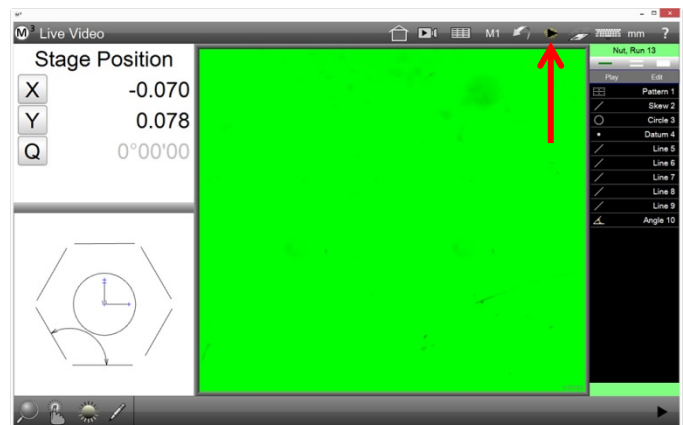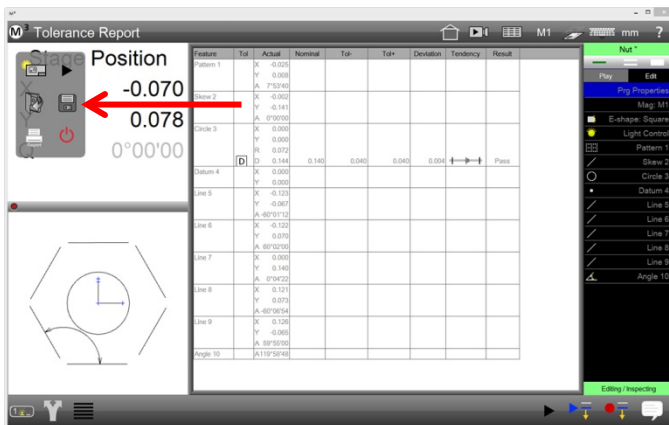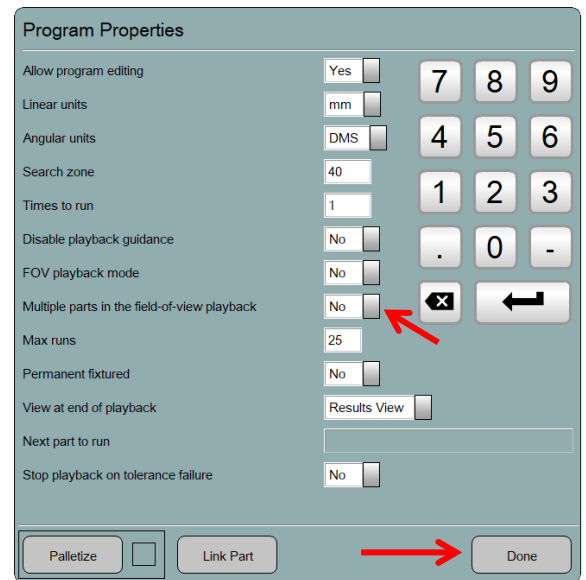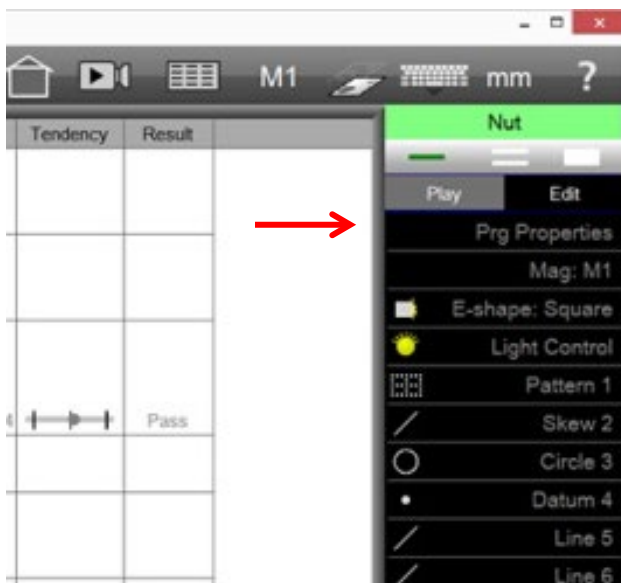

## **Playing the Program with Multiple Parts**


To play a program to measure multiple parts:

- 1 Place the parts into the field of view. The pattern will be recognized, and the program will be played. The tabs in the Results view for the run of multiple parts will be connected. The run identification numbers will be shown on the run tab and in the part view.

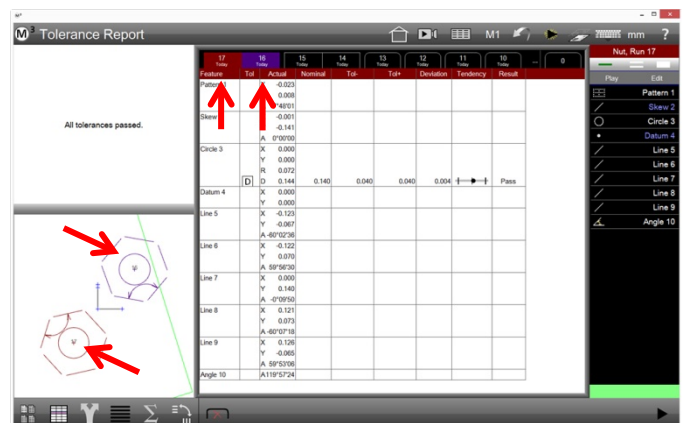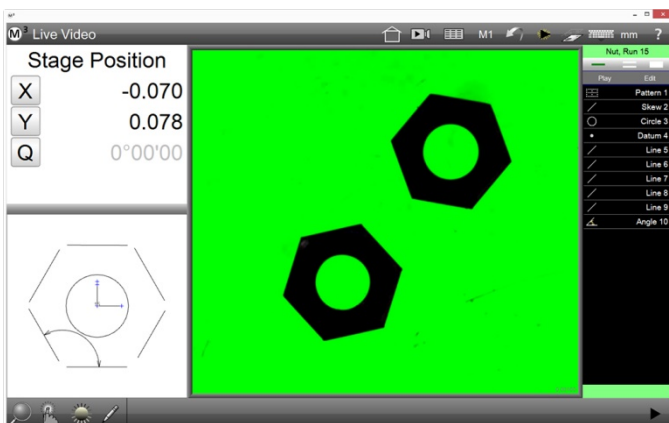

# Video Inspection Software User's Guide

Run identification numbers and markups created in the program will be shown in the enlarged Part View screen.

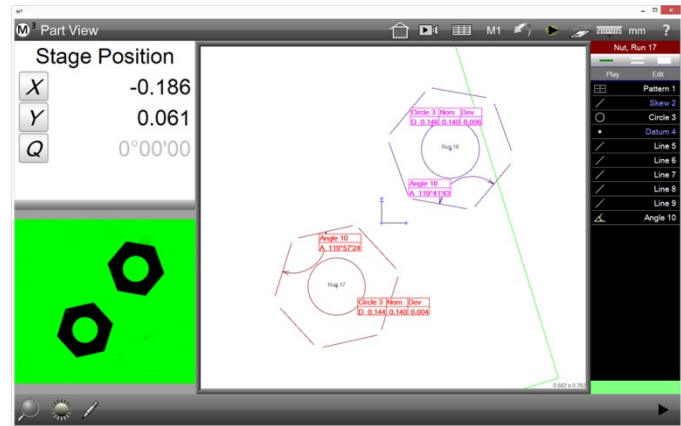

## Product Warranty

This product is warranted against defects in workmanship, material and design for two (2) years from date of delivery to the extent that METLOGIX will, at its sole option, repair or replace the product or any part thereof which is defective, provided, however, that this warranty shall not apply to products subjected to tampering or, abuse, or exposed to highly corrosive conditions.

THIS WARRANTY IS IN LIEU OF ALL OTHER WARRANTIES WHETHER EXPRESS OR IMPLIED AND METLOGIX HEREBY DISCLAIMS ALL OTHER WARRANTIES, INCLUDING, WITHOUT LIMITATION, ANY WARRANTY OF FITNESS FOR A PARTICULAR PURPOSE OR MERCHANTABILITY. METLOGIX SHALL NOT BE LIABLE FOR ANY INCIDENTAL OR CONSEQUENTIAL DAMAGES, INCLUDING, BUT NOT LIMITED TO, ANY ANTICIPATED OR LOST PROFITS.

This warranty is voidable if the purchaser fails to follow any and all instructions, warnings or cautions in the product's Instruction Manual.

If a manufacturing defect is found, METLOGIX will replace or repair the product or replace any defective part thereof without charge; however, METLOGIX's obligation hereunder does not include the cost of transportation which must be borne by the customer. METLOGIX assumes no responsibility for damage in transit, and any claims for such damage should be presented to the carrier by the purchaser.





# SOFTWARE LICENSE AGREEMENT

NOTICE TO USER: PLEASE READ THIS AGREEMENT CAREFULLY. BY COPYING, INSTALLING, OR USING ALL OR ANY PORTION OF THE SOFTWARE, YOU ACCEPT ALL TERMS AND CONDITIONS OF THIS AGREEMENT, INCLUDING, IN PARTICULAR THE PROVISIONS ON: TRANSFERABILITY IN SECTION 4; WARRANTY IN SECTIONS 6 AND 7; AND LIABILITY IN SECTION 8. YOU AGREE THAT THIS AGREEMENT IS LIKE ANY WRITTEN NEGOTIATED AGREEMENT SIGNED BY YOU. THIS AGREEMENT IS ENFORCEABLE AGAINST YOU AND ANY LEGAL ENTITY THAT OBTAINED THE SOFTWARE AND ON WHOSE BEHALF IT IS USED; FOR EXAMPLE, IF APPLICABLE, YOUR EMPLOYER. IF YOU DO NOT AGREE TO THE TERMS OF THIS AGREEMENT, DO NOT USE THIS SOFTWARE.

METLOGIX AND ITS SUPPLIERS OWN ALL INTELLECTUAL PROPERTY IN THE SOFTWARE. THE SOFTWARE IS LICENSED, NOT SOLD. METLOGIX PERMITS YOU TO COPY, DOWNLOAD, INSTALL, USE, OR OTHERWISE BENEFIT FROM THE FUNCTIONALITY OR INTELLECTUAL PROPERTY OF THE SOFTWARE ONLY IN ACCORDANCE WITH THE TERMS OF THIS AGREEMENT. USE OF SOME METLOGIX AND SOME NON-METLOGIX MATERIALS AND SERVICES INCLUDED IN OR ACCESSED THROUGH THE SOFTWARE MAY BE SUBJECT TO OTHER TERMS AND CONDITIONS TYPICALLY FOUND IN A SEPARATE LICENSE AGREEMENT, TERM OF USE OR "READ ME" FILE LOCATED WITHIN OR NEAR SUCH MATERIALS AND SERVICES.

THE SOFTWARE MAY INCLUDE TECHNOLOGY DESIGNED TO PREVENT UNAUTHORIZED USE AND COPYING. THIS TECHNOLOGY MAY CAUSE YOUR COMPUTER TO CONNECT TO THE INTERNET WITHOUT NOTICE ON INSTALL, LAUNCH, AND ON AN INTERMITTENT OR REGULAR BASIS THEREAFTER. ONCE CONNECTED, THE SOFTWARE WILL TRANSMIT INFORMATION TO METLOGIX VIA AN INTERNET CONNECTION. METLOGIX MAY USE THE TRANSMITTED INFORMATION, AS WELL AS OTHER INFORMATION YOU OR OUR THIRD PARTIES MAY PROVIDE TO US, TO DETECT OR PREVENT USE OF METLOGIX SOFTWARE THIS IS FRAUDULENT, NOT VALIDLY LICENSED, OR NOT USED IN ACCORDANCE WITH A VALID LICENSE. SOFTWARE THAT FAILS TO CONNECT TO METLOGIX AND SOFTWARE THAT CONNECTS TO METLOGIX WHOSE USE IS FOUND TO NOT TO BE PERMITTED MAY OFFER ONLY LIMITED FUNCTIONALITY OR MAY NOT OPERATE AT ALL.

# 1. Definitions

“MetLogix” means MetLogix, Incorporated, a Delaware corporation, 175 Canal Street, Manchester, New Hampshire 03101.

“MetLogix Runtime(s)” means MetLogix M3, MetLogix M2, MetLogix M1, MetLogix L3, MetLogix L2, MetLogix L1, MetLogix Test Builder, or MetLogix CFR21.

“Computer” means a virtual or physical computer device that accepts information in digital or similar form and manipulates it for a specific result based on a sequence of instructions.

“Internal Network” means a private, proprietary network resource accessible only by employees and individual contractors (i.e., temporary employees) or a specific corporation or similar business entity. Internal Network does not include portions of the Internet or any other network community open to the public, such as membership or subscription driven groups, associations, and similar organizations.

“Output File” means an output file you created with the Software.

“Permitted Number” means one (1) unless otherwise indicated under a valid license (e.g., volume license) granted by MetLogix.

“Software” means (a) all of the information with which this agreement is provided, including but not limited to: (i) all software files and other computer information.

## 2. Software License

If you obtained the Software and any required serial number(s) from MetLogix or one of its authorized licensees (resellers) and as long as you comply with the terms of this Agreement, MetLogix grants you a non-exclusive license to install and use the Software in a manner consistent with its design and Documentation and as further set forth below.

### 2.1 *Limited Use*

#### 2.1.1

The Software, or portions of the Software, may allow installation and use without a serial number. If so, you may install but not use such non-serialized Software on any number of Computers as part of an organizational deployment plan. Further, you may install and use such non-serialized Software on any number of Computers for demonstration, evaluation, and training purposes only and only if any Output Files or other material produced through such use are used only for internal, non-commercial, and non-production purposes. You may not use such non-serialized Software after any applicable timeout period has ended, unless you input a valid serial number. ACCESS TO AND USE OF ANY OUTPUT FILES CREATED WITH SUCH NON-SERIALIZED SOFTWARE IS ENTIRELY AT YOUR OWN RISK.

#### 2.1.2

The Software, or portions of the Software, that are provided with a serial number designated for “evaluation purposes” or other similar designation (such as Software or a serial number supplied as “EVAL” under a separate ordering document) and that includes an expiration date (“Evaluation Software”) may only be installed and used on Computers for demonstration, evaluation, and training purposes only and only if Output Files or other materials produced through such use are used only for internal, non-commercial, and non-production purposes. The Evaluation Software will automatically time out with or without prior notice. You may not use such Evaluation Software after any applicable time-out period has ended, unless you input a valid serial number. USE OF ANY OUTPUT FILES CREATED WITH SUCH NON-SERIALIZED SOFTWARE IS ENTIRELY AT YOUR OWN RISK.

### ***2.1.3 General Use***

Except as described otherwise herein, you may install and use one (1) copy of the Software in accordance with the Documentation only on the Permitted Number of your compatible Computers into which you enter a valid serial number.

### ***2.1.4 Distribution from a Server***

The Software may not be distributed from a Server or an Internal Network.

### ***2.1.5 Dual Boot Platform***

The Software is licensed for use on a specific operating system platform. You must purchase a separate license for use of the Software on each operating system platform.

### ***2.1.6 Documentation***

You may make copies of the Documentation for your own internal use in connection with use of the Software in accordance with this Agreement but no more than the amount reasonably necessary. Any permitted copy of the Documentation that you make must contain the same copyright and other proprietary notices that appear on or in the Documentation.

## **3. Intellectual Property Ownership**

The Software and any authorized copies that you make are the intellectual property of and are owned by MetLogix Incorporated. The structure, organization, and source code of the Software are the valuable trade secrets and confidential information of MetLogix Incorporated. The Software is protected by law, including but not limited to the copyright laws of the United States and other countries, and by international treaty provisions. Except as expressly stated herein, this Agreement does not grant you any intellectual property rights in the Software and all rights not expressly granted are reserved by MetLogix Incorporated.

## **4. Restrictions and Requirements**

### ***4.1 Notices***

Any permitted copy of the Software that you make must contain the same copyright and other proprietary notices that appear on or in the Software.

### ***4.2 Use Obligations***

You agree that you will not use the Software other than as permitted by this Agreement and that you will not use the Software in a manner inconsistent with its design or Documentation.

### ***4.3 No Modifications***

You may not modify, port, adapt, or translate the Software.

### ***4.4 No Reverse Engineering***

You will not reverse engineer, decompile, disassemble, or otherwise attempt to discover the source code of the Software.

### ***4.5 No Unbundling***

The Software may include various applications, utilities, and components, may support multiple platforms and languages, and may be provided to you on multiple media or in multiple copies. Nonetheless, the Software is designed and provided to you as a single product to be used as a single produce on Computers permitted by Section 2. You are not required to install all component parts of the Software, but you may not unbundle the component parts of the Software for use on different Computers. You may not unbundle or repackage Software for distribution, transfer, or resale.

## ***4.6 No Transfer***

YOU WILL NOT RENT, LEASE, SELL, SUBLICENSE, ASSIGN OR TRANSFER YOUR RIGHTS IN THE SOFTWARE, OR AUTHORIZE ANY PORTION OF THE SOFTWARE TO BE COPIED ONTO ANOTHER INDIVIDUAL OR LEGAL ENTITY'S COMPUTER EXCEPT AS MAY BE EXPRESSLY PERMITTED HEREIN. You may, however, permanently transfer all your rights to use the Software to another individual or legal entity provided that: (a) you also transfer (i) this agreement, (ii) the serial number(s), the Software affixed to media provided by MetLogix or its authorized distributor, and all other software or hardware bundled, packaged, or pre-installed with the Software, including all copies, Updates, and Prior Versions (as defined in Section 5); (b) you retain no Updates, Prior Versions, or copies, including backups and copies stored on a Computer; and (c) the receiving party accepts the terms and conditions of this agreement and any other terms and conditions under which you purchased a valid license to the Software. NOTWITHSTANDING THE FOREGOING, YOU MAY NOT TRANSFER EDUCATION, PRE-RELEASE, EVALUATION SOFTWARE, OR NOT FOR RESALE COPIES OF THE SOFTWARE OR SOFTWARE OBTAINS UNDER A METLOGIX VOLUME LICENSE PROGRAM EXCEPT AS MAY BE EXPRESSLY PERMITTED BY METLOGIX WITH THE TERMS OF A VOLUME LICENSE PROGRAM.

## ***4.7 No Service Bureau***

You will not use or offer the Software on a service bureau basis.

## ***4.8 MetLogix M Series Restrictions***

You may not use MetLogix M Series software on any non-PC device or with any embedded or device version of any operating system.

# **5. Updates**

If the Software is an Update to a prior version of MetLogix software (the "Prior Version"), the following apply:

Your use of this Update is conditional upon your retention of the Prior Version. Therefore, if you validly transfer this Update pursuant to Section 4.6, you must transfer the Prior Version along with it. If you wish to use this Update in addition to the Prior Version, you may only do so on the same computer on which you have installed and are using the Prior Version. Any obligation that MetLogix may have to support Prior Versions may end upon the availability of this Update. No other use of the Update is permitted. Additional Updates may be licensed to you by MetLogix with additional or different items.

# **6. Limited Warranty**

MetLogix warrants to the individual or entity that first purchases a license for the Software for use pursuant to the terms of this agreement that the Software will perform substantially in accordance with the Documentation for the ninety (90) day period following receipt of the Software when used on the recommended operating system and hardware configuration. Non-substantial variation of performance from the Documentation does not establish a warranty right. This limited warranty does not apply to the following which are made available "AS-IS" and without warranty from MetLogix: patches, font software; pre-release (beta), trial, starter, evaluation, product sampler, and not for resale (NFR) copies of the Software including but not limited to Evaluation Software. All warranty claims must be made, along with proof of purchase, to MetLogix within such ninety (90) day period. If the Software does not perform substantially in accordance with the Documentation, the entire liability of MetLogix and its affiliates and your exclusive remedy will be limited to either, at MetLogix' option, replacement of the Software or refund of the license fee you paid for the Software (if any). THE LIMITED WARRANTY SET FORTH IN THIS SECTION GIVES YOU SPECIFIC LEGAL RIGHTS. YOU MAY HAVE ADDITIONAL RIGHTS UNDER LAW WHICH VARY FROM JURISDICTION TO JURISDICTION. METLOGIX DOES NOT SEEK TO LIMIT YOUR WARRANTY RIGHTS TO ANY EXTENT NOT PERMITTED BY LAW.

## 7. Disclaimer

THE LIMITED WARRANTY IN SECTION 6 IS THE ONLY WARRANTY OFFERED BY METLOGIX, ITS AFFILIATES, AND SUPPLIERS AND IT STATES THE SOLE AND EXCLUSIVE REMEDIES FOR METLOGIX', ITS AFFILIATES', OR SUPPLIERS' BREACH OF THAT OFFERED WARRANTY. THE LIMITED WARRANTY IN SECTION 6 AND ANY STATUTORY WARRANTY AND REMEDY THAT CANNOT BE EXCLUDED OR LIMITED UNDER LAW ARE THE ONLY WARRANTIES APPLICABLE TO THE SOFTWARE. OTHER THAN THOSE OFFERED AND STATUTORY WARRANTIES APPLICABLE TO THE SOFTWARE, METLOGIX, ITS AFFILIATES, SUPPLIERS, AND CERTIFICATE AUTHORITIES DISCLAIM ALL WARRANTIES, CONDITIONS, REPRESENTATIONS, AND TERMS, EXPRESSED OR IMPLIED, WHETHER BY STATUTE, COMMON LAW, CUSTOM, USAGE, OR OTHERWISE AS TO ANY MATTER, INCLUDING BUT NOT LIMITED TO PERFORMANCE, SECURITY, NON-INFRINGEMENT OF THIRD PARTY RIGHTS, INTEGRATION, MERCHANTABILITY, SATISFACTORY QUALITY, AND FITNESS FOR ANY PARTICULAR PURPOSE. OTHER THAN SUCH OFFERED AND STATUTORY WARRANTIES AND REMEDIES, METLOGIX, ITS AFFILIATES, SUPPLIERS, AND CERTIFICATE AUTHORITIES PROVIDE THE SOFTWARE AND ACCESS TO ANY WEBSITES, METLOGIX OR THIRD-PARTY ONLINE SERVICES, AND CERTIFICATE AUTHORITY SERVICES AS-IS AND WITH ALL FAULTS. THIS DISCLAIMER OF WARRANTY MAY NOT BE VALID IN SOME JURISDICTIONS. YOU MAY HAVE ADDITIONAL WARRANTY RIGHTS UNDER LAW WHICH MAY NOT BE WAIVED OR DISCLAIMED. METLOGIX DOES NOT SEEK TO LIMIT YOUR WARRANTY RIGHTS TO ANY EXTENT NOT PERMITTED BY LAW.

## 8. Limitation of Liability

EXCEPT FOR THE EXCLUSIVE REMEDY OFFERED BY METLOGIX ABOVE AND ANY REMEDIES THAT CANNOT BE EXCLUDED OR LIMITED UNDER LAW, METLOGIX, ITS AFFILIATES, SUPPLIERS AND CERTIFICATE AUTHORITIES WILL NOT BE LIABLE TO YOU FOR ANY LOSS, DAMAGES, CLAIMS, OR COSTS WHATSOEVER INCLUDING ANY CONSEQUENTIAL, INDIRECT OR INCIDENTAL DAMAGES, ANY LOST PROFITS OR LOST SAVINGS, ANY DAMAGES RESULTING FROM BUSINESS INTERRUPTION, PERSONAL INJURY OR FAILURE TO MEET ANY DUTY OF CARE, OR CLAIMS BY THIRD PARTY, EVEN IF ANY METLOGIX REPRESENTATIVE HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH LOSS, DAMAGES, CLAIMS, OR COSTS. IN ANY EVENT, METLOGIX' AGGREGATE LIABILITY AND THAT OF ITS AFFILIATES, SUPPLIERS, AND CERTIFICATE AUTHORITIES UNDER OR IN CONNECTION WITH THIS AGREEMENT WILL BE LIMITED TO THE AMOUNT PAID FOR THE SOFTWARE, IF ANY. THIS LIMITATION WILL APPLY EVEN IN THE EVENT OF A FUNDAMENTAL OR MATERIAL BREACH OR A BREACH OF THE FUNDAMENTAL OR MATERIAL TERMS OF THIS AGREEMENT

THE FOREGOING LIMITATIONS AND EXCLUSIONS APPLY TO THE EXTENT PERMITTED BY APPLICABLE LAW IN YOUR JURISDICTION. THIS LIMITATION OF LIABILITY MAY NOT BE VALID IN SOME JURISDICTIONS. YOU MAY HAVE RIGHTS THAT CANNOT BE WAIVED UNDER CONSUMER PROTECTION AND OTHER LAWS. METLOGIX DOES NOT SEEK TO LIMIT YOUR WARRANTY OR REMEDIES TO ANY EXTENT NOT PERMITTED BY LAW.

## 9. Export Rules

You acknowledge that the Software is subject to the U.S. Export Administration Regulations and other export laws, restrictions, and regulations (collectively the "Export Laws") and that you will comply with the Export Laws. You will not ship, transfer, export, or re-export the Software, directly or indirectly, to: (a) any countries that are subject to US export restrictions (currently including, but not necessarily limited to, Cuba, Iran, North Korea, Sudan, and Syria) (each, an "Embargoed Country"), (b) any end user who you know or have reason to know will utilize them in design, development or production of nuclear, chemical or biological weapons, or rocket systems, space launch vehicles, and sounding rockets, or unmanned air vehicle systems (each, a "Prohibited Use"), or (c) any end user who has been prohibited from participating in U.S. export transactions by any federal agency of the U.S. government (each, a "Sanctioned Party"). In addition, you are responsible for complying with any local laws in your jurisdiction which may impact your right to import, export or use the Software. You represent and warranty that (i) you are not a citizen of, or located within, an Embargoed Country, (ii) you will not use the Software for a Prohibited Use, and (iii) you are not

a Sanctioned Party. All rights to use the Software are granted on condition that such rights are forfeited if you fail to comply with the terms of this agreement.

## **10. General Provisions**

If any part of this Agreement is found void and unenforceable, it will not affect the validity of the balance of this Agreement, which will remain valid and enforceable according to its terms. This Agreement may only be modified in writing, signed by an officer of MetLogix, Inc. The English version of this Agreement will be the version used when interpreting or construing this Agreement. This is the entire Agreement between MetLogix and you relating to the Software and it supersedes any prior representations, discussion, undertakings, communications, or advertising relating to the Software.

## **11. Notice to U.S. Government End Users**

For U.S. Government End Users, MetLogix agrees to comply with all applicable equal opportunity laws including, if appropriate, the provisions of Executive Order 11246, as amended, Section 402 of the Vietnam Era Veterans Readjustment Assistance Act of 1974 (38 USC 4212), and Section 503 of the Rehabilitation Act of 1973, as amended, and the regulations at 41 CFR Parts 60-1 through 60-60, 60-250, and 60-741. The affirmative action clause and regulations contained in the preceding sentence will be incorporated by reference in this Agreement.

## **12. Compliance with Licenses**

If you are a business, company, or organization, you agree that, in addition to any license compliance checking performed by the Software, MetLogix or its authorized representative have the right, no more than once every twelve (12) months, upon ten (10) days' prior notice to you, to inspect your records, systems, and facilities to verify that your use of any and all MetLogix software is in conformity with your valid licenses from MetLogix. For example, MetLogix has the right to those of your records useful to determine whether installations of the Software have, or have not, been serialized, and you shall provide such records to MetLogix promptly upon request by MetLogix. Additionally, you shall provide MetLogix with all records and information requested by MetLogix in order to verify that your use of any and all MetLogix software is in conformity with your valid licenses from MetLogix within thirty (30) days of MetLogix' request.

## **13. Peer to Peer Communications**

The Software may use your connection to a local area network, without additional notice, automatically connect to other MetLogix software and, in doing so, may indicate on the local area network that it is available for communication with other MetLogix software. These connections may transmit the IP Address of your connection to the local network, but no personally identifiable information is ever transmitted or received through such network connections (except to the extent that IP addresses may be considered personally identifiable in some jurisdictions)