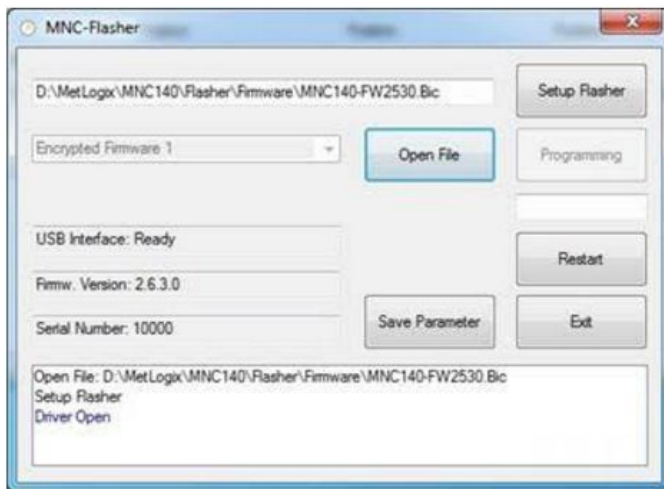This document details a procedure that will potentially resolve JTag errors when trying to update firmware using MNC-Update.exe
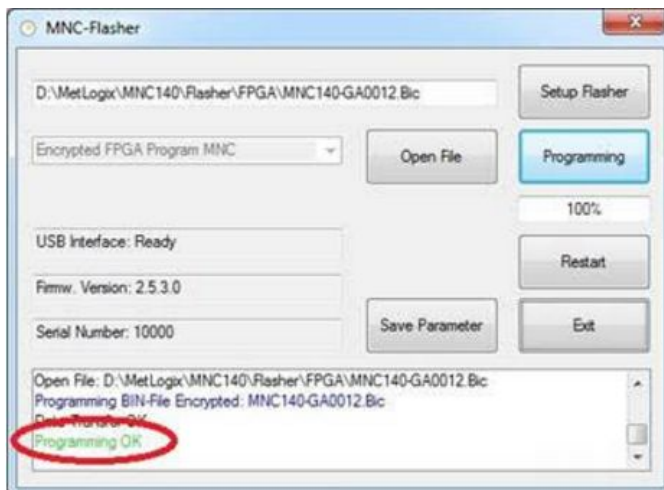
It will require the MNC-Flasher.exe, which loads individual components of the firmware update.
It will also require the following three Bic files:

MNC140-FW2530.Bic
MNC140-GA0012.Bic
MNC140-FW2630.Bic

A)   Roll back to firmware version 2530 (MNC140-FW2530.Bic) using the single flasher



B)   Flash the FPGA (MNC140-GA0012.Bic) with the single flasher



If programming was successful the textbox will show "Programming OK", otherwise you'll get an error message.

C)   If step B) works, update to the current firmware version (MNC140-FW2630.Bic) using the single flasher.